
WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

[RENTAL] VOLVO A40G 752129



RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number	OOW	Client Info	LITTIU/ADTI	VCP447448		
	Sample Date		Client Info		20 Apr 2024		
	Machine Age	hrs	Client Info		571		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	91		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	,	<1		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm	ASTM D5185m	>50	1		
	Lead	ppm	ASTM D5185m	>50	<1		
	Copper	ppm	ASTM D5185m	>300	6		
	Tin	ppm	ASTM D5185m	>50	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon		ACTM DE105	F0	40		
	Potassium	ppm	ASTM D5185m ASTM D5185m		10 3		
There is no indication of any contamination in the fluid.	Water	ppm	WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		4		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m	187	87		
	Barium	ppm	ASTM D5185m		2		
	Molybdenum	ppm	ASTM D5185m		- <1		
	Manganese	ppm	ASTM D5185m		6		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		80		
	Phosphorus	ppm	ASTM D5185m	445	188		
	Zinc	ppm	ASTM D5185m	56	30		
	Sulfur	ppm	ASTM D5185m	1336	1887		
	Visc @ 40°C	cSt	ASTM D445	35.3	125		



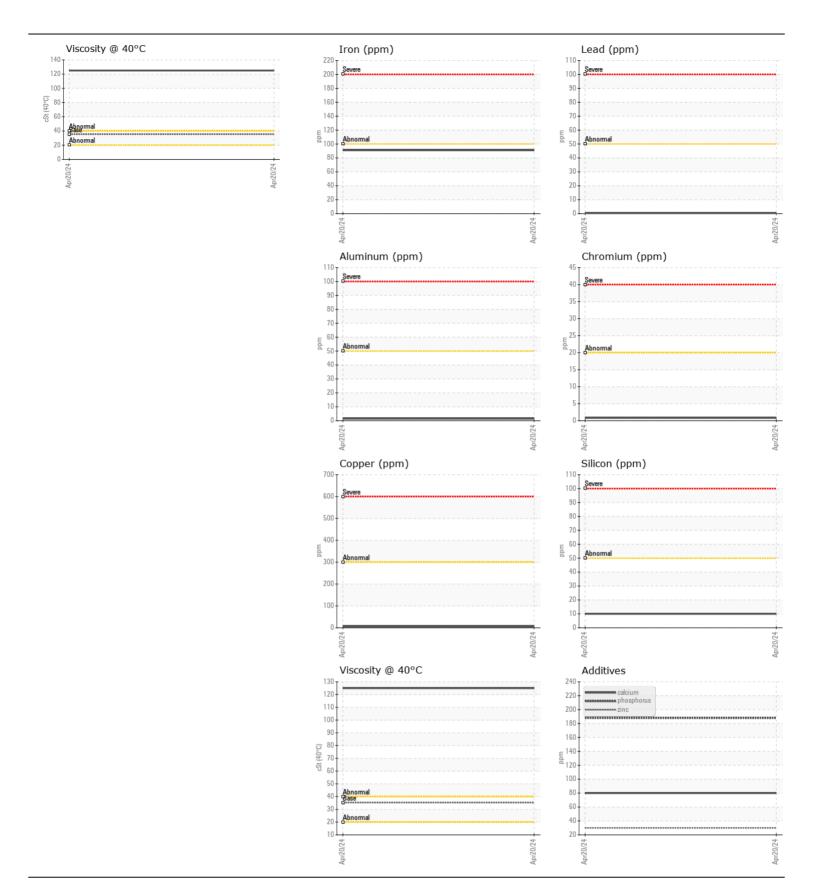

Certificate L2367

Laboratory Sample No.

Test Package : MOB 1

: VCP447448 Lab Number : 06188140 Unique Number : 11044892

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 22 May 2024 **Tested** : 23 May 2024 Diagnosed

: 24 May 2024 - Sean Felton

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619

Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (813)630-2233