



| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
2831 PETERBILT 567
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (48 QTS)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | GFL0103178 | GFL0103173 | GFL0094768 |
| Sample Date | | Client Info | | 21 May 2024 | 27 Mar 2024 | 25 Jan 2024 |
| Machine Age | hrs | Client Info | | 14854 | 14315 | 13753 |
| Oil Age | hrs | Client Info | | 1827 | 1288 | 726 |
| Filter Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Changed | | Client Info | | Not Changd | Not Changd | Not Changd |
| Filter Changed | | Client Info | | N/A | N/A | N/A |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >165 | 10 | 7 | 9 |
| Chromium | ppm | ASTM D5185m | >5 | <1 | <1 | <1 |
| Nickel | ppm | ASTM D5185m | >4 | 0 | <1 | 0 |
| Titanium | ppm | ASTM D5185m | >2 | <1 | 0 | 0 |
| Silver | ppm | ASTM D5185m | >2 | <1 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 2 | 2 | 1 |
| Lead | ppm | ASTM D5185m | >150 | 1 | <1 | <1 |
| Copper | ppm | ASTM D5185m | >90 | 1 | 0 | <1 |
| Tin | ppm | ASTM D5185m | >5 | <1 | 0 | 0 |
| Vanadium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION

There is no indication of any contamination in the oil.


| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >35 | 7 | 6 | 7 |
| Potassium | ppm | ASTM D5185m | >20 | 4 | 2 | <1 |
| Fuel | | WC Method | >3.0 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >7.5 | 0.4 | 0.3 | 0.3 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 7.9 | 8.7 | 8.6 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 19.2 | 19.8 | 19.8 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|-------------|------|------|
| Sodium | ppm | ASTM D5185m | | 4 | 3 | 4 |
| Boron | ppm | ASTM D5185m | 0 | 3 | 5 | 5 |
| Barium | ppm | ASTM D5185m | 0 | 0 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 60 | 62 | 54 | 62 |
| Manganese | ppm | ASTM D5185m | 0 | 0 | 0 | 0 |
| Magnesium | ppm | ASTM D5185m | 1010 | 960 | 908 | 986 |
| Calcium | ppm | ASTM D5185m | 1070 | 1139 | 1025 | 1110 |
| Phosphorus | ppm | ASTM D5185m | 1150 | 1013 | 1004 | 1048 |
| Zinc | ppm | ASTM D5185m | 1270 | 1272 | 1236 | 1246 |
| Sulfur | ppm | ASTM D5185m | 2060 | 3181 | 3404 | 3050 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 14.9 | 16.5 | 16.4 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | 7.6 | 7.9 | 7.9 |
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | 13.4 | 13.2 | 13.2 |


FT-IR (Direct Trend)

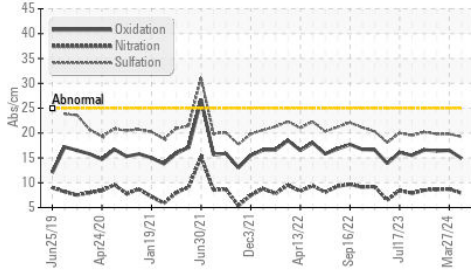


Base Number

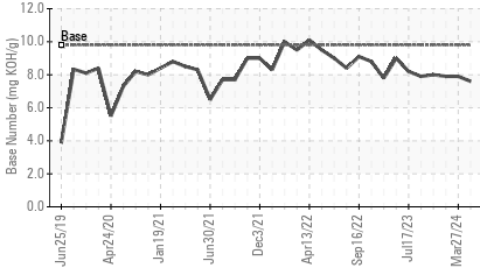


Viscosity @ 100°C

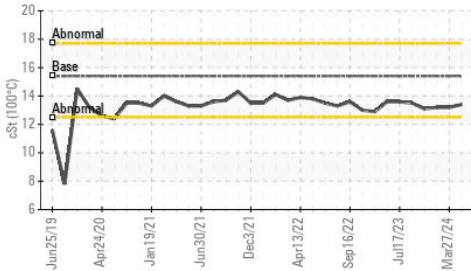


Ferrous Alloys

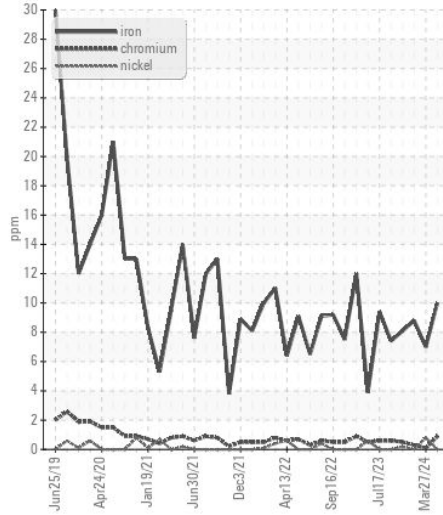


Non-ferrous Metals

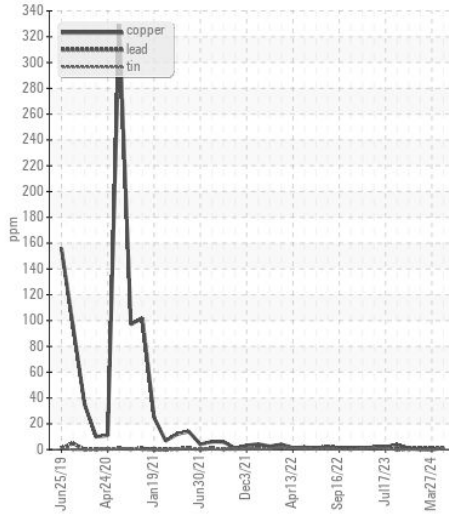

Viscosity @ 100°C

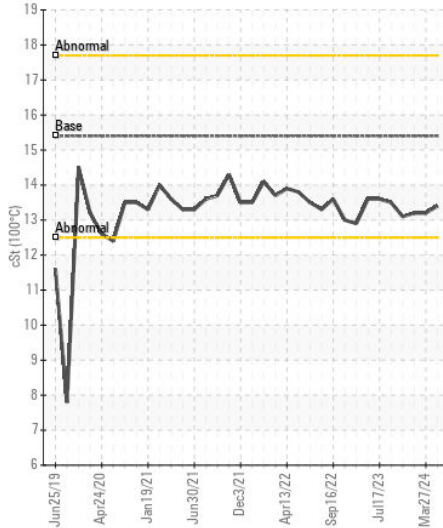

Base Number

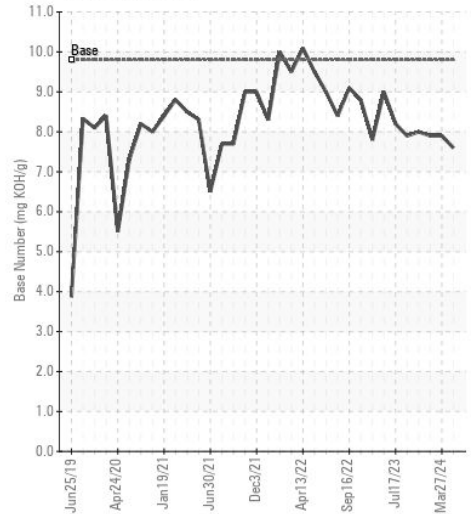

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0103178
Lab Number : 06188769
Unique Number : 11045521
Test Package : FLEET

Received : 23 May 2024
Tested : 24 May 2024
Diagnosed : 24 May 2024 - Wes Davis

GFL Environmental - 001 - Raleigh(CNG)
 3741 Conquest Drive
 Garner, NC
 US 27529

Contact: Craig Johnson
 craig.johnson@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (919)662-7100
 F: (919)662-7130