



Machine Id  
**VOLVO 403**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 10W30 (10 GAL)**

**RECOMMENDATION**

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LW0009180</b>	---	---
Sample Date		Client Info		<b>16 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>36728</b>	---	---
Oil Age	hrs	Client Info		<b>36728</b>	---	---
Filter Age	hrs	Client Info		<b>36728</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>50</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>2</b>	---	---
Nickel	ppm	ASTM D5185m	>2	<b>1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m	>2	<b>7</b>	---	---
Aluminum	ppm	ASTM D5185m	>25	<b>36</b>	---	---
Lead	ppm	ASTM D5185m	>40	<b>1</b>	---	---
Copper	ppm	ASTM D5185m	>330	<b>10</b>	---	---
Tin	ppm	ASTM D5185m	>15	<b>4</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

**CONTAMINATION**










Fuel content negligible. Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. Elemental level of silicon (Si) above normal indicating ingress of seal material.

Silicon	ppm	ASTM D5185m	>25	<b>▲ 75</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>77</b>	---	---
Fuel	%	ASTM D3524	>6.0	<b>0.6</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	*ASTM D7844	>3	<b>0.2</b>	---	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>9.9</b>	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>22.8</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

**FLUID CONDITION**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>2</b>	---	---
Boron	ppm	ASTM D5185m	2	<b>135</b>	---	---
Barium	ppm	ASTM D5185m	0	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m	50	<b>133</b>	---	---
Manganese	ppm	ASTM D5185m	0	<b>5</b>	---	---
Magnesium	ppm	ASTM D5185m	950	<b>726</b>	---	---
Calcium	ppm	ASTM D5185m	1050	<b>1664</b>	---	---
Phosphorus	ppm	ASTM D5185m	995	<b>765</b>	---	---
Zinc	ppm	ASTM D5185m	1180	<b>924</b>	---	---
Sulfur	ppm	ASTM D5185m	2600	<b>2766</b>	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>21.3</b>	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		<b>6.7</b>	---	---
Visc @ 100°C	cSt	ASTM D445	12.00	<b>9.0</b>	---	---

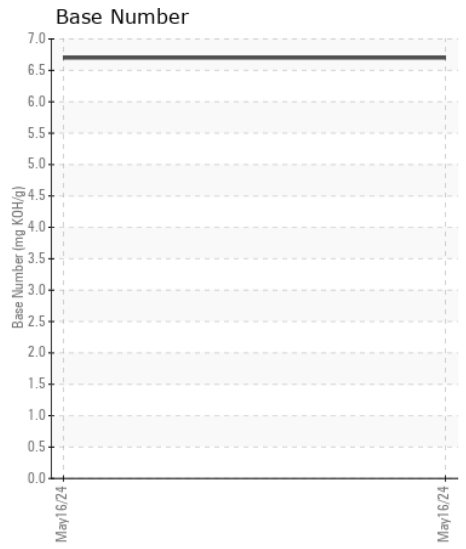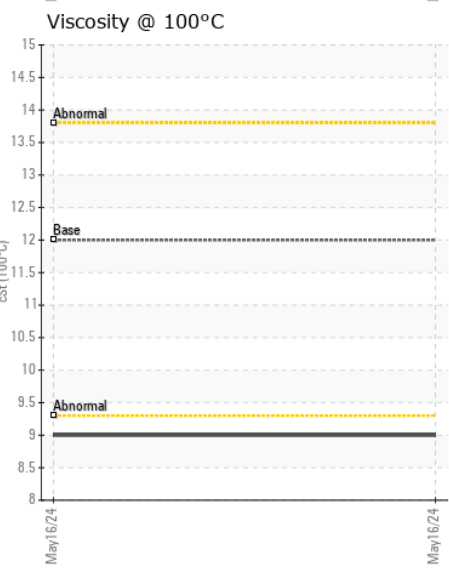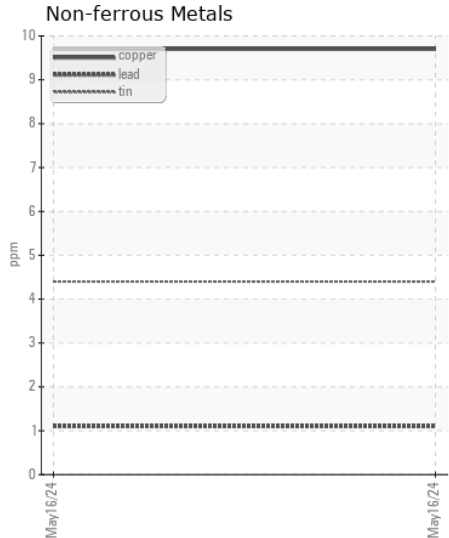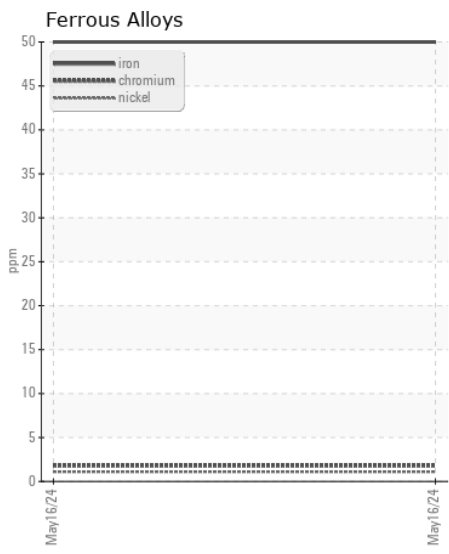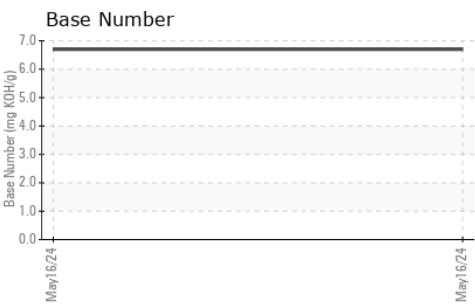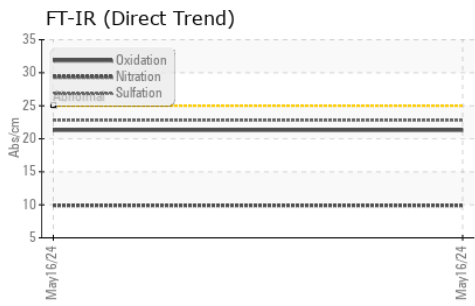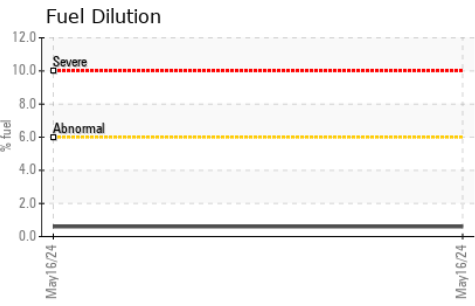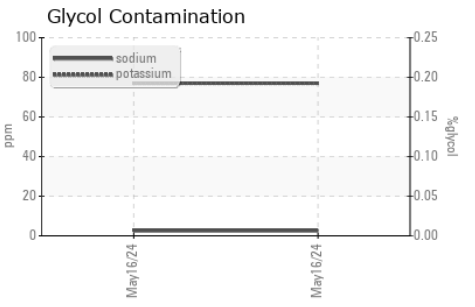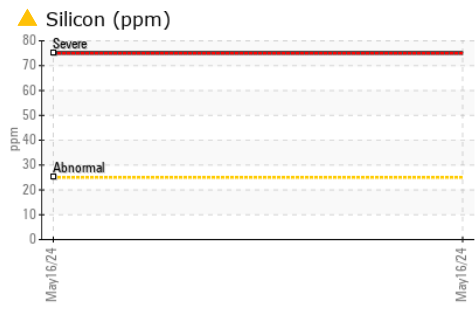

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : LW0009180 **Received** : 23 May 2024  
**Lab Number** : 06189918 **Tested** : 29 May 2024  
**Unique Number** : 11046670 **Diagnosed** : 29 May 2024 - Sean Felton  
**Test Package** : FLEET ( Additional Tests: FuelDilution, PercentFuel )

**LIV TRANSPORTATION, INC**  
 9809 INDUSTRIAL DRIVE  
 BRIDGEVIEW, IL  
 US 60455  
 Contact: BART KORLAGA  
 BART@LIVTRANSPORTATION.COM  
 T: (224)875-1049  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)