



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[701295 PRIMORIS]**  
 Machine Id  
**VOLVO A40G 352509**  
 Component  
**Rear Axle**  
 Fluid  
**VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP451153</b>	VCP433434	VCP393804
Sample Date		Client Info		<b>12 Apr 2024</b>	16 Nov 2023	25 Apr 2023
Machine Age	hrs	Client Info		<b>6123</b>	5500	4282
Oil Age	hrs	Client Info		<b>2000</b>	1500	3282
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	Not Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Not Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	ATTENTION

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>72</b>	69	577
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	7
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	2
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>&lt;1</b>	2	0
Lead	ppm	ASTM D5185m	>50	<b>&lt;1</b>	0	<1
Copper	ppm	ASTM D5185m	>150	<b>&lt;1</b>	<1	5
Tin	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>3</b>	2	6
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	1	3
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	MODER
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>1</b>	0	0
Boron	ppm	ASTM D5185m	111	<b>192</b>	193	116
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	3	0
Molybdenum	ppm	ASTM D5185m	0.9	<b>12</b>	11	5
Manganese	ppm	ASTM D5185m	0.0	<b>4</b>	3	22
Magnesium	ppm	ASTM D5185m	39	<b>47</b>	42	2
Calcium	ppm	ASTM D5185m	93	<b>131</b>	120	20
Phosphorus	ppm	ASTM D5185m	920	<b>1076</b>	1089	2373
Zinc	ppm	ASTM D5185m	104	<b>93</b>	63	17
Sulfur	ppm	ASTM D5185m	20179	<b>33019</b>	30485	32725
Visc @ 40°C	cSt	ASTM D445	333	<b>250</b>	251	51.5

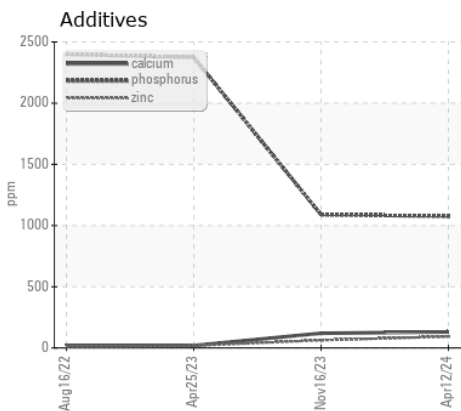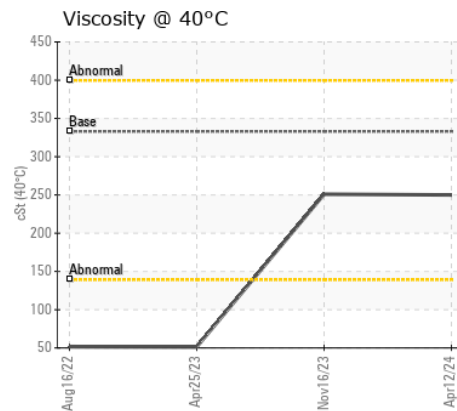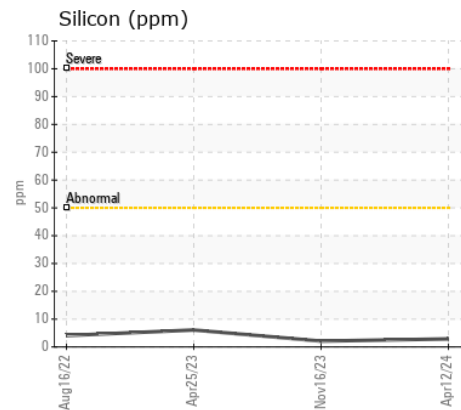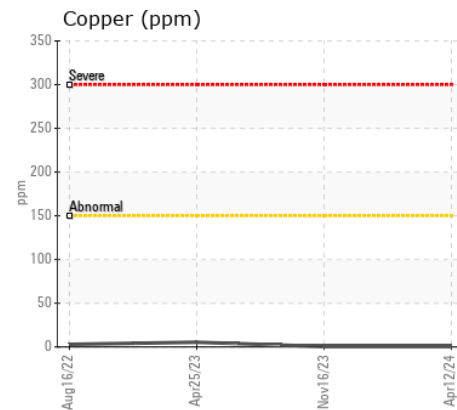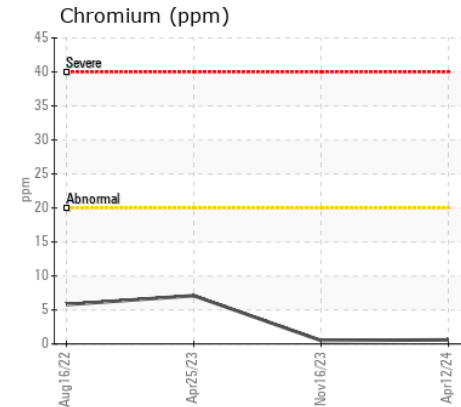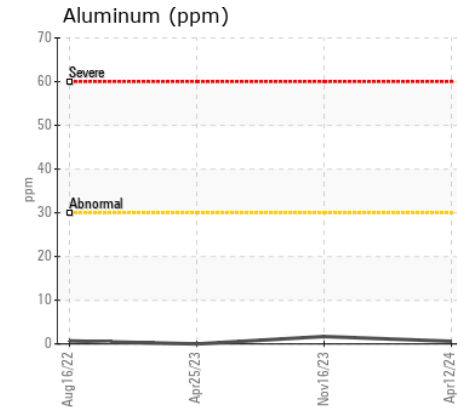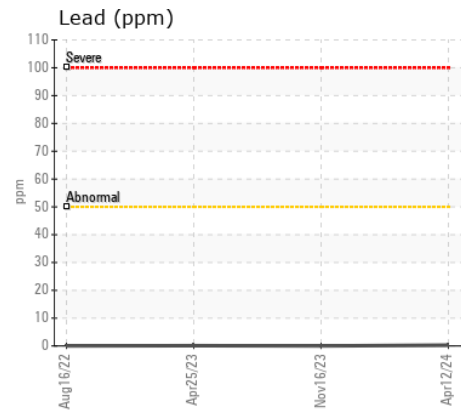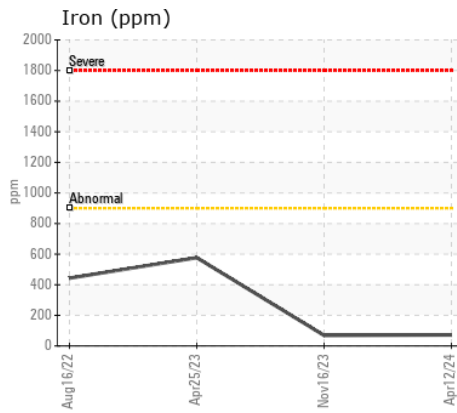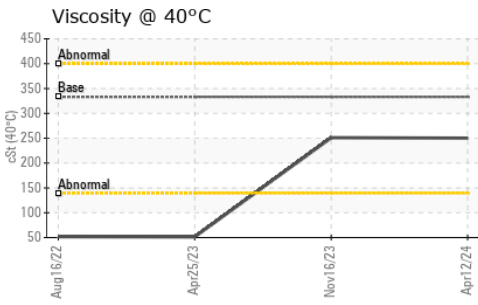

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP451153  
**Lab Number** : 06190771  
**Unique Number** : 11047523  
**Test Package** : MOB 1

**Received** : 24 May 2024  
**Tested** : 28 May 2024  
**Diagnosed** : 28 May 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC  
 8418 PALM RIVER ROAD  
 TAMPA, FL  
 US 33619

Contact: KENNY HANEY  
 khaney@flaglerce.com

T: (813)630-0077  
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)