



| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
924033-260253
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | GFL0118271 | GFL0118175 | GFL0109172 |
| Sample Date | | Client Info | | 13 May 2024 | 08 Apr 2024 | 05 Mar 2024 |
| Machine Age | hrs | Client Info | | 802 | 610 | 470 |
| Oil Age | hrs | Client Info | | 700 | 610 | 600 |
| Filter Age | hrs | Client Info | | 700 | 0 | 0 |
| Oil Changed | | Client Info | | Changed | Changed | Changed |
| Filter Changed | | Client Info | | Changed | Changed | Changed |
| Sample Status | | | | NORMAL | ATTENTION | ATTENTION |

WEAR

Metal levels are typical for a new component breaking in.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >100 | 12 | 44 | 41 |
| Chromium | ppm | ASTM D5185m | >20 | 1 | 1 | <1 |
| Nickel | ppm | ASTM D5185m | >4 | <1 | <1 | 0 |
| Titanium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| Silver | ppm | ASTM D5185m | >3 | 1 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 2 | 5 | 4 |
| Lead | ppm | ASTM D5185m | >40 | <1 | 1 | 0 |
| Copper | ppm | ASTM D5185m | >330 | 1 | 0 | 2 |
| Tin | ppm | ASTM D5185m | >15 | <1 | <1 | 0 |
| Vanadium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION








There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 4 | 5 | 5 |
| Potassium | ppm | ASTM D5185m | >20 | 3 | 6 | 4 |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >3 | 0.4 | 1.1 | 0.9 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 7.3 | 10.9 | 9.7 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 18.8 | 22.7 | 20.8 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|--------------|------|------|
| Sodium | ppm | ASTM D5185m | | 17 | 96 | 98 |
| Boron | ppm | ASTM D5185m | 0 | 1 | 6 | 10 |
| Barium | ppm | ASTM D5185m | 0 | <1 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 60 | 60 | 59 | 60 |
| Manganese | ppm | ASTM D5185m | 0 | <1 | <1 | <1 |
| Magnesium | ppm | ASTM D5185m | 1010 | 915 | 880 | 860 |
| Calcium | ppm | ASTM D5185m | 1070 | 1035 | 1015 | 960 |
| Phosphorus | ppm | ASTM D5185m | 1150 | 945 | 1003 | 977 |
| Zinc | ppm | ASTM D5185m | 1270 | 1163 | 1220 | 1138 |
| Sulfur | ppm | ASTM D5185m | 2060 | 2890 | 3340 | 2872 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 14.6 | 19.6 | 17.7 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | 8.3 | 6.4 | 7.6 |
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | 13.8 | 12.7 | 13.0 |

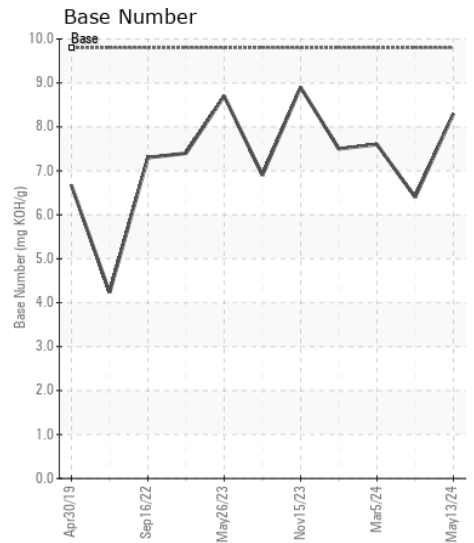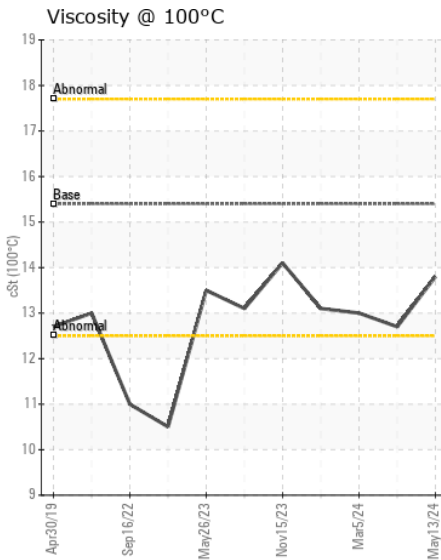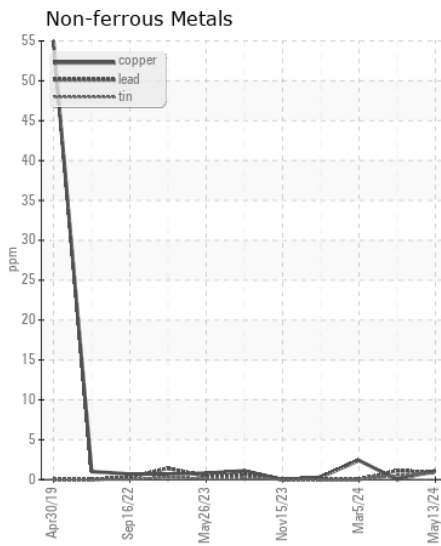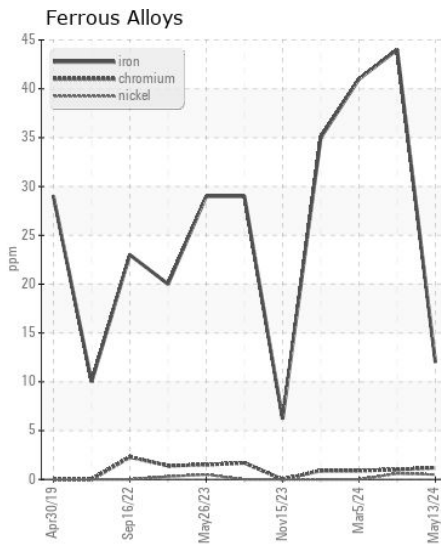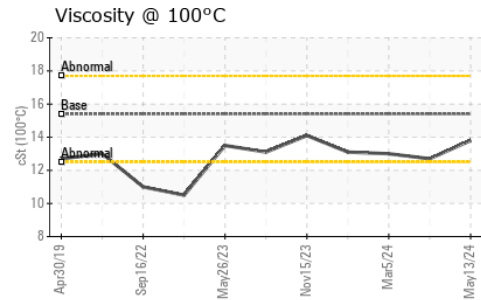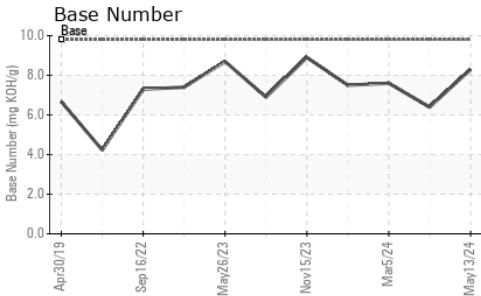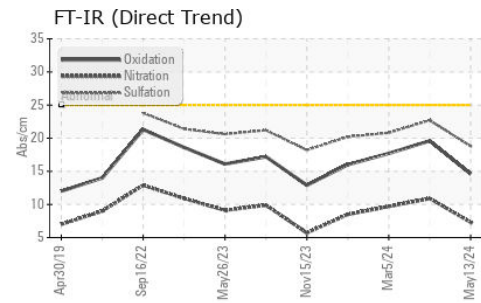

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0118271
Lab Number : 06191897
Unique Number : 11048649
Test Package : FLEET
Received : 28 May 2024
Tested : 29 May 2024
Diagnosed : 29 May 2024 - Wes Davis

GFL Environmental - 822 - Springfield Hauling
 2120 West Bennett Street
 Springfield, MO
 US 65807
 Contact: Dennis Moore
 dennis.moore@gflenv.com
 T: (417)403-3641
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)