



# OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id  
**CHEVROLET 3500 2WD VD1326 (S/N 1GB4CYCY2JF220414)**

Component  
**Diesel Engine**

Fluid  
**DURALENE Dura-Max Xtreme 15W40 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		DC0035643	---	---
Sample Date		Client Info		22 May 2024	---	---
Machine Age	mls	Client Info		68581	---	---
Oil Age	mls	Client Info		0	---	---
Filter Age	mls	Client Info		0	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	36	---	---
Chromium	ppm	ASTM D5185m	>20	1	---	---
Nickel	ppm	ASTM D5185m	>4	<1	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m	>3	1	---	---
Aluminum	ppm	ASTM D5185m	>20	4	---	---
Lead	ppm	ASTM D5185m	>40	2	---	---
Copper	ppm	ASTM D5185m	>330	3	---	---
Tin	ppm	ASTM D5185m	>15	1	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

## CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	7	---	---
Potassium	ppm	ASTM D5185m	>20	5	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.7	---	---
Nitration	Abs/cm	*ASTM D7624	>20	11.3	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.4	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		2	---	---
Boron	ppm	ASTM D5185m		10	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		51	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m		726	---	---
Calcium	ppm	ASTM D5185m		1063	---	---
Phosphorus	ppm	ASTM D5185m		815	---	---
Zinc	ppm	ASTM D5185m		1015	---	---
Sulfur	ppm	ASTM D5185m		2651	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	19.0	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		7.20	---	---
Visc @ 100°C	cSt	ASTM D445		13.53	---	---

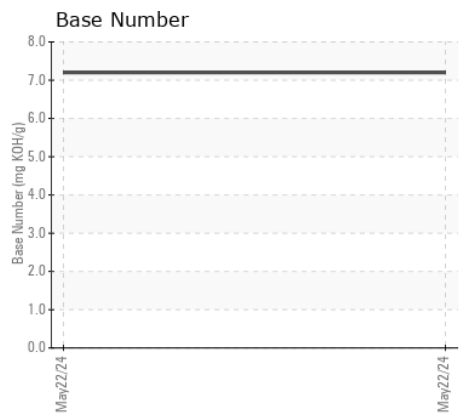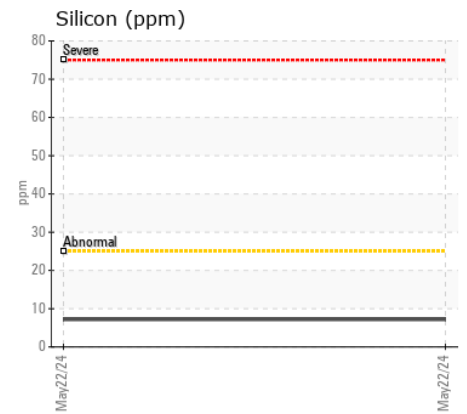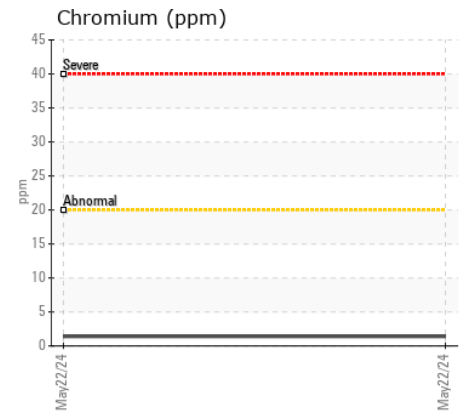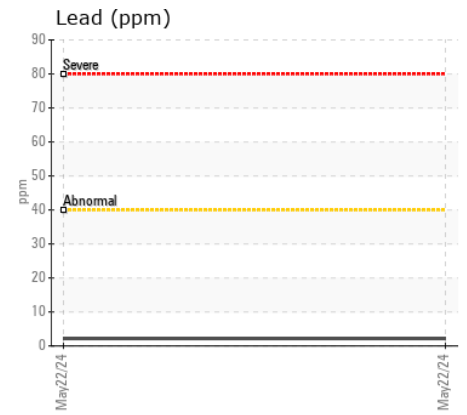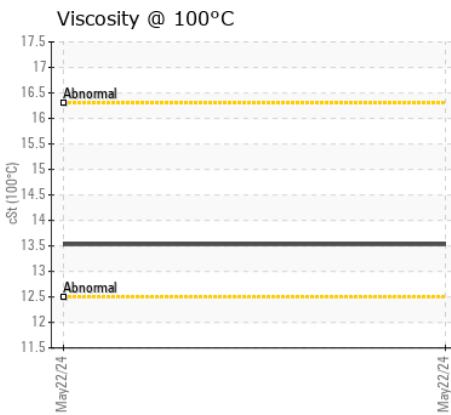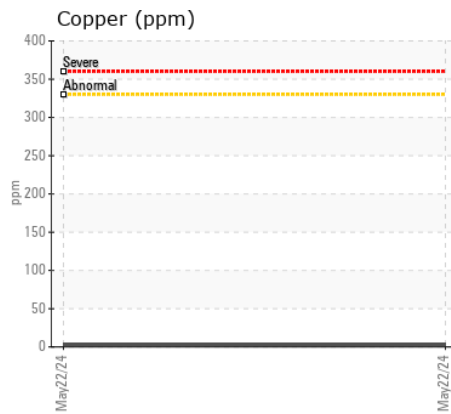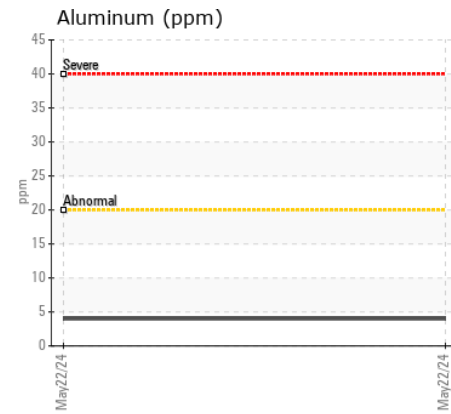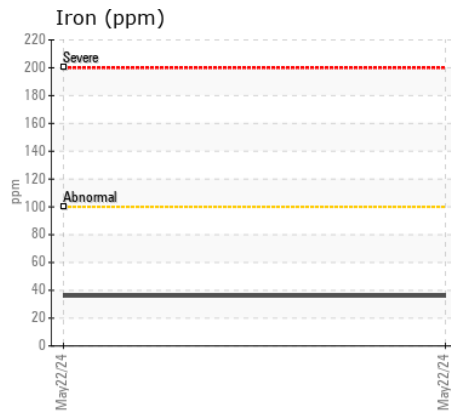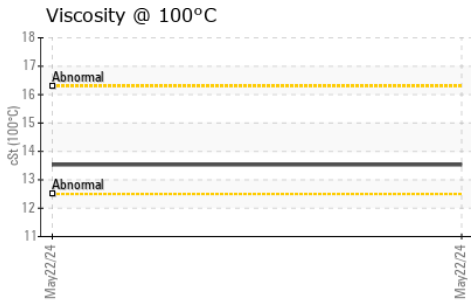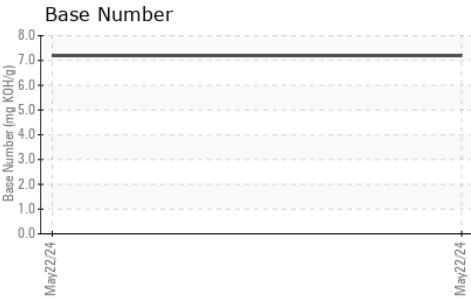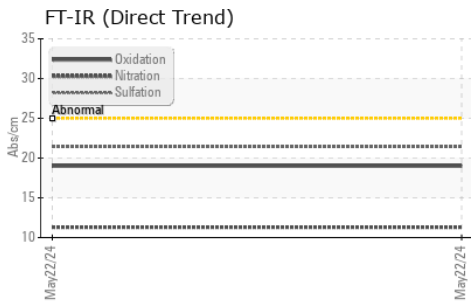

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : DC0035643  
**Lab Number** : 06193053  
**Unique Number** : 11049805  
**Test Package** : MOB 2

**Received** : 28 May 2024  
**Tested** : 31 May 2024  
**Diagnosed** : 31 May 2024 - Sean Felton

**COMER CONSTRUCTION**  
 2100 SLADE LANE  
 FOREST HILL, MD  
 US 21050  
 Contact: FRED RICE  
 frice@comerconstruction.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (410)638-0289