



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**KEMP QUARRIES / NEOSHO [69885]**

Machine Id  
**WL111**

Component  
**Front Right Final Drive**

Fluid  
**PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor. ( Customer Sample Comment: PM-2 sampled fluid )

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PCA0108721</b>	PCA0086525	PCA0084706
Sample Date		Client Info		<b>21 May 2024</b>	06 Feb 2024	10 Oct 2023
Machine Age	hrs	Client Info		<b>30720</b>	30222	29750
Oil Age	hrs	Client Info		<b>30720</b>	30222	29750
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>800	<b>353</b>	104	252
Chromium	ppm	ASTM D5185m	>10	<b>1</b>	0	<1
Nickel	ppm	ASTM D5185m	>5	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185m	>15	<b>&lt;1</b>	0	<1
Silver	ppm	ASTM D5185m	>2	<b>1</b>	0	0
Aluminum	ppm	ASTM D5185m	>75	<b>3</b>	1	2
Lead	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	<1
Copper	ppm	ASTM D5185m	>75	<b>3</b>	0	6
Tin	ppm	ASTM D5185m	>8	<b>&lt;1</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>400	<b>23</b>	16	22
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	0	2
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>1</b>	<1	0
Boron	ppm	ASTM D5185m	2	<b>&lt;1</b>	0	0
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	9
Molybdenum	ppm	ASTM D5185m	0	<b>2</b>	0	<1
Manganese	ppm	ASTM D5185m	0	<b>3</b>	<1	2
Magnesium	ppm	ASTM D5185m	9	<b>19</b>	18	13
Calcium	ppm	ASTM D5185m	3114	<b>4420</b>	3518	3289
Phosphorus	ppm	ASTM D5185m	1099	<b>1134</b>	1017	1023
Zinc	ppm	ASTM D5185m	1245	<b>1401</b>	1233	1247
Sulfur	ppm	ASTM D5185m	7086	<b>5423</b>	4609	4866
Visc @ 40°C	cSt	ASTM D445	213.9	<b>197</b>	198	186

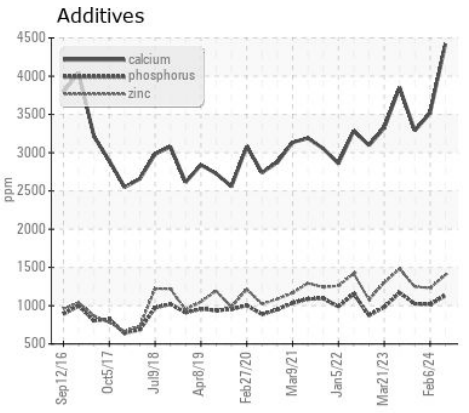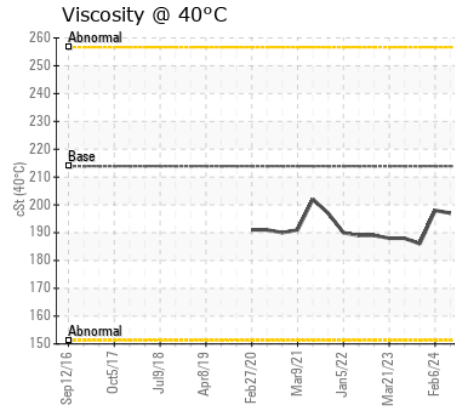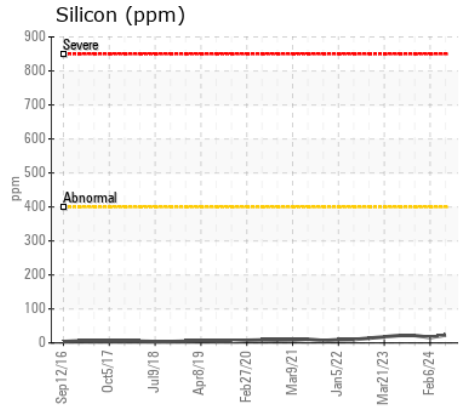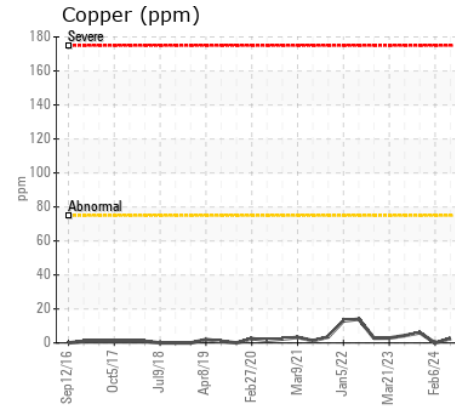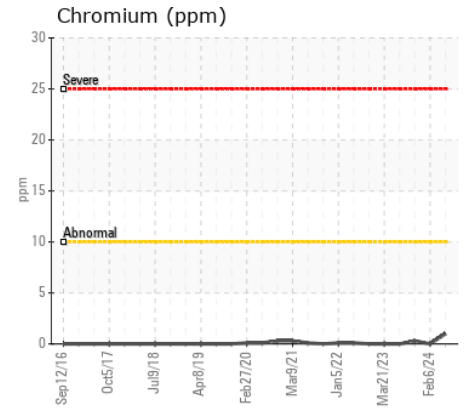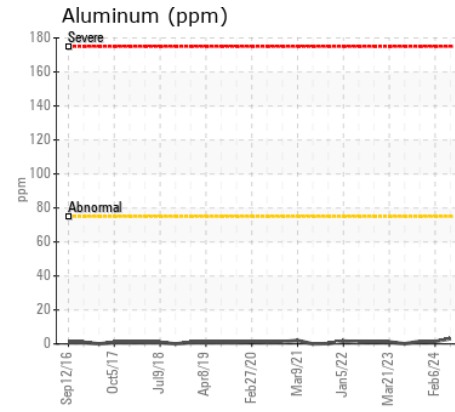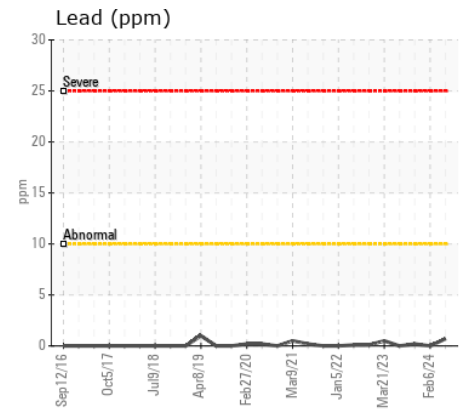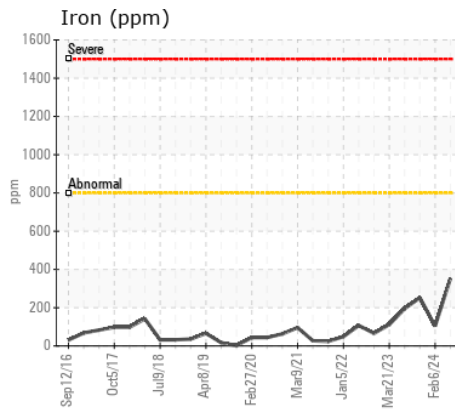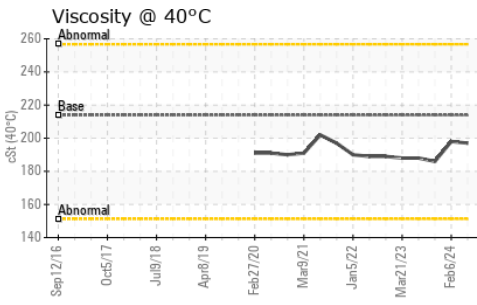

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
 Sample No. : PCA0108721  
 Lab Number : 06193079  
 Unique Number : 11049831  
 Test Package : MOB 1

Received : 28 May 2024  
 Tested : 30 May 2024  
 Diagnosed : 30 May 2024 - Sean Felton

Kemp Quarries - Kemp Stone - Neosho  
 19148 Ingersol Lane  
 Neosho, MO  
 US 64850  
 Contact:  
 neosho@kempstone.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
 F: