



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area

**[25643]**

Machine Id

**VOLVO DD25B 660339**

Component

**Diesel Engine**

Fluid

**VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP452656</b>	VCP401763	VCP348106
Sample Date		Client Info		<b>20 May 2024</b>	24 Feb 2023	12 Mar 2022
Machine Age	hrs	Client Info		<b>4249</b>	3657	3007
Oil Age	hrs	Client Info		<b>0</b>	500	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	N/A
Filter Changed		Client Info		<b>Changed</b>	Changed	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>19</b>	32	2
Chromium	ppm	ASTM D5185m	>10	<b>1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185m		<b>1</b>	<1	0
Silver	ppm	ASTM D5185m	>2	<b>1</b>	0	0
Aluminum	ppm	ASTM D5185m	>10	<b>5</b>	6	<1
Lead	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	<1
Copper	ppm	ASTM D5185m	>15	<b>1</b>	2	0
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>10</b>	10	10
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	2	<1
Fuel		WC Method	>6.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.3</b>	0.6	0.3
Nitration	Abs/cm	*ASTM D7624	>20	<b>8.4</b>	10.8	11.4
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>22.2</b>	22.6	25.1
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>3</b>	0	1
Boron	ppm	ASTM D5185m	2.5	<b>51</b>	35	76
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.7	<b>43</b>	50	44
Manganese	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	256	<b>522</b>	487	538
Calcium	ppm	ASTM D5185m	2057	<b>1726</b>	1821	1658
Phosphorus	ppm	ASTM D5185m	935	<b>1023</b>	967	934
Zinc	ppm	ASTM D5185m	1223	<b>1189</b>	1127	1115
Sulfur	ppm	ASTM D5185m	4079	<b>3709</b>	2881	2662
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>21.1</b>	22.7	21.2
Base Number (BN)	mg KOH/g	ASTM D2896	10	<b>10.4</b>	10.1	6.0
Visc @ 100°C	cSt	ASTM D445	15.0	<b>12.5</b>	12.7	13.6

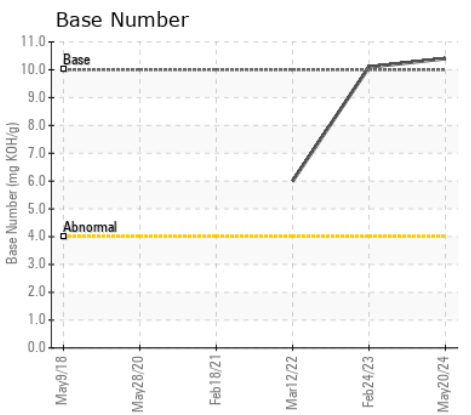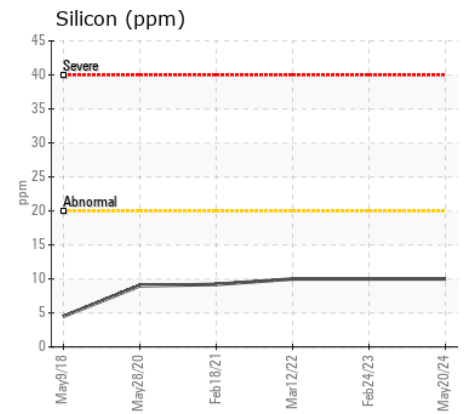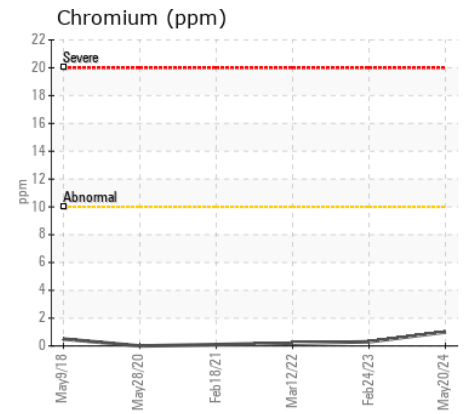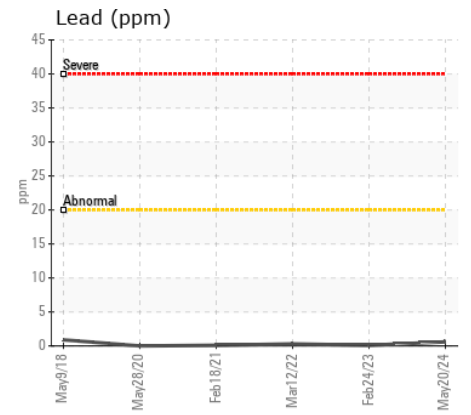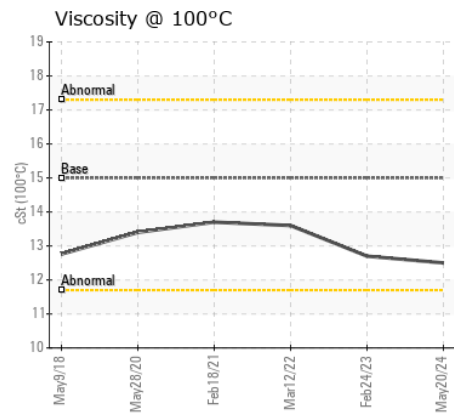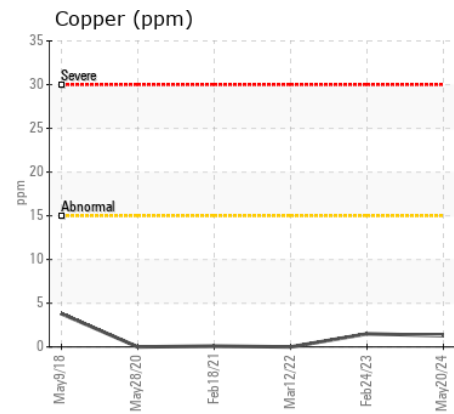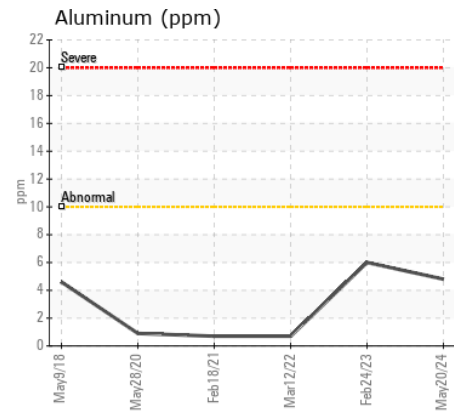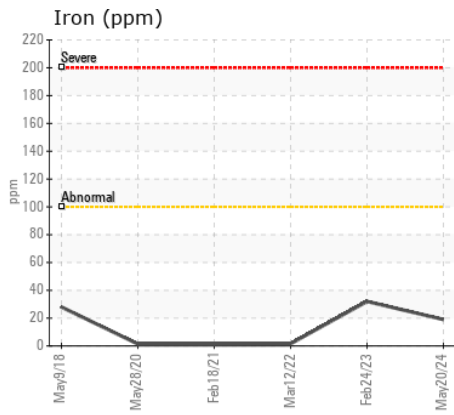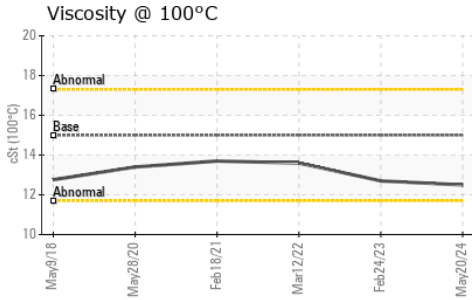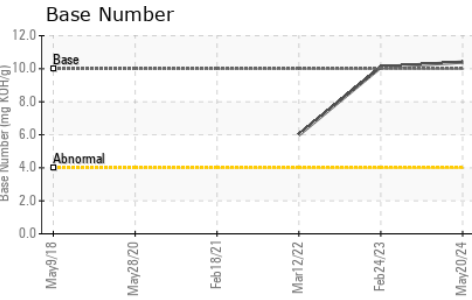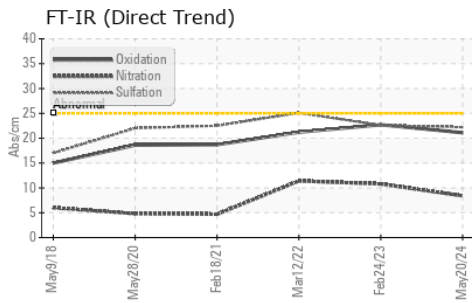

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP452656 **Received** : 29 May 2024  
**Lab Number** : 06193684 **Tested** : 30 May 2024  
**Unique Number** : 11050436 **Diagnosed** : 30 May 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: TBN )

**SANDERS BROTHERS CONSTRUCTION**  
 1990 HARLEY STREET  
 NORTH CHARLESTON, SC  
 US 29411  
 Contact: MARC WATSON  
 marc.watson@sandersbrothers.com  
 T: (843)744-4261  
 F: (843)747-3909

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)