



VOLVO

OIL ANALYSIS REPORT

| | |
|-----------------|--------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |



Area

[HERC]

Machine Id

VOLVO A30G 753394

Component

Hydraulic System

Fluid

VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|-------------|----------|----------|
| Sample Number | | Client Info | | VCP449695 | --- | --- |
| Sample Date | | Client Info | | 20 May 2024 | --- | --- |
| Machine Age | hrs | Client Info | | 1120 | --- | --- |
| Oil Age | hrs | Client Info | | 0 | --- | --- |
| Filter Age | hrs | Client Info | | 0 | --- | --- |
| Oil Changed | | Client Info | | Not Changed | --- | --- |
| Filter Changed | | Client Info | | Changed | --- | --- |
| Sample Status | | | | NORMAL | --- | --- |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|------|-----|-----|
| Iron | ppm | ASTM D5185m | >50 | 0 | --- | --- |
| Chromium | ppm | ASTM D5185m | >20 | 0 | --- | --- |
| Nickel | ppm | ASTM D5185m | >10 | 0 | --- | --- |
| Titanium | ppm | ASTM D5185m | | <1 | --- | --- |
| Silver | ppm | ASTM D5185m | | <1 | --- | --- |
| Aluminum | ppm | ASTM D5185m | >20 | <1 | --- | --- |
| Lead | ppm | ASTM D5185m | >20 | <1 | --- | --- |
| Copper | ppm | ASTM D5185m | >150 | 0 | --- | --- |
| Tin | ppm | ASTM D5185m | >20 | <1 | --- | --- |
| Vanadium | ppm | ASTM D5185m | | <1 | --- | --- |
| White Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | NONE | --- | --- |

CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

| | | | | | | |
|------------------|--------|--------------|----------|----------|-----|-----|
| Silicon | ppm | ASTM D5185m | >20 | 2 | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | 1 | --- | --- |
| Water | | WC Method | >0.1 | NEG | --- | --- |
| Particles >4µm | | ASTM D7647 | | 11680 | --- | --- |
| Particles >6µm | | ASTM D7647 | >5000 | 2708 | --- | --- |
| Particles >14µm | | ASTM D7647 | >160 | 114 | --- | --- |
| Particles >21µm | | ASTM D7647 | >40 | 21 | --- | --- |
| Particles >38µm | | ASTM D7647 | >10 | 2 | --- | --- |
| Particles >71µm | | ASTM D7647 | >3 | 0 | --- | --- |
| Oil Cleanliness | | ISO 4406 (c) | >-/19/14 | 21/19/14 | --- | --- |
| Silt | scalar | *Visual | NONE | NONE | --- | --- |
| Debris | scalar | *Visual | NONE | NONE | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | NONE | --- | --- |
| Appearance | scalar | *Visual | NORML | NORML | --- | --- |
| Odor | scalar | *Visual | NORML | NORML | --- | --- |
| Emulsified Water | scalar | *Visual | >0.1 | NEG | --- | --- |

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|------|-----|-----|
| Sodium | ppm | ASTM D5185m | | <1 | --- | --- |
| Boron | ppm | ASTM D5185m | 14 | 10 | --- | --- |
| Barium | ppm | ASTM D5185m | 0.0 | 0 | --- | --- |
| Molybdenum | ppm | ASTM D5185m | 0.0 | 5 | --- | --- |
| Manganese | ppm | ASTM D5185m | 0.0 | <1 | --- | --- |
| Magnesium | ppm | ASTM D5185m | 2.6 | 42 | --- | --- |
| Calcium | ppm | ASTM D5185m | 49 | 293 | --- | --- |
| Phosphorus | ppm | ASTM D5185m | 354 | 419 | --- | --- |
| Zinc | ppm | ASTM D5185m | 419 | 524 | --- | --- |
| Sulfur | ppm | ASTM D5185m | 3719 | 2865 | --- | --- |
| Acid Number (AN) | mg KOH/g | ASTM D8045 | | 0.62 | --- | --- |
| Visc @ 40°C | cSt | ASTM D445 | 46 | 47.5 | --- | --- |

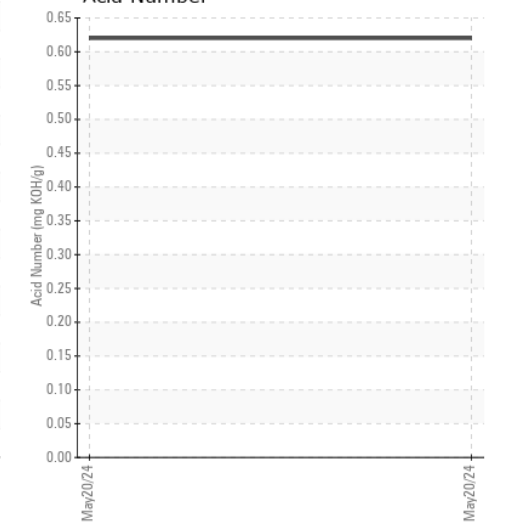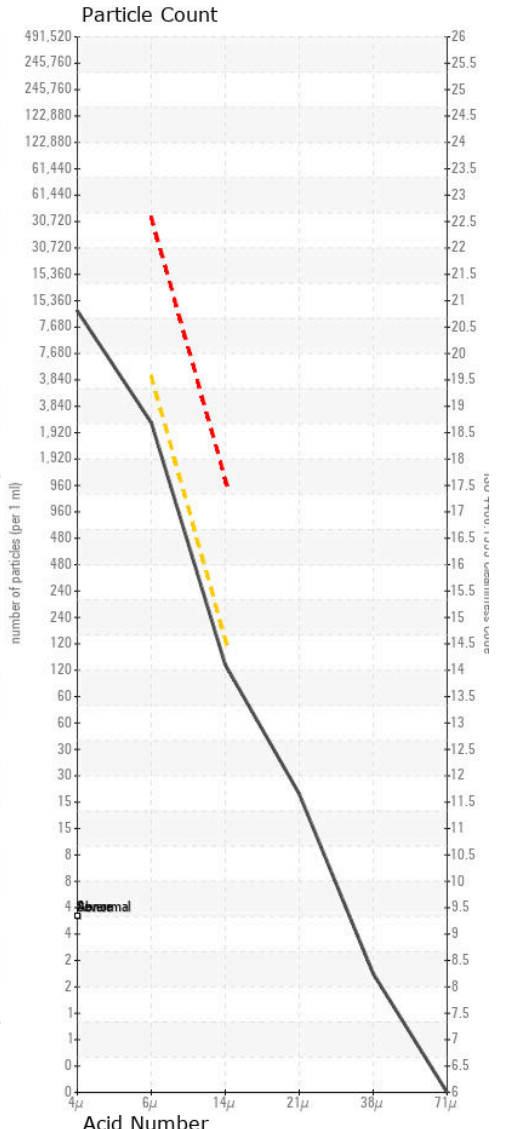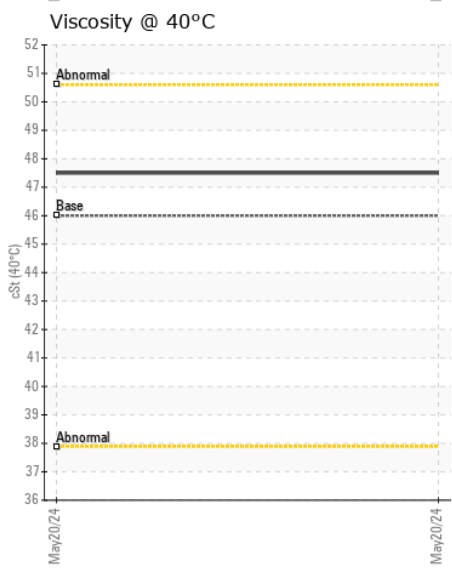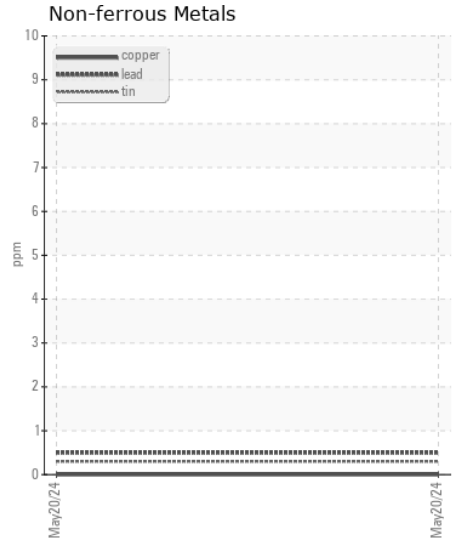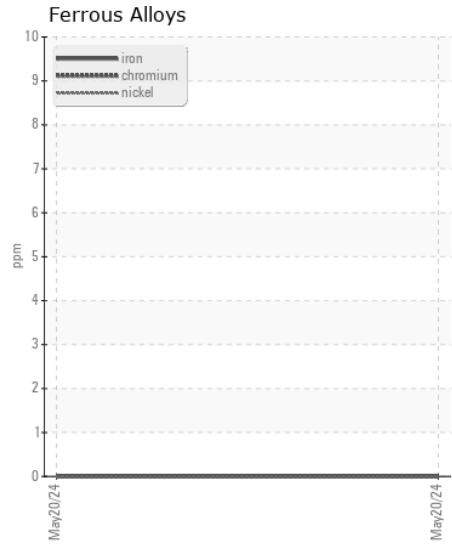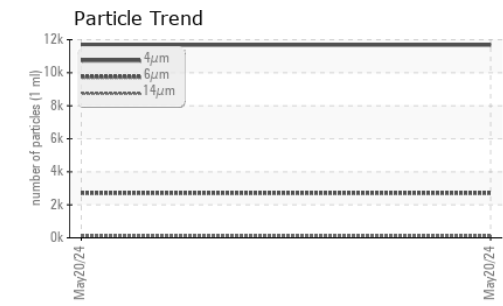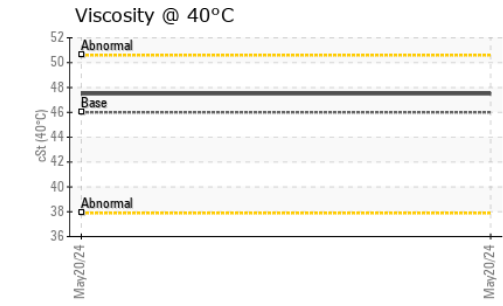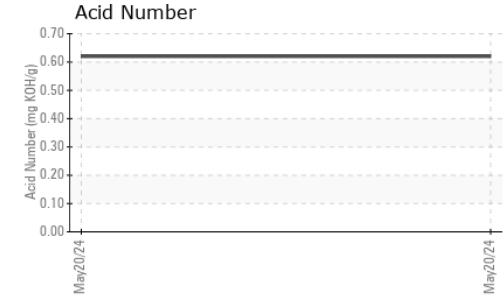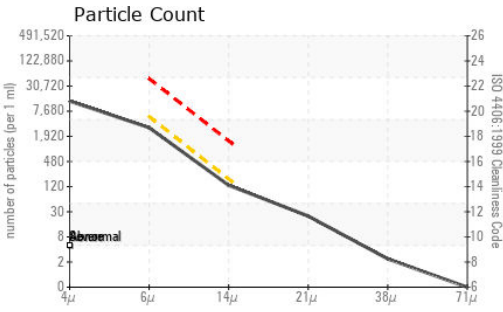

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP449695 **Received** : 29 May 2024
Lab Number : 06193920 **Tested** : 30 May 2024
Unique Number : 11056043 **Diagnosed** : 30 May 2024 - Wes Davis
Test Package : MOB 2

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)