
WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**



Machine Id VOLVO L110H 631332

Rear Axle

VOLVO WB 102 (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP446290	VCP414734	VCP393619
	Sample Date		Client Info		17 Apr 2024	06 Sep 2023	01 Dec 2022
	Machine Age	hrs	Client Info		10389	9270	8127
	Oil Age	hrs	Client Info		0	2270	2000
	Filter Age	hrs	Client Info		0	0	0
	Oil Changed		Client Info		Changed	Not Changd	Changed
	Filter Changed		Client Info		Not Changd	Not Changd	Changed
	Sample Status				NORMAL	ABNORMAL	NORMAL
WEAR	Iron	ppm	ASTM D5185m	>500	29	44	77
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	0	<1	<1
	Nickel	ppm	ASTM D5185m	>10	0	<1	0
	Titanium	ppm	ASTM D5185m		0	<1	0
	Silver	ppm	ASTM D5185m		0	0	0
	Aluminum	ppm	ASTM D5185m	>30	0	9	0
	Lead	ppm	ASTM D5185m	>50	0	0	0
	Copper	ppm	ASTM D5185m	>120	<1	0	0
	Tin	ppm	ASTM D5185m	>20	0	0	0
	Vanadium	ppm	ASTM D5185m		0	0	0
	White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	12	28	11
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	0	0	1
There is no indicately of any somatimation in the oil.	Water		WC Method	>0.2	NEG	NEG	NEG
	Silt	scalar	*Visual	NONE	NONE	NONE	NONE
	Debris	scalar	*Visual	NONE	NONE	▲ MODER	NONE
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
	Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
	Odor	scalar	*Visual	NORML	NORML	NORML	NORML
	Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0	0	4
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		44	57	131
	Barium	ppm	ASTM D5185m		0	0	1
	Molybdenum	ppm	ASTM D5185m		0	0	<1
	Manganese	ppm	ASTM D5185m		<1	<1	1
	Magnesium	ppm	ASTM D5185m		10	14	25
	Calcium	ppm	ASTM D5185m		3635	3566	4146
	Phosphorus	ppm	ASTM D5185m		1299	1257	1304
	Zinc	ppm	ASTM D5185m		1552	1515	1664
	Sulfur	ppm	ASTM D5185m		4911	3969	4464
Depart Id. DIDTAM RMI ISCADI 06104260 (Concreted: 05/21/2024 07:45:06) Day: 1	Visc @ 40°C	cSt	ASTM D445		40.5	41.6	40.3

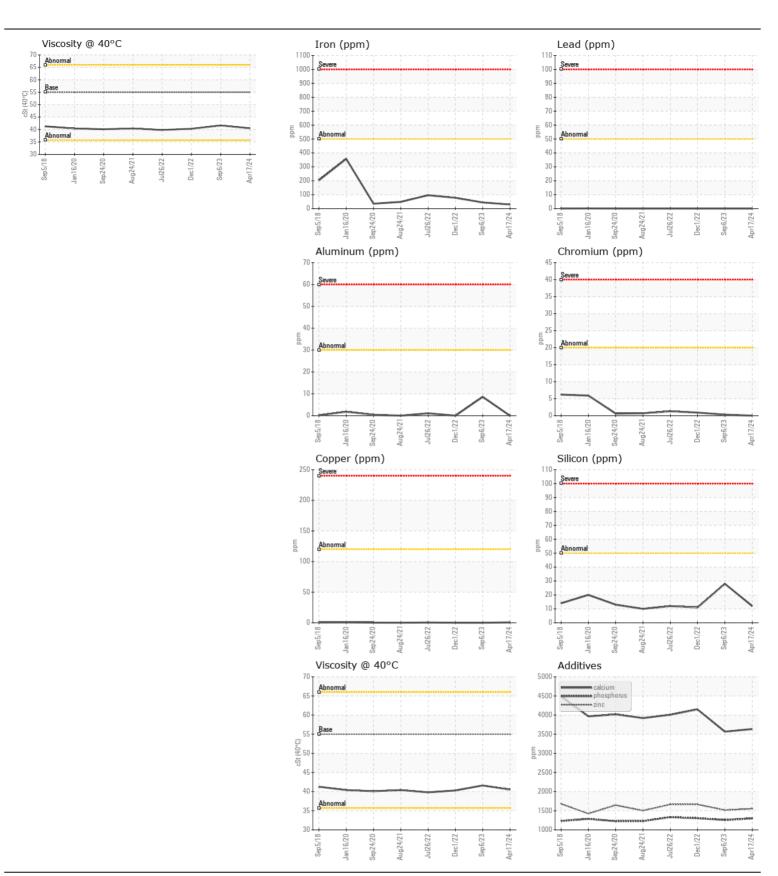



Certificate L2367

Laboratory Sample No.

: VCP446290 Lab Number : 06194360 Unique Number : 11056483 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 29 May 2024 **Tested** : 31 May 2024

: 31 May 2024 - Wes Davis Diagnosed

10149 FISHER AVENUE

Contact: PM Services PMServices@ripaconstruction.com T:

RIPA AND ASSOCIATES

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) TAMPA, FL

US 33619

F: