



VOLVO

COOLANT REPORT

CORROSION	NORMAL
CONTAMINANTS	NORMAL
COOLANT CONDITION	NORMAL

Machine Id
VOLVO EC250EL 314172
 Component
Coolant
 Fluid
VALVOLINE 50/50 (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. The fluid is suitable for further service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP438770	---	---
Sample Date		Client Info		14 May 2024	---	---
Machine Age	hrs	Client Info		3232	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changd	---	---
Sample Status				NORMAL	---	---








CORROSION

Total Dissolved Solids				581.5	---	---
Coolant Appearance		*Visual	Clear	normal	---	---

CONTAMINANTS

There is no indication of any contamination in the coolant.

Boiling Point	°C	WC Method		225	---	---
Specific Gravity		*ASTM D1298		1.068	---	---
pH	Scale 0-14	ASTM D1287		8.63	---	---
Nitrites	ppm	AP-053:2009		NT	---	---
Reserve Alkalinity	Scale 0-20	*ASTM D1121		---	---	---
Percentage Glycol	%	ASTM D3321		50.8	---	---
Freezing Point	°F	ASTM D3321		-35	---	---
Carboxylate				fail	---	---
Coolant Color		*Visual		Yllow	---	---

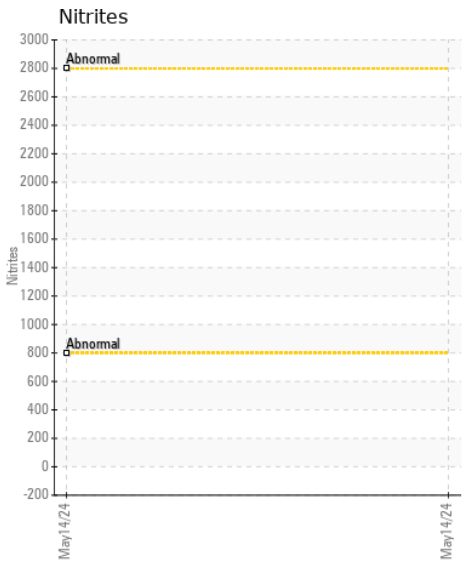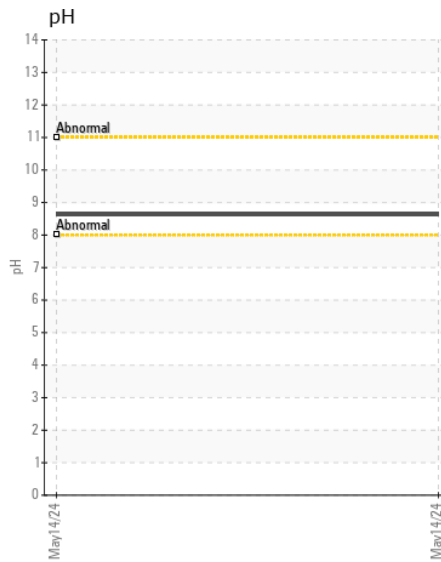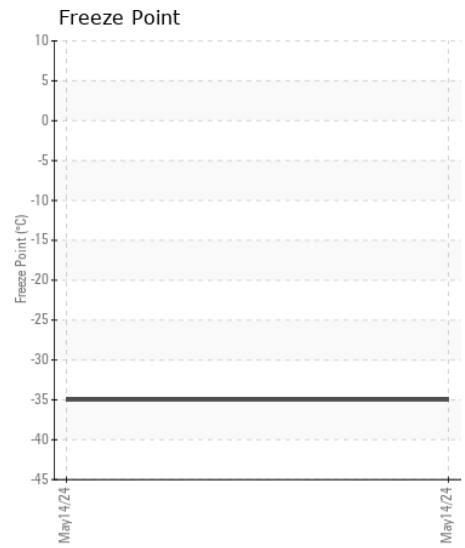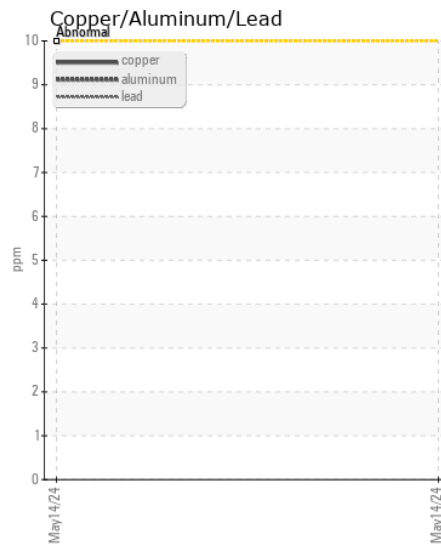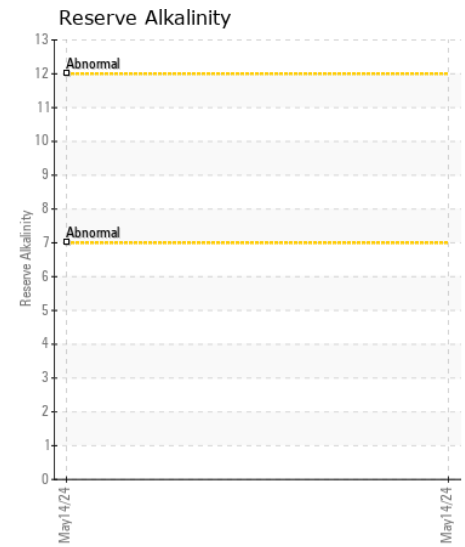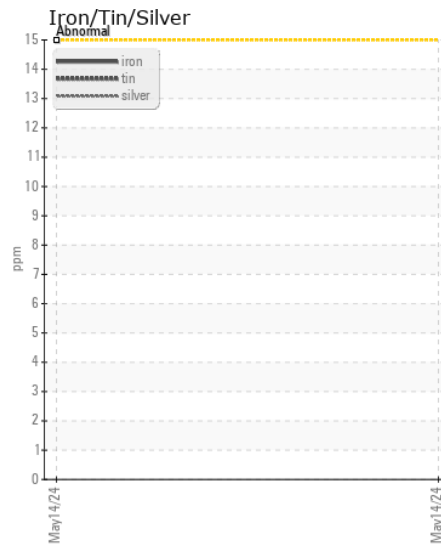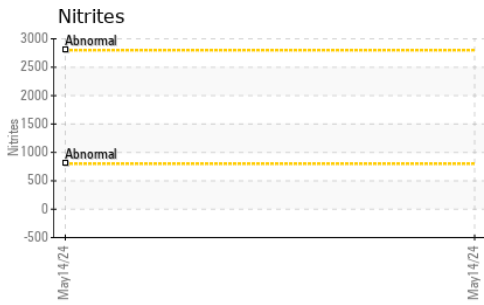

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP438770 **Received** : 29 May 2024
Lab Number : 06194591 **Tested** : 03 Jun 2024
Unique Number : 11056714 **Diagnosed** : 03 Jun 2024 - Jonathan Hester
Test Package : COOL- (Additional Tests: BoilingPoint, COOL, GlycolType)

CITY CARTING
 221 OLD GATE LN
 MILFORD, CT
 US 06460
 Contact: TAVINS BANKS
 tavins@citycart.net
 T: (203)223-3885
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)