



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**7012777 (S/N 1FF135PACNF00116)**  
 Component  
**Hydraulic System**  
 Fluid  
**JOHN DEERE ZINC-FREE HYDRAULIC OIL 46 (--- QTS)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0218030</b>	---	---
Sample Date		Client Info		<b>24 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>990</b>	---	---
Oil Age	hrs	Client Info		<b>990</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Changd</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

PQ	UOM	Method	Limit/Abn	Current	History1	History2
Iron	ppm	ASTM D5185m	>20	<b>7</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m		<b>1</b>	---	---
Aluminum	ppm	ASTM D5185m	>10	<b>1</b>	---	---
Lead	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Copper	ppm	ASTM D5185m	>75	<b>3</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION











The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	<b>2</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>5000	<b>1955</b>	---	---
Particles >6µm		ASTM D7647	>1300	<b>553</b>	---	---
Particles >14µm		ASTM D7647	>160	<b>42</b>	---	---
Particles >21µm		ASTM D7647	>40	<b>9</b>	---	---
Particles >38µm		ASTM D7647	>10	<b>1</b>	---	---
Particles >71µm		ASTM D7647	>3	<b>0</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>18/16/13</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>0</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>1</b>	---	---
Calcium	ppm	ASTM D5185m		<b>43</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>503</b>	---	---
Zinc	ppm	ASTM D5185m		<b>56</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>201</b>	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	<b>0.09</b>	---	---
Visc @ 40°C	cSt	ASTM D445	47	<b>45.2</b>	---	---

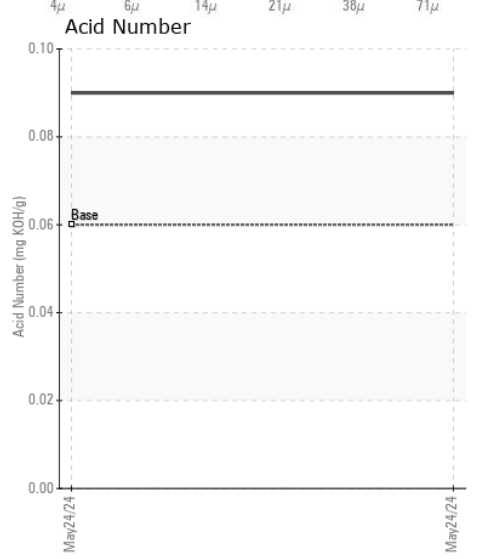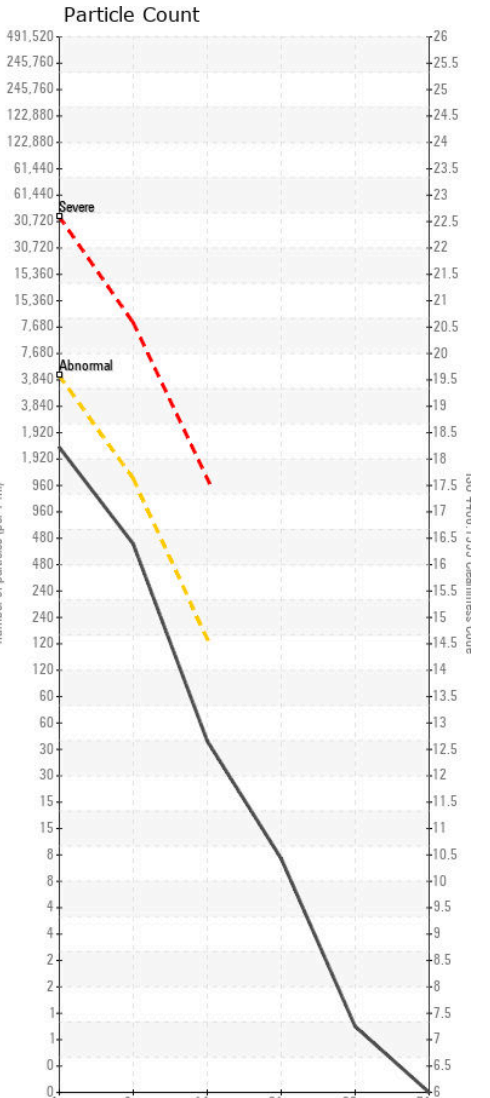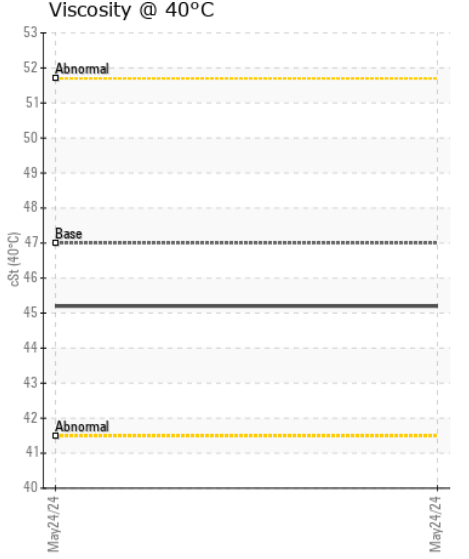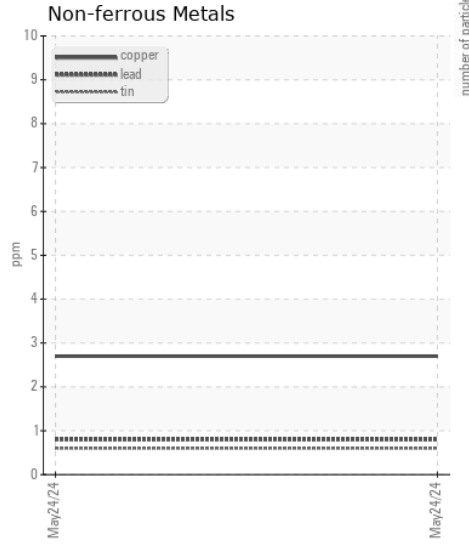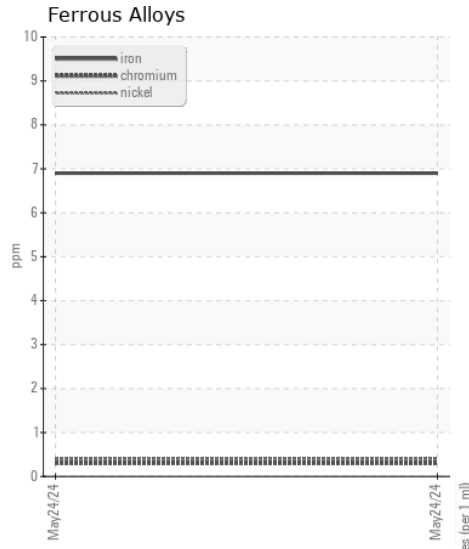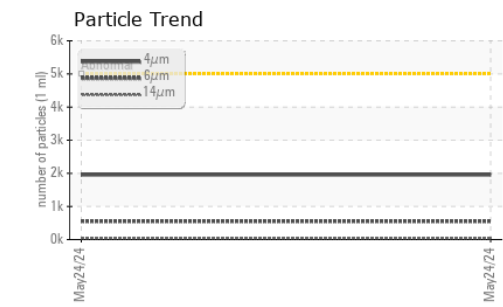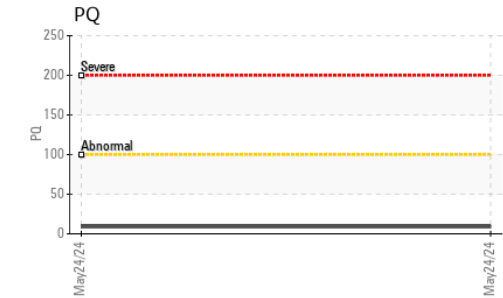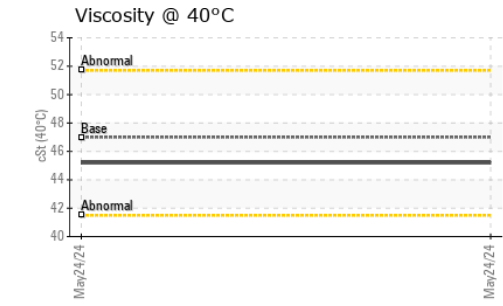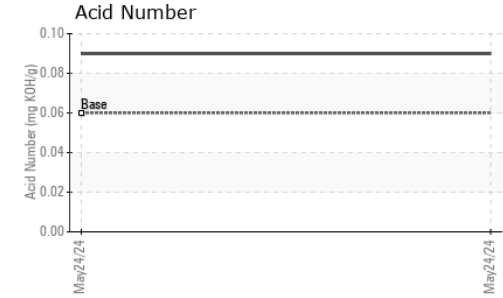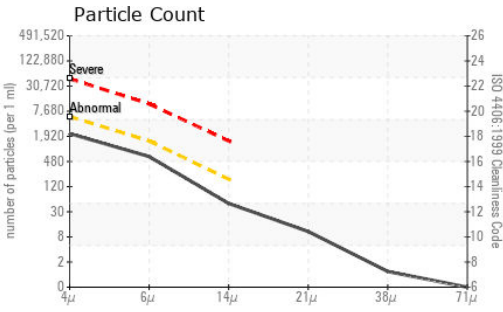

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0218030 **Received** : 29 May 2024  
**Lab Number** : 06194604 **Tested** : 30 May 2024  
**Unique Number** : 11056727 **Diagnosed** : 30 May 2024 - Wes Davis  
**Test Package** : CONST ( Additional Tests: PQ )

**JRE - MANASSAS PARK**  
 9107 OWENS DRIVE  
 MANASSAS PARK, VA  
 US 20111  
 Contact: TECHNICIAN ACCOUNT  
 catherine.anastasio@wearcheck.com  
 T:  
 F: (703)631-4715

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)