



[702884 APTIM] Machine Id VOLVO A30G 740273

Drop Box

VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)

RECO	MME	NDAT	ION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION


There is no indication of any contamination in the oil.


FLUID CONDITION

The oil viscosity is lower than normal. Confirm oil type.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP444769	VCP417655	VCP364493
Sample Date		Client Info		25 Apr 2024	22 Aug 2023	01 Sep 2022
Machine Age	hrs	Client Info		11987	11091	10152
Oil Age	hrs	Client Info		3000	4000	2000
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Changed	Changed
Filter Changed		Client Info		Not Changd	Changed	Changed
Sample Status				ATTENTION	ATTENTION	ATTENTION
Iron	ppm	ASTM D5185m	>500	66	82	57
Chromium	ppm	ASTM D5185m	>20	1	<1	<1
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>30	20	23	16
Lead	ppm	ASTM D5185m	>30	0	0	<1
Copper	ppm	ASTM D5185m	>30	1	1	2
Tin	ppm	ASTM D5185m	>20	<1	<1	0
Vanadium	ppm	ASTM D5185m		<1	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Silicon	ppm	ASTM D5185m	>50	31	36	38
Potassium	ppm	ASTM D5185m	>20	2	0	2
			0.0			
Water		WC Method	>0.2	NEG	NEG	NEG
Water Silt	scalar	WC Method *Visual	>0.2	NEG	NEG NONE	NEG NONE
	scalar scalar			-		
Silt		*Visual	NONE	NONE	NONE	NONE
Silt Debris	scalar	*Visual *Visual	NONE NONE	NONE NONE	NONE NONE	NONE
Silt Debris Sand/Dirt	scalar scalar	*Visual *Visual *Visual	NONE NONE NONE	NONE NONE NONE	NONE NONE NONE	NONE NONE NONE NORML
Silt Debris Sand/Dirt Appearance	scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NORML	NONE NONE NONE NORML	NONE NONE NONE NORML	NONE NONE NONE
Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NONE NORE NORML	NONE NONE NORML NORML	NONE NONE NORML NORML
Silt Debris Sand/Dirt Appearance Odor Emulsified Water	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NONE NORML NORML NEG	NONE NONE NORML NORML NEG	NONE NONE NORML NORML
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual ASTM D5185m	NONE NONE NORML NORML >0.2	NONE NONE NORML NORML NEG 4	NONE NONE NORML NORML NEG 2	NONE NONE NORML NORML NEG
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron	scalar scalar scalar scalar scalar ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m	NONE NONE NORML NORML >0.2	NONE NONE NORML NORML NEG 4 167	NONE NONE NORML NORML NEG 2 187	NONE NONE NORML NORML NEG 1 203
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium	scalar scalar scalar scalar scalar ppm ppm	*Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m	NONE NONE NONE NORML >0.2 1111 0.0	NONE NONE NORML NORML NEG 4 167 0	NONE NONE NORML NORML NEG 2 187 0	NONE NONE NORML NORML NEG 1 203 2
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum	scalar scalar scalar scalar scalar ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML >0.2 1111 0.0	NONE NONE NORML NORML NEG 4 167 0 3	NONE NONE NORML NORML NEG 2 187 0 2	NONE NONE NORML NORML NEG 1 203 2 2
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese	scalar scalar scalar scalar ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NORME NORML >0.2 1111 0.0 0.9 0.0	NONE NONE NORML NORML NEG 4 167 0 3 2	NONE NONE NORML NORML NEG 2 187 0 2 3	NONE NONE NORML NORML NEG 1 203 2 2 2 2
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium	scalar scalar scalar scalar ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML >0.2 1111 0.0 0.9 0.0 39	NONE NONE NORML NORML NEG 4 167 0 3 2 2 27	NONE NONE NORML NORML NEG 2 187 0 2 3 2 3 25	NONE NONE NORML NORML NEG 1 203 2 2 2 2 2 2
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium	scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NORML NORML >0.2 1111 0.0 0.9 0.9 39 93	NONE NORML NORML NEG 4 167 0 3 2 2 27 27	NONE NORML NORML NEG 2 187 0 2 3 2 3 25 16	NONE NONE NORML NORML NEG 1 203 2 2 2 2 2 2 2 2 15
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium	scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NORME NORML >0.2 1111 0.0 0.9 0.0 39 93 920	NONE NONE NORML NORML NEG 4 167 0 3 2 27 27 27 27 1451	NONE NONE NORML NORML NEG 2 187 0 2 3 2 3 25 16 1387	NONE NONE NORML NORML NEG 1 203 2 2 2 2 2 2 2 2 2 15 1566

Contact/Location: KENNY HANEY - VOLVO0093

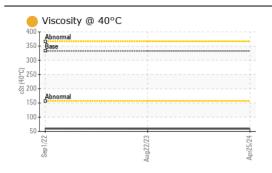

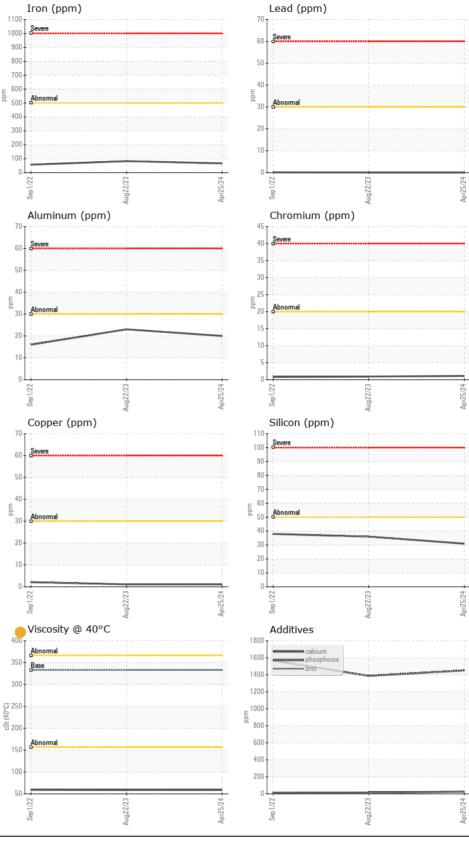

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP444769 : 30 May 2024 Lab Number : 06195774 TAMPA, FL Tested : 31 May 2024 Unique Number : 11057897 : 01 Jun 2024 - Don Baldridge US 33619 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 F: (813)630-2233 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: KENNY HANEY - VOLVO0093