



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**VOLVO L90H 626088**  
Component  
**Transmission (Auto)**  
Fluid  
**VOLVO AT 102 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP444337</b>	VCP393546	VCP409310
Sample Date		Client Info		<b>24 Apr 2024</b>	07 Jun 2023	10 Feb 2023
Machine Age	hrs	Client Info		<b>4940</b>	3173	2420
Oil Age	hrs	Client Info		<b>0</b>	3141	2420
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>160	<b>42</b>	138	108
Chromium	ppm	ASTM D5185m	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	1	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>5	<b>0</b>	0	1
Aluminum	ppm	ASTM D5185m	>50	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185m	>50	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185m	>225	<b>5</b>	17	12
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185m	>20	<b>3</b>	8	7
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	2	2
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>4</b>	<1	4
Boron	ppm	ASTM D5185m	187	<b>80</b>	75	56
Barium	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	<1	<1
Manganese	ppm	ASTM D5185m	0.0	<b>3</b>	10	9
Magnesium	ppm	ASTM D5185m	6.8	<b>1</b>	2	1
Calcium	ppm	ASTM D5185m	215	<b>86</b>	100	80
Phosphorus	ppm	ASTM D5185m	445	<b>200</b>	227	189
Zinc	ppm	ASTM D5185m	56	<b>22</b>	45	28
Sulfur	ppm	ASTM D5185m	1336	<b>2109</b>	2255	1657
Visc @ 40°C	cSt	ASTM D445	35.3	<b>27.7</b>	28.9	27.8

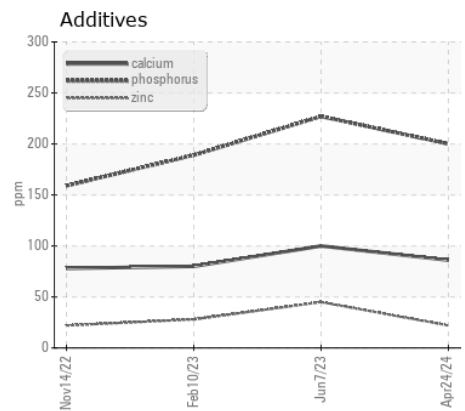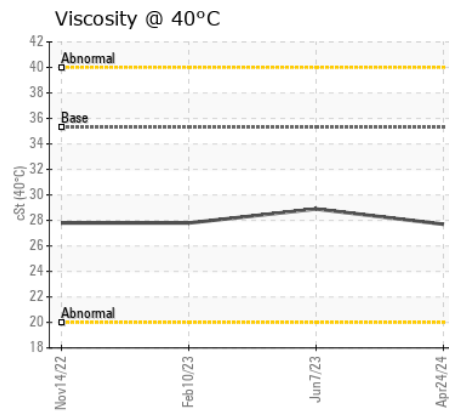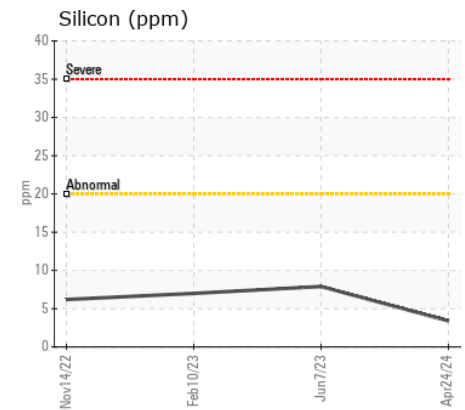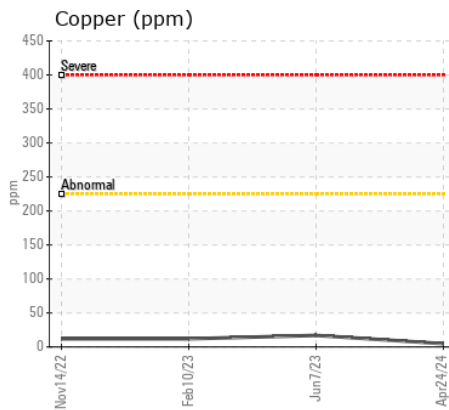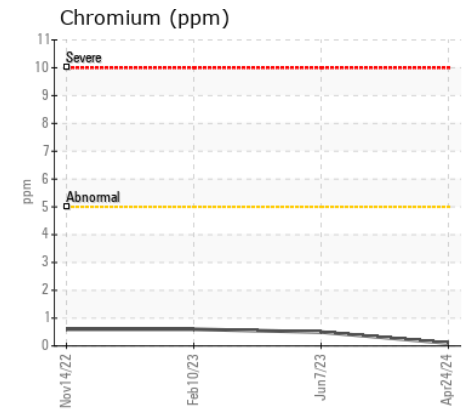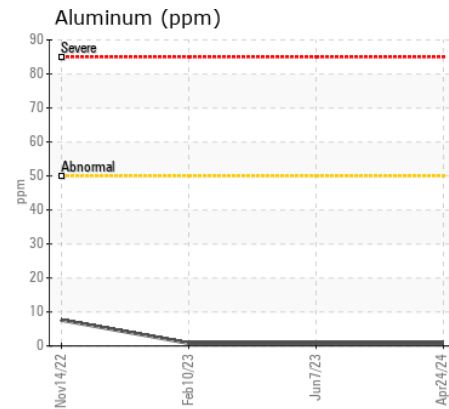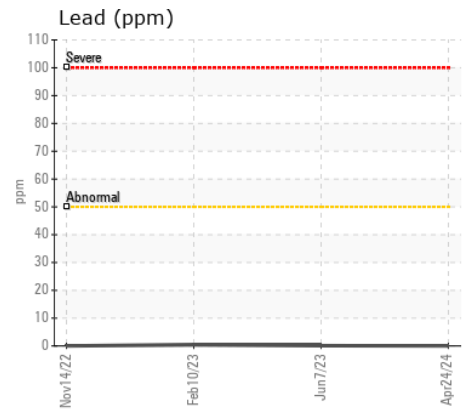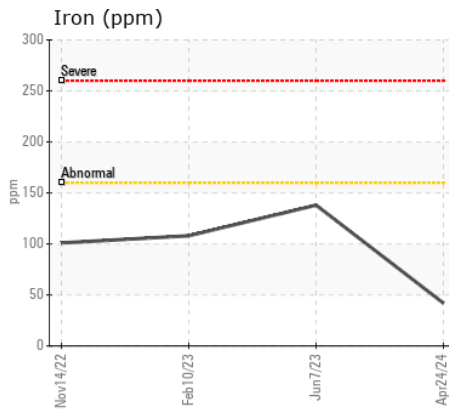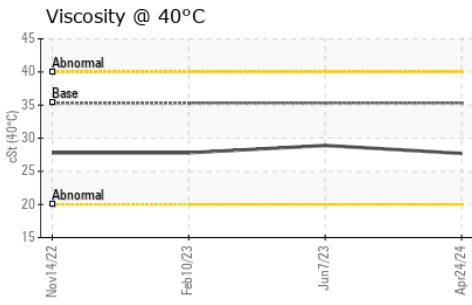

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP444337  
**Lab Number** : 06195829  
**Unique Number** : 11057952  
**Test Package** : MOB 1

**Received** : 30 May 2024  
**Tested** : 31 May 2024  
**Diagnosed** : 31 May 2024 - Wes Davis

**OLDCASTLE LAWN AND GARDEN**  
 2427 RWS RANCH RD  
 DAVENPORT, FL  
 US 33837  
 Contact: DAVID ORTIZ  
 david.ortiz@oldcastle.com  
 T: (800)833-2984  
 F: (863)421-1776

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)