



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**JOHN DEERE 700L 1T0700LXCMF397486**  
 Component  
**Hydraulic System**  
 Fluid  
**JOHN DEERE HYDRAU (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0218753</b>	JR0191290	JR0175861
Sample Date		Client Info		<b>12 Jun 2024</b>	01 Nov 2023	01 Jun 2023
Machine Age	hrs	Client Info		<b>3556</b>	2939	2432
Oil Age	hrs	Client Info		<b>1595</b>	978	471
Filter Age	hrs	Client Info		<b>1595</b>	978	471
Oil Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Not Chngd
Filter Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Not Chngd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

PQ	UOM	Method	Limit/Abn	Current	History1	History2
PQ		ASTM D8184		<b>18</b>	8	14
Iron	ppm	ASTM D5185m	>20	<b>6</b>	5	3
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	<1	0
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	<1
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>10	<b>&lt;1</b>	2	<1
Lead	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>75	<b>1</b>	2	1
Tin	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION











The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	<b>4</b>	4	3
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	2	<1
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>5000	<b>627</b>	2100	638
Particles >6µm		ASTM D7647	>1300	<b>179</b>	379	168
Particles >14µm		ASTM D7647	>160	<b>15</b>	19	15
Particles >21µm		ASTM D7647	>40	<b>6</b>	5	6
Particles >38µm		ASTM D7647	>10	<b>0</b>	0	0
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/15/11</b>	18/16/11	16/15/11
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	0	<1
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	0	<1
Manganese	ppm	ASTM D5185m		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>&lt;1</b>	2	0
Calcium	ppm	ASTM D5185m	87	<b>97</b>	89	88
Phosphorus	ppm	ASTM D5185m	727	<b>671</b>	605	600
Zinc	ppm	ASTM D5185m	900	<b>866</b>	814	782
Sulfur	ppm	ASTM D5185m	1500	<b>1884</b>	1624	1718
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	<b>0.69</b>	0.70	0.65
Visc @ 40°C	cSt	ASTM D445	65	<b>55.9</b>	56.21	57.4

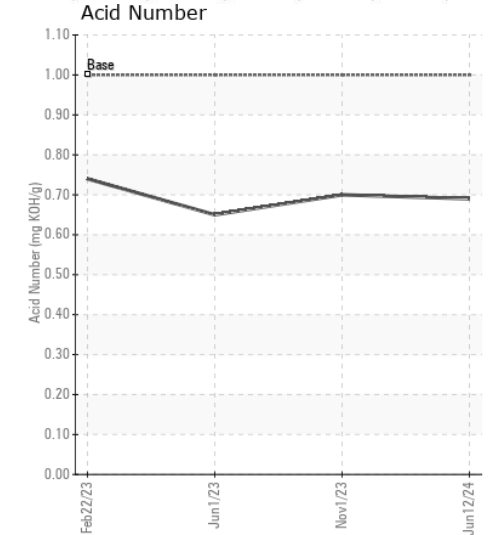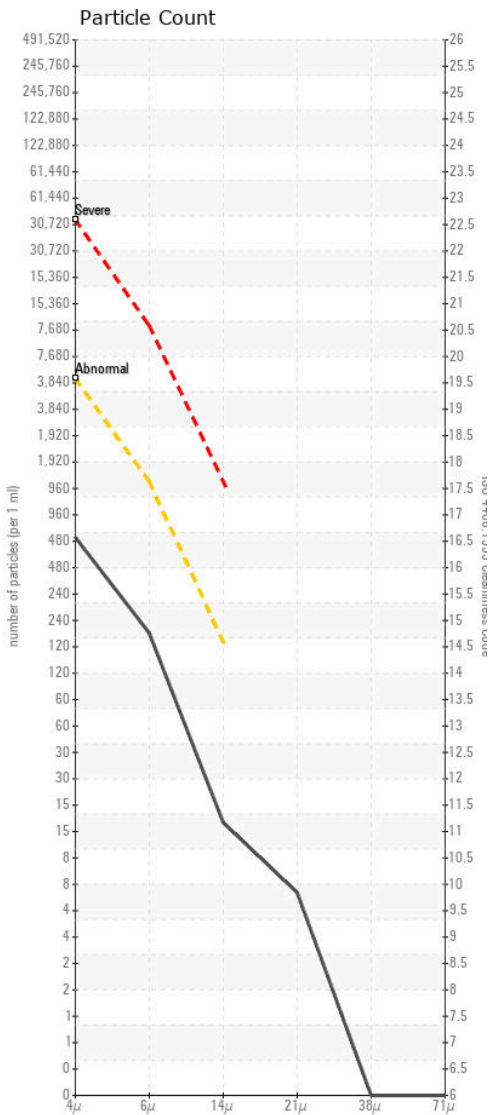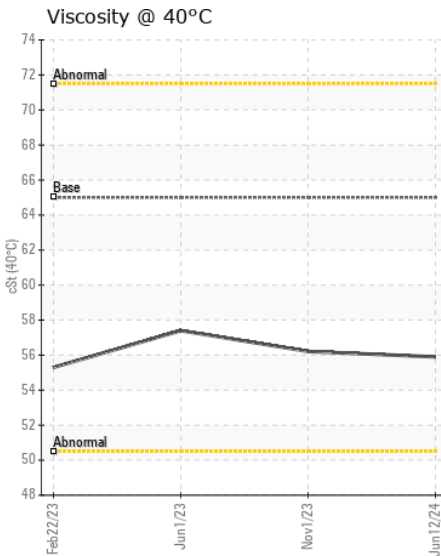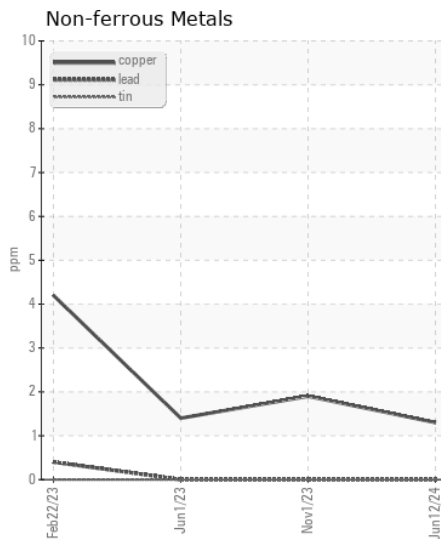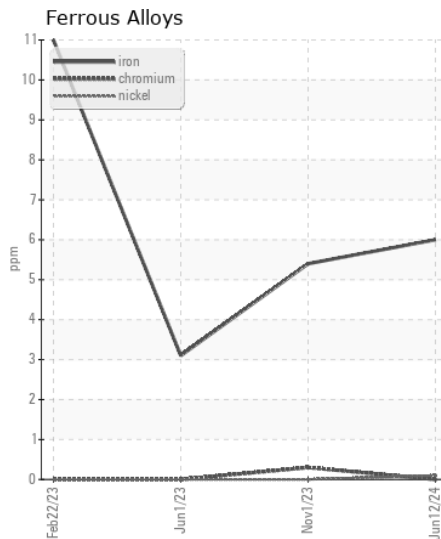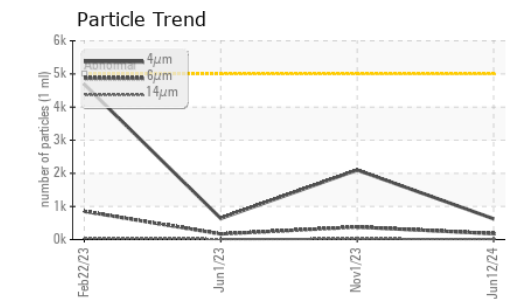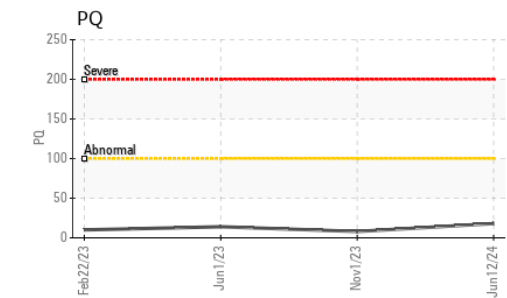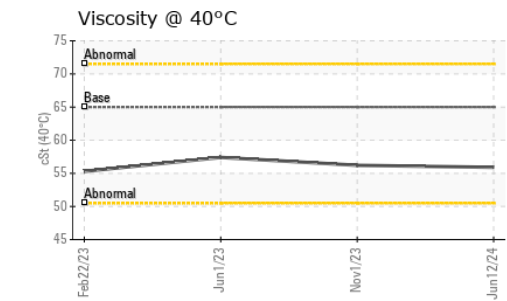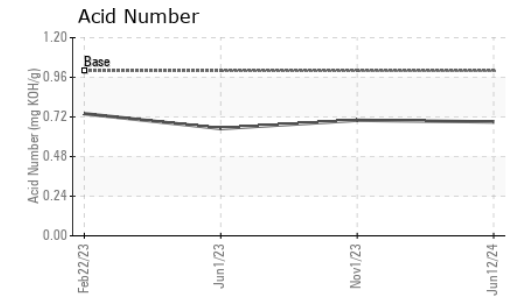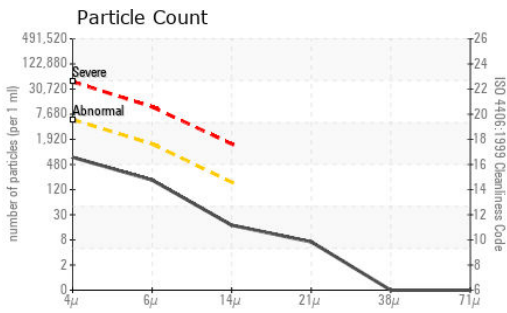

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513

Sample No. : JR0218753

Lab Number : 06209995

Unique Number : 11082859

Test Package : CONST ( Additional Tests: PQ )

Received : 14 Jun 2024

Tested : 17 Jun 2024

Diagnosed : 17 Jun 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

JRE - ASHEVILLE

101 BRUCE DRIVE

ASHEVILLE, NC

US 28806

Contact: Randy Warren

randy.warren@jamesriverequipment.com

T: (528)667-0176

F: (828)667-4865