



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[TUCKER]**  
Machine Id  
**VOLVO A25G 742097**  
Component  
**Drop Box**  
Fluid  
**VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP444780</b>	VCP386230	VCP385837
Sample Date		Client Info		<b>10 Apr 2024</b>	12 Oct 2022	12 Oct 2022
Machine Age	hrs	Client Info		<b>7317</b>	6141	6141
Oil Age	hrs	Client Info		<b>0</b>	1500	2000
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	Changed
Sample Status				<b>NORMAL</b>	ABNORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	<b>76</b>	25	208
Chromium	ppm	ASTM D5185m	>20	<b>1</b>	<1	4
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	1
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>3</b>	<1	<1
Lead	ppm	ASTM D5185m	>30	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185m	>30	<b>&lt;1</b>	4	13
Tin	ppm	ASTM D5185m	>20	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>11</b>	3	3
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	0	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	▲ MODER	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	0	1
Boron	ppm	ASTM D5185m	111	<b>134</b>	157	163
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.9	<b>10</b>	3	5
Manganese	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	<1	6
Magnesium	ppm	ASTM D5185m	39	<b>18</b>	25	15
Calcium	ppm	ASTM D5185m	93	<b>51</b>	98	57
Phosphorus	ppm	ASTM D5185m	920	<b>952</b>	972	1043
Zinc	ppm	ASTM D5185m	104	<b>106</b>	163	47
Sulfur	ppm	ASTM D5185m	20179	<b>21136</b>	27911	26509
Visc @ 40°C	cSt	ASTM D445	333	<b>215</b>	232	194

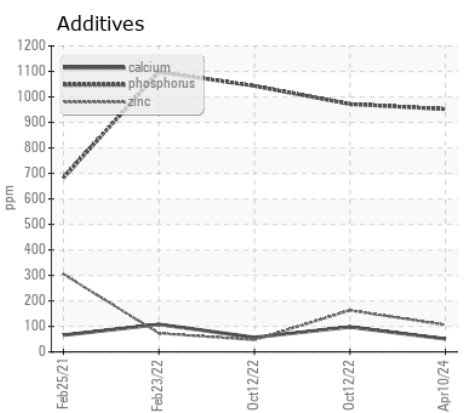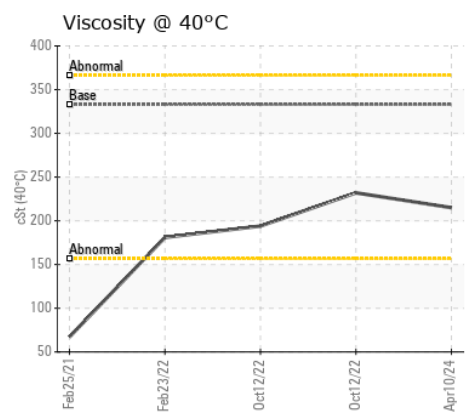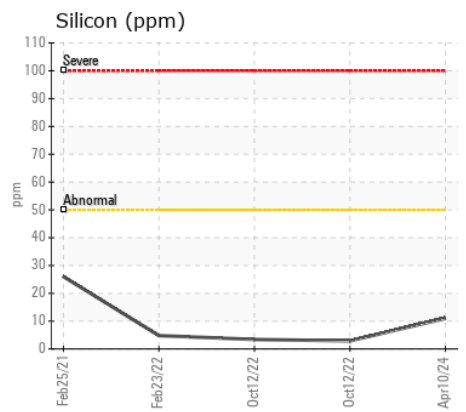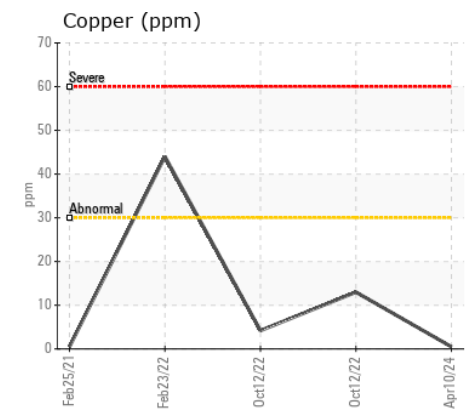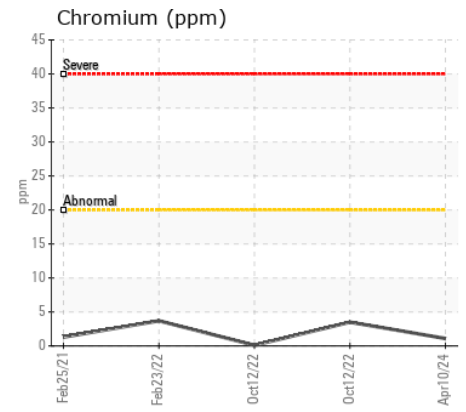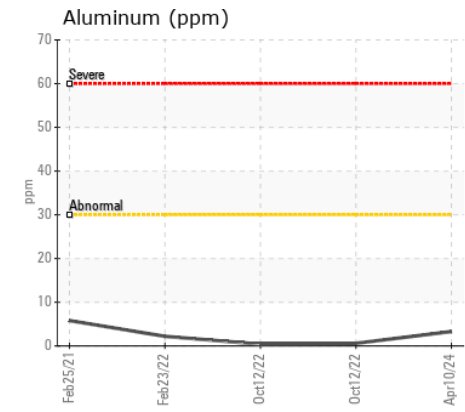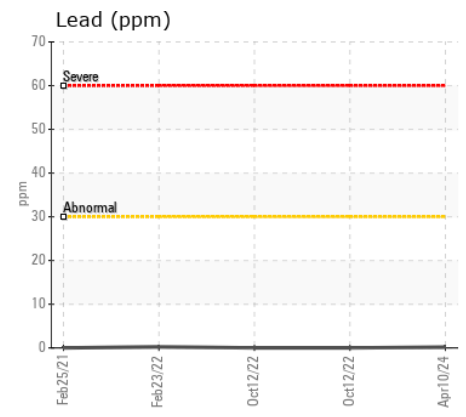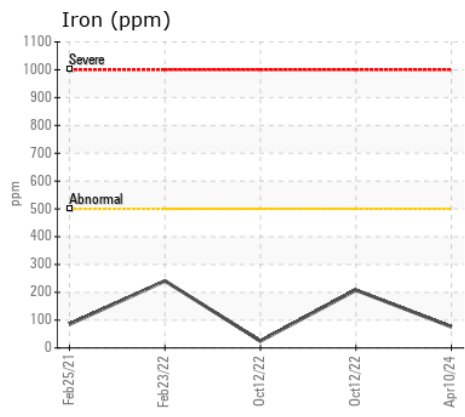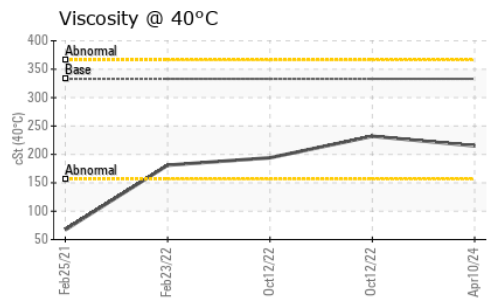

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP444780 **Received** : 14 Jun 2024  
**Lab Number** : 06210491 **Tested** : 17 Jun 2024  
**Unique Number** : 11083355 **Diagnosed** : 17 Jun 2024 - Wes Davis  
**Test Package** : MOB 1

**ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC**  
 8418 PALM RIVER ROAD  
 TAMPA, FL  
 US 33619  
 Contact: KENNY HANEY  
 khaney@flaglerce.com  
 T: (813)630-0077  
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)