

WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

[PRINCE]

VOLVO L90HY 626458

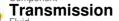

VOLVO AUTOMATIC TRANS	JWIISSION I LOI	DAI	102 (MAL)			
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP447033		
	Sample Date		Client Info		09 Apr 2024		
	Machine Age	hrs	Client Info		2481		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	3		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	3		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>50	1		
	Tin	ppm	ASTM D5185m	>20	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	O'''		40714 0-10-				
CONTAMINATION	Silicon	ppm	ASTM D5185m		0		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m		<1		
	Water		WC Method	>0.2	NEG		
	Silt Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		114		
	Barium	ppm		0.0	<1		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		1		
	Calcium	ppm	ASTM D5185m		58		
	Phosphorus	ppm	ASTM D5185m		193		
	Zinc	ppm	ASTM D5185m		9		
	Sulfur	ppm	ASTM D5185m	1336	1992		
	Visc @ 40°C	cSt	ASTM D445	35.3	29.8		

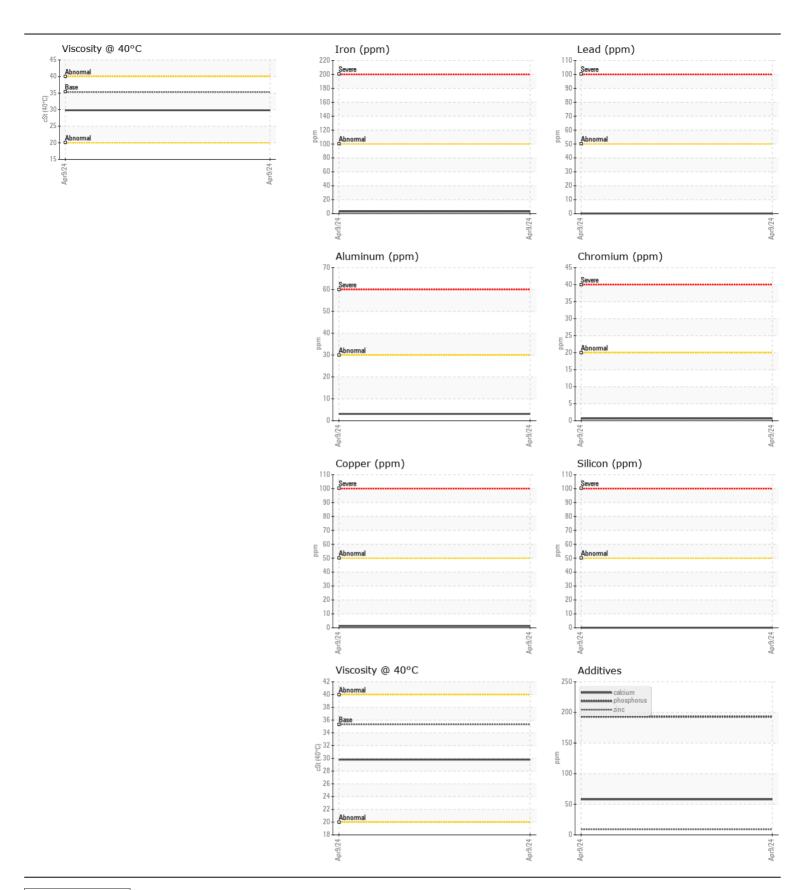



Certificate L2367

Laboratory Sample No.

: VCP447033 Lab Number : 06210613 Unique Number : 11083477 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 14 Jun 2024 **Tested** : 17 Jun 2024

: 17 Jun 2024 - Angela Borella Diagnosed

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619

Contact: KENNY HANEY khaney@flaglerce.com

T: (813)630-0077

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (813)630-2233