

Area SOUTH HOLLAND Machine Id LINKBELT 235HSL CC6951 (S/N P5L1-6951)

Diesel Engine


DIESEL ENGINE OIL 10W40 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		HPL0005147		
	Sample Date		Client Info		11 Jun 2024		
	Machine Age	hrs	Client Info		1455		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	7		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m	>4	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	0		
	Aluminum	ppm	ASTM D5185m	>20	5		
	Lead	ppm	ASTM D5185m	>40	0		
	Copper	ppm	ASTM D5185m	>330	1		
	Tin	ppm	ASTM D5185m	>15	0		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	10		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	0		
	Fuel		WC Method	>5	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	9.8		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	36.6		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		1		
	Boron	ppm	ASTM D5185m	250	3		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m	10	0		
	Molybdenum	ppm	ASTM D5185m		556		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m	450	1033		
	Calcium	ppm	ASTM D5185m		2703		
	Phosphorus	ppm	ASTM D5185m		1108		
	Zinc	ppm	ASTM D5185m		1388		
	Sulfur	ppm	ASTM D5185m		9830		
	Oxidation	Abs/.1mm	*ASTM D7414		39.3		
	Base Number (BN)		ASTM D2896		14.68		
		0					

Visc @ 100°C cSt

ASTM D445 14.4

13.3

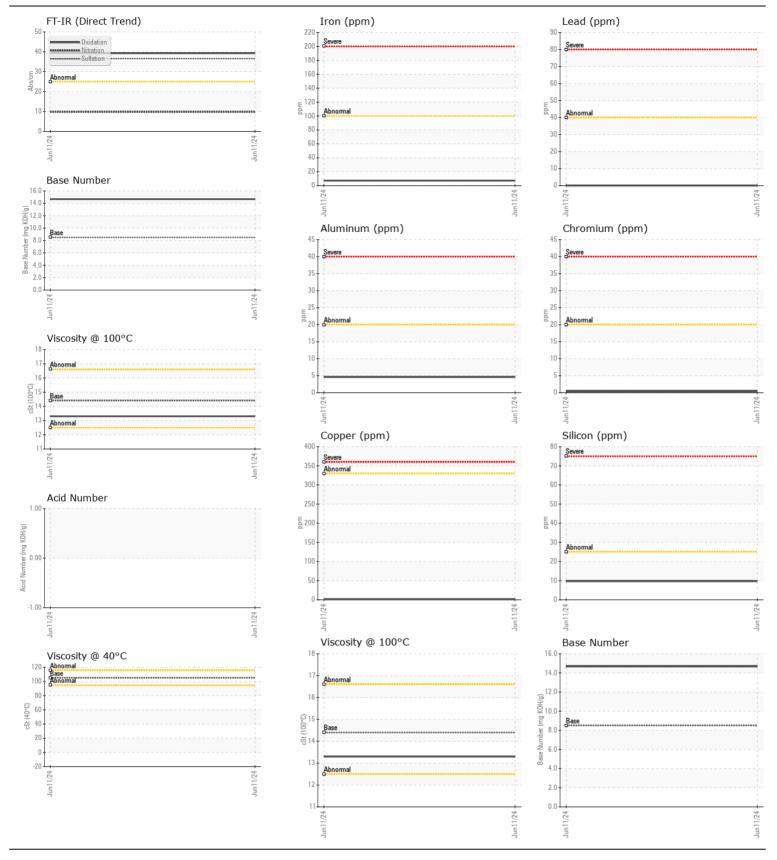

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 STEVENSON CRANE Sample No. Received 410 STEVENSON DR : HPL0005147 : 14 Jun 2024 1 Lab Number : 06210903 Tested BOLINGBROOK, IL : 18 Jun 2024 Unique Number : 11083767 : 18 Jun 2024 - Sean Felton US 60440 Diagnosed Test Package : MOB 2 (Additional Tests: KV40, TAN Man) Contact: DAVE KOEHNE Certificate L2367 davidk@stevensoncrane.com To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (630)972-9199 F: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: DAVE KOEHNE - STEBOL Page 2 of 2