



# OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id  
**DEMI JOHN 2203**  
 Component  
**Diesel Engine**  
 Fluid  
**DIESEL ENGINE OIL SAE 40 (--- QTS)**

## RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0941899</b>	WC0792374	---
Sample Date		Client Info		<b>16 Jun 2024</b>	10 May 2023	---
Machine Age	hrs	Client Info		<b>0</b>	0	---
Oil Age	hrs	Client Info		<b>0</b>	0	---
Filter Age	hrs	Client Info		<b>0</b>	0	---
Oil Changed		Client Info		<b>N/A</b>	N/A	---
Filter Changed		Client Info		<b>N/A</b>	N/A	---
Sample Status				<b>NORMAL</b>	NORMAL	---

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>5</b>	11	---
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	<1	---
Nickel	ppm	ASTM D5185m	>4	<b>&lt;1</b>	0	---
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	---
Silver	ppm	ASTM D5185m	>3	<b>0</b>	0	---
Aluminum	ppm	ASTM D5185m	>20	<b>2</b>	0	---
Lead	ppm	ASTM D5185m	>40	<b>0</b>	<1	---
Copper	ppm	ASTM D5185m	>330	<b>1</b>	2	---
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---

## CONTAMINATION








There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>3</b>	4	---
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	5	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	---
Water		WC Method	>0.2	<b>NEG</b>	NEG	---
Glycol		WC Method		<b>NEG</b>	NEG	---
Soot %	%	*ASTM D7844	>3	<b>0.1</b>	0.1	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>5.1</b>	6.2	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>18.5</b>	20.0	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	---

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>216	<b>2</b>	4	---
Boron	ppm	ASTM D5185m	250	<b>121</b>	213	---
Barium	ppm	ASTM D5185m	10	<b>0</b>	0	---
Molybdenum	ppm	ASTM D5185m	100	<b>44</b>	16	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	<1	---
Magnesium	ppm	ASTM D5185m	450	<b>298</b>	109	---
Calcium	ppm	ASTM D5185m	3000	<b>1646</b>	2188	---
Phosphorus	ppm	ASTM D5185m	1150	<b>920</b>	1077	---
Zinc	ppm	ASTM D5185m	1350	<b>1082</b>	1260	---
Sulfur	ppm	ASTM D5185m	4250	<b>3534</b>	4208	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>14.4</b>	16.8	---
Base Number (BN)	mg KOH/g	ASTM D2896	8.5	<b>8.9</b>	8.3	---
Visc @ 100°C	cSt	ASTM D445	14.4	<b>12.8</b>	13.0	---

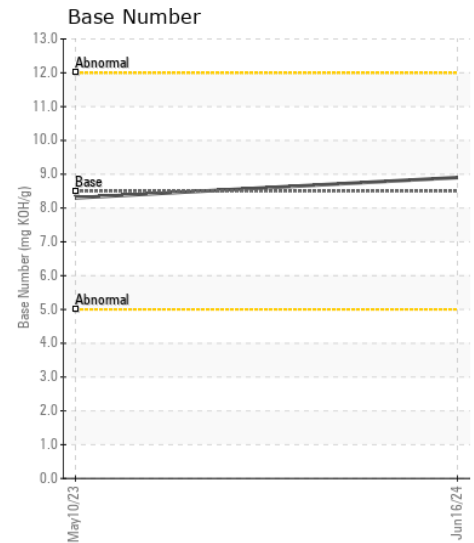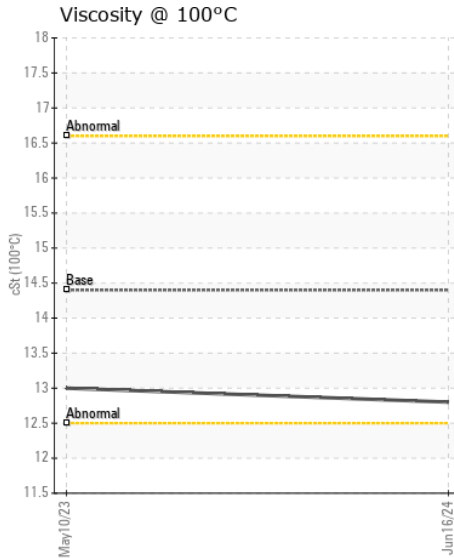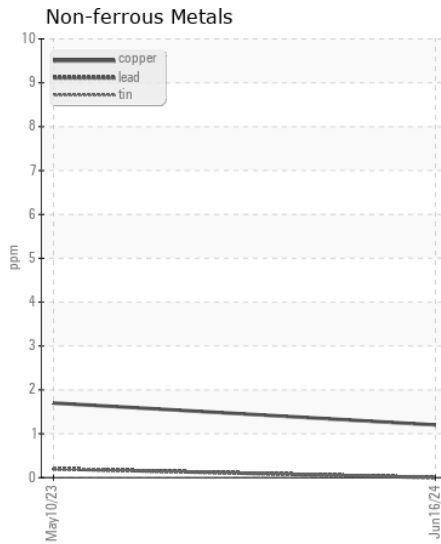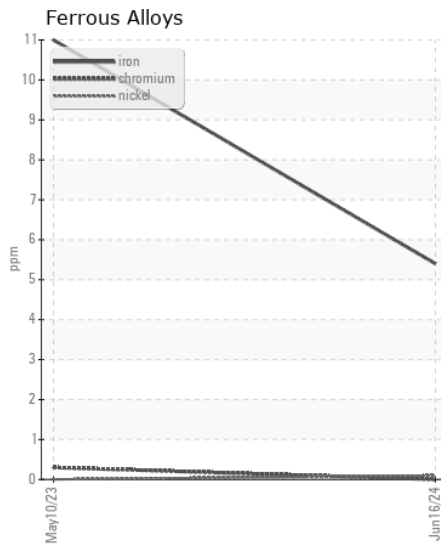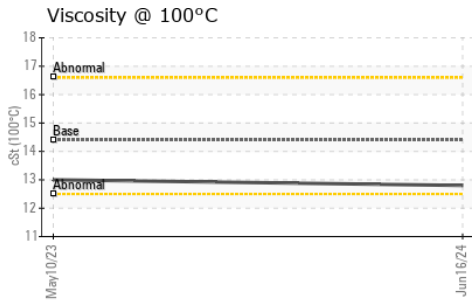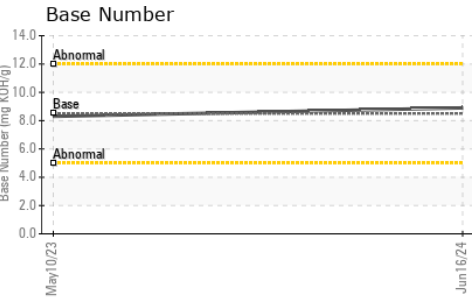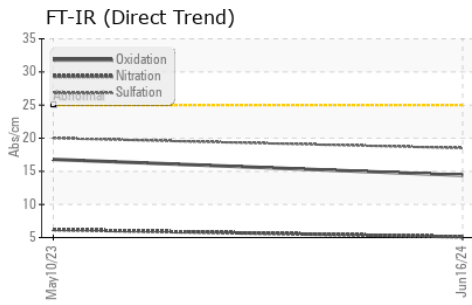

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513

**Sample No.** : WC0941899

**Lab Number** : 06211281

**Unique Number** : 11084145

**Test Package** : CONST ( Additional Tests: TBN )

**Received** : 17 Jun 2024

**Tested** : 18 Jun 2024

**Diagnosed** : 18 Jun 2024 - Wes Davis

**SIDDONS-MARTIN EMERGENCY GROUP**

4401 REX RD

FRIENDSWOOD, TX

US 77546

Contact: Natalie Perrone

nperrone@siddons-martin.com

T:

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)