WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**

[G08870]

VOLVO A30G 740081
Component
Rear Axle


Rear Axie Fluid {not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		VCP439968		
	Sample Date		Client Info		12 Jun 2024		
	Machine Age	hrs	Client Info		12002		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m		46		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		<1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		6		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	MODER		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m		3		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method		NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor		*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual		NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		43		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		12		
	Calcium	ppm	ASTM D5185m		76		
	Phosphorus	ppm	ASTM D5185m		1075		
	Zinc	ppm	ASTM D5185m		55		

Sulfur

26456

ASTM D5185m

ppm

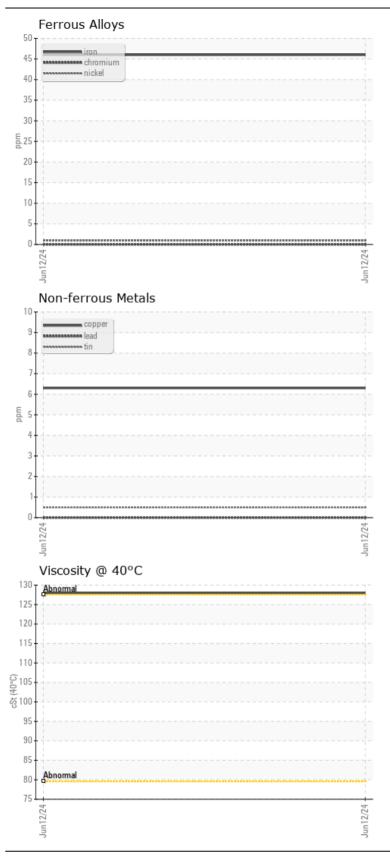





Certificate L2367

Laboratory Sample No.

: VCP439968 Lab Number : 06212614 Unique Number : 11085478 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Jun 2024 **Tested** : 19 Jun 2024

Diagnosed : 19 Jun 2024 - Wes Davis **OCEAN COUNTY LANDFILL**

PO BOX 207 BELLFORD, NJ US 07718

Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (732)787-0226 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (732)495-6225