



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL

Machine Id
KOMATSU Wa600 (S/N 60135)
 Component
Hydraulic System
 Fluid
TULCO LUBSOIL SUPER HYDRAULIC HZ 46 (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		TO10002110	TO10003148	TO10002723
Sample Date		Client Info		13 Jun 2024	20 Feb 2024	18 Oct 2023
Machine Age	hrs	Client Info		22846	22323	21834
Oil Age	hrs	Client Info		523	1568	1079
Filter Age	hrs	Client Info		523	489	79
Oil Changed		Client Info		Not Changed	Changed	Not Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>20	23	22	17
Chromium	ppm	ASTM D5185m	>20	<1	<1	<1
Nickel	ppm	ASTM D5185m	>20	<1	0	<1
Titanium	ppm	ASTM D5185m		<1	0	<1
Silver	ppm	ASTM D5185m		<1	0	0
Aluminum	ppm	ASTM D5185m	>20	2	2	2
Lead	ppm	ASTM D5185m	>20	<1	0	<1
Copper	ppm	ASTM D5185m	>20	10	9	6
Tin	ppm	ASTM D5185m	>20	<1	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION











There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185m	>15	7	5	4
Potassium	ppm	ASTM D5185m	>20	2	2	2
Water	%	ASTM D6304	>0.05	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	▲ 80713	▲ 114275	▲ 122762
Particles >6µm		ASTM D7647	>1300	▲ 6910	▲ 13382	▲ 19849
Particles >14µm		ASTM D7647	>160	57	152	▲ 283
Particles >21µm		ASTM D7647	>40	12	37	▲ 49
Particles >38µm		ASTM D7647	>10	0	1	1
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 24/20/13	▲ 24/21/14	▲ 24/21/15
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		2	0	0
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		<1	8	9
Molybdenum	ppm	ASTM D5185m		<1	0	<1
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m		158	145	155
Calcium	ppm	ASTM D5185m		185	201	184
Phosphorus	ppm	ASTM D5185m		692	719	702
Zinc	ppm	ASTM D5185m		947	870	963
Sulfur	ppm	ASTM D5185m		3020	2883	3107
Acid Number (AN)	mg KOH/g	ASTM D8045		0.88	1.01	0.72
Visc @ 40°C	cSt	ASTM D445		47.3	49.8	47.0
Visc @ 100°C	cSt	ASTM D445		6.9	7	7
Viscosity Index (VI)	Scale	ASTM D2270		100	95	105

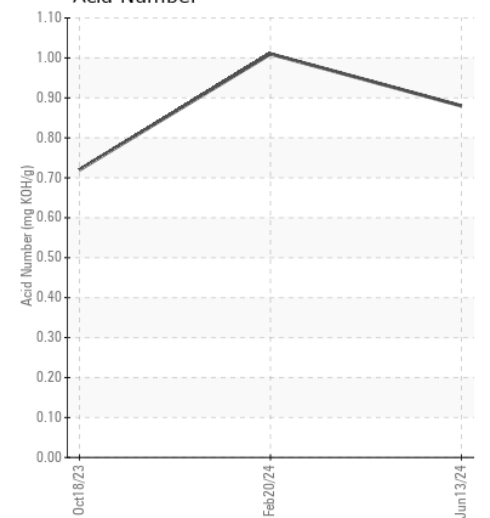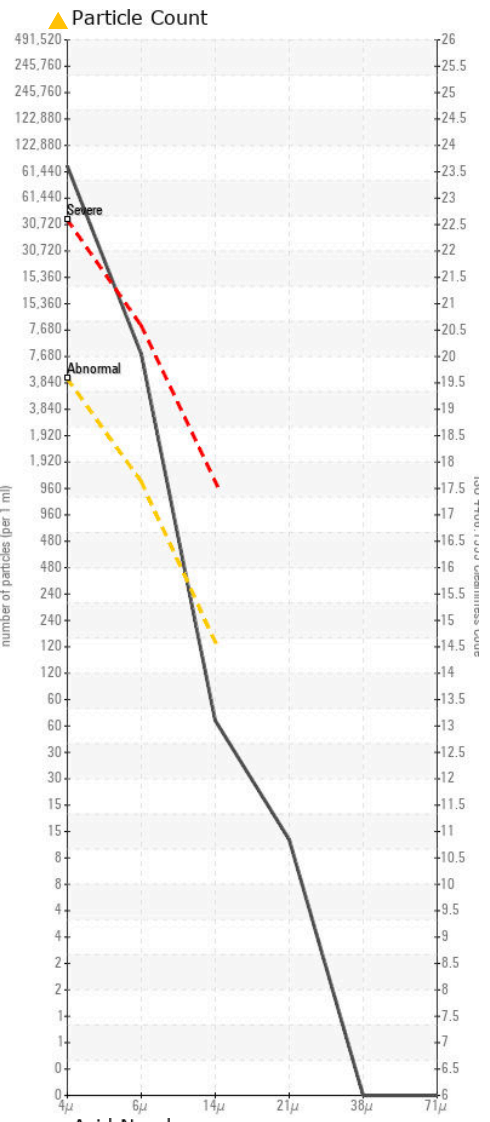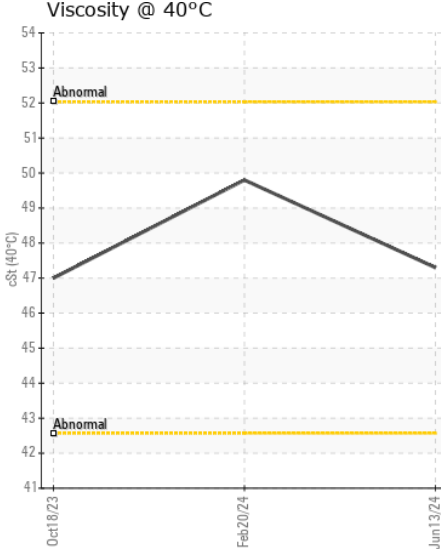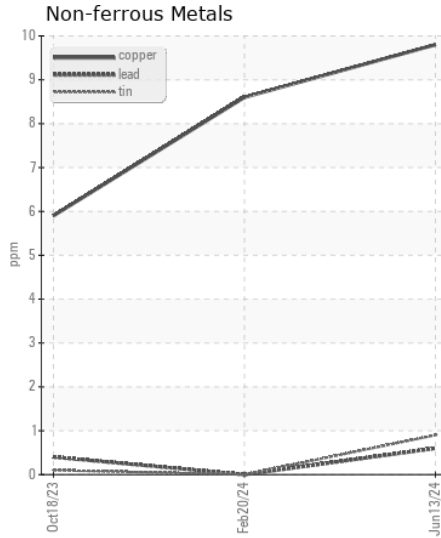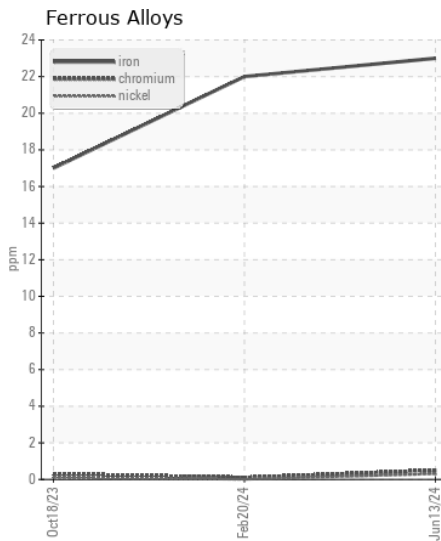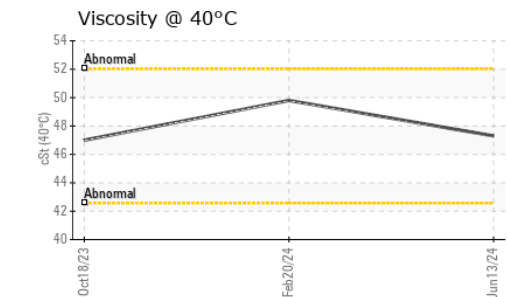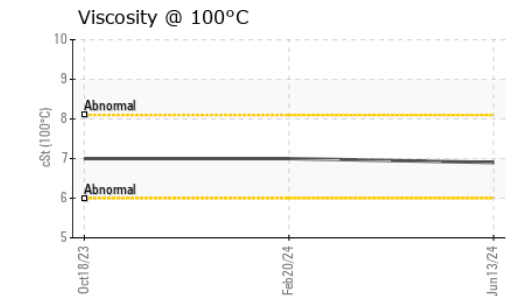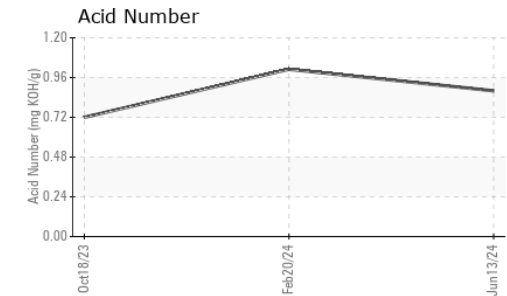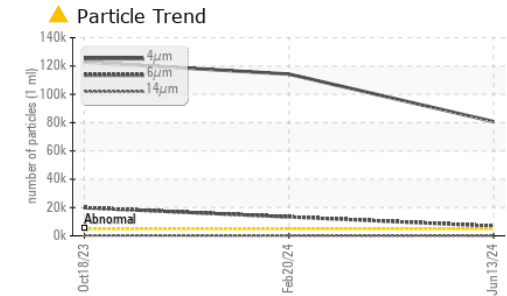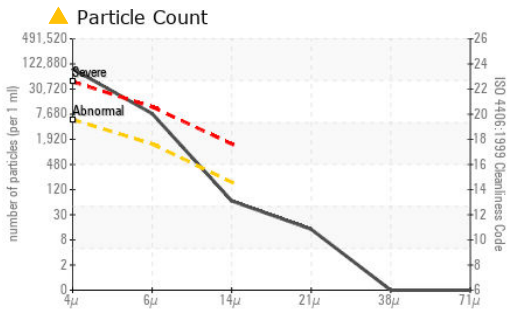

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : TO10002110 **Received** : 18 Jun 2024
Lab Number : 06213455 **Tested** : 20 Jun 2024
Unique Number : 11086319 **Diagnosed** : 20 Jun 2024 - Don Baldrige
Test Package : MOB 2 (Additional Tests: KF, KV100, VI)

ANCHOR STONE TULSA ROCK
 TULSA ROCK QUARRY, 66TH ST N 145TH AVENUE
 TULSA, OK
 US 74137
 Contact: MIKE SNYDER
 msnyder@anchorstoneco.com
 T: (417)850-9635
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)