WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL **NORMAL**

Machine Id

KOMATSU 130LC K23561480

Component
Swing Drive

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		VCP442221		
	Sample Date		Client Info		14 Jun 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		201		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VE A D							
VEAR	Iron	ppm	ASTM D5185m		48		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		1		
	Nickel	ppm	ASTM D5185m	>10	0		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		55		
	Tin	ppm	ASTM D5185m	>10	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	42		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		2		
	Water	le le	WC Method		NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
THE CONDITION							
LUID CONDITION	Sodium	ppm	ASTM D5185m		1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		2		
	Barium	ppm	ASTM D5185m		7		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		11		
	Calcium	ppm	ASTM D5185m		4575		
	Phosphorus	ppm	ASTM D5185m		932		
	Zinc	ppm	ASTM D5185m		1025		
	Sulfur	ppm	ASTM D5185m		12344		

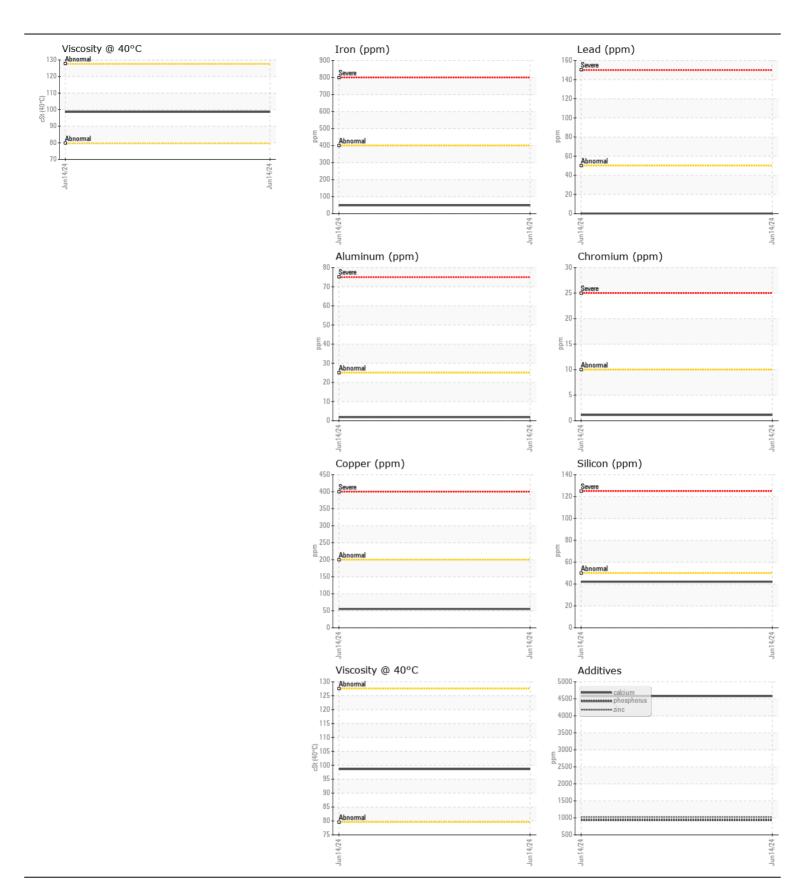



Certificate L2367

Laboratory Sample No.

: VCP442221 Lab Number : 06213849 Unique Number : 11086713 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Jun 2024 **Tested** : 20 Jun 2024

: 20 Jun 2024 - Wes Davis Diagnosed

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619

Contact: KENNY HANEY khaney@flaglerce.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233