



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**VOLVO L120H 632959**

Component  
**Diesel Engine**

Fluid  
**VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP383136</b>	VCP383200	VCP372268
Sample Date		Client Info		<b>14 Jun 2024</b>	25 May 2023	07 Feb 2023
Machine Age	hrs	Client Info		<b>4230</b>	2670	2170
Oil Age	hrs	Client Info		<b>500</b>	0	500
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>200	<b>9</b>	11	11
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	1	<1
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185m	>30	<b>3</b>	5	3
Lead	ppm	ASTM D5185m	>40	<b>0</b>	1	<1
Copper	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185m	>20	<b>0</b>	2	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION













There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>4</b>	4	5
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	2	0
Fuel		WC Method	>6.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.3</b>	0.3	0.3
Nitration	Abs/cm	*ASTM D7624	>20	<b>8.0</b>	8.5	7.8
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>22.8</b>	19.9	23.2
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>2</b>	3	2
Boron	ppm	ASTM D5185m	2.5	<b>32</b>	13	45
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.7	<b>37</b>	14	40
Manganese	ppm	ASTM D5185m	0.0	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185m	256	<b>480</b>	1120	497
Calcium	ppm	ASTM D5185m	2057	<b>1739</b>	1594	1616
Phosphorus	ppm	ASTM D5185m	935	<b>918</b>	1124	879
Zinc	ppm	ASTM D5185m	1223	<b>1034</b>	1411	1084
Sulfur	ppm	ASTM D5185m	4079	<b>3088</b>	3658	3048
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>21.3</b>	15.5	21.4
Base Number (BN)	mg KOH/g	ASTM D2896	10	<b>10.3</b>	10.1	10.2
Visc @ 100°C	cSt	ASTM D445	15.0	<b>13.1</b>	14.2	13.6

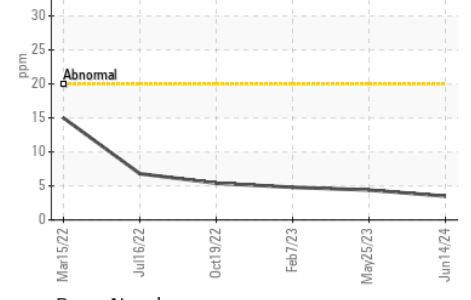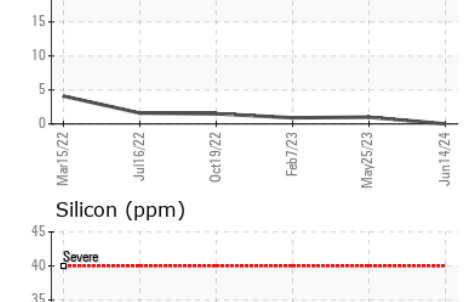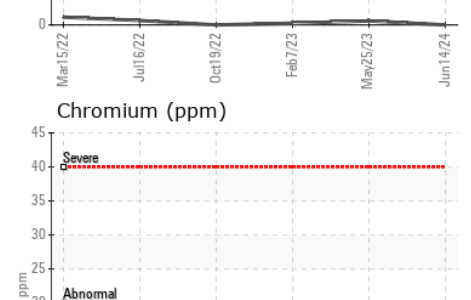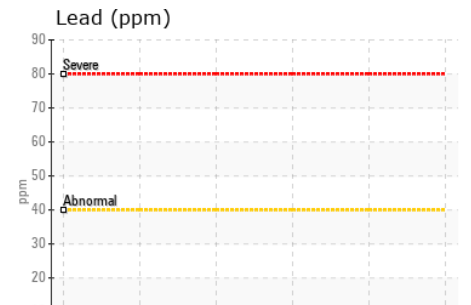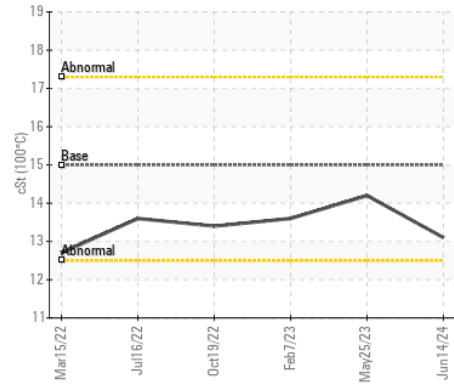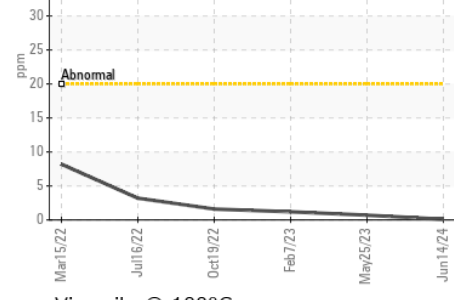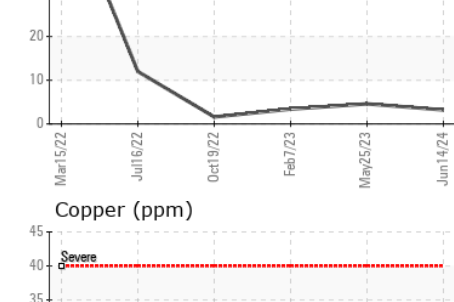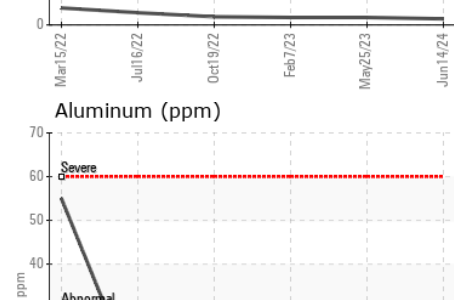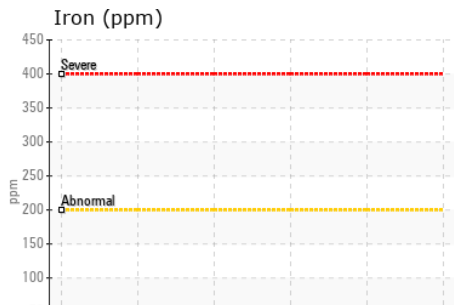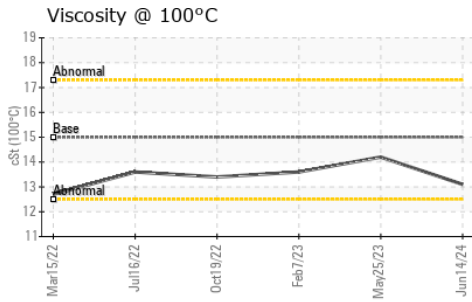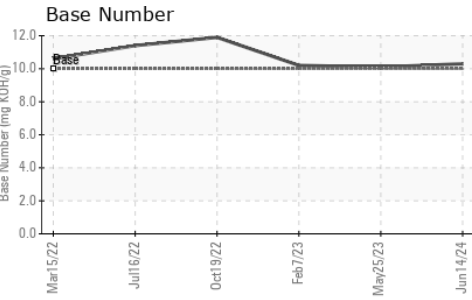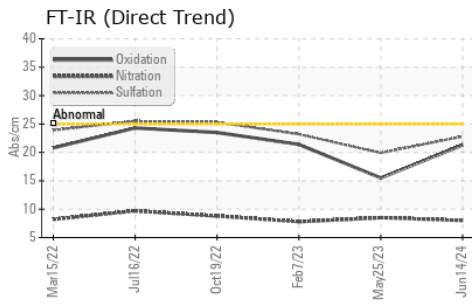

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP383136 **Received** : 19 Jun 2024  
**Lab Number** : 06214335 **Tested** : 20 Jun 2024  
**Unique Number** : 11087199 **Diagnosed** : 20 Jun 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: TBN )

**LEONARDS CONTRACTING**  
 30850 STEPHENSON HWY  
 MADISON HEIGHTS, MI  
 US 48071  
 Contact: LARRY SCHRADER  
 larry.schrader@sdevelop.com  
 T: (810)499-1953  
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)