



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>ABNORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**Rental**  
 Machine Id  
**149903**  
 Component  
**Diesel Engine**  
 Fluid  
**{not provided} (48 GAL)**

## RECOMMENDATION

We advise that you check the fuel injection system. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>RPL0021161</b>	---	---
Sample Date		Client Info		<b>11 Jun 2024</b>	---	---
Machine Age	hrs	Client Info		<b>0</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Changd</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>21</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m	>3	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Lead	ppm	ASTM D5185m	>40	<b>8</b>	---	---
Copper	ppm	ASTM D5185m	>330	<b>&lt;1</b>	---	---
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

## CONTAMINATION









There is a moderate amount of fuel present in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>5</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	---	---
Fuel	%	ASTM D3524	>5	<b>6.9</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	*ASTM D7844	>3	<b>0.5</b>	---	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>10.6</b>	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>26.8</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil.

Sodium	ppm	ASTM D5185m		<b>2</b>	---	---
Boron	ppm	ASTM D5185m		<b>6</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>52</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>820</b>	---	---
Calcium	ppm	ASTM D5185m		<b>1171</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>950</b>	---	---
Zinc	ppm	ASTM D5185m		<b>1162</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>3350</b>	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>29.2</b>	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		<b>5.8</b>	---	---
Visc @ 100°C	cSt	ASTM D445		<b>11.6</b>	---	---

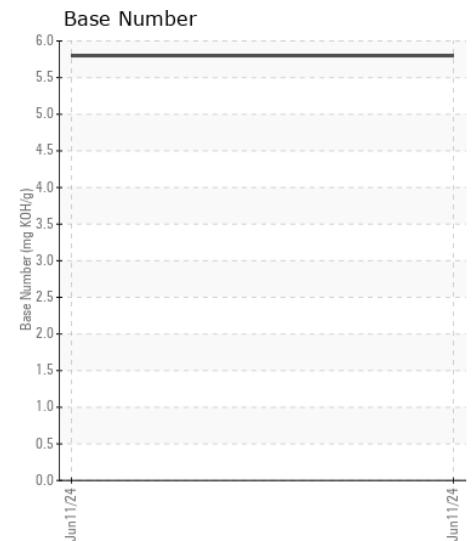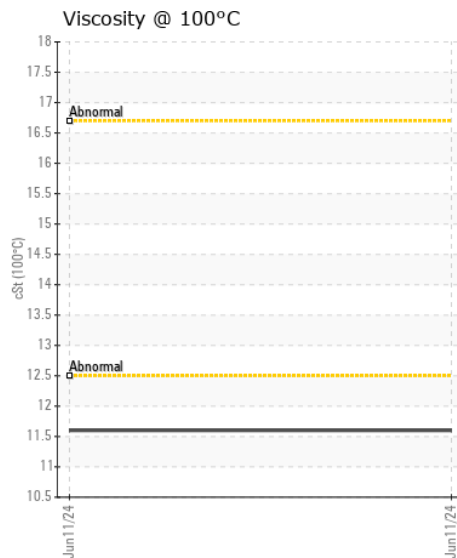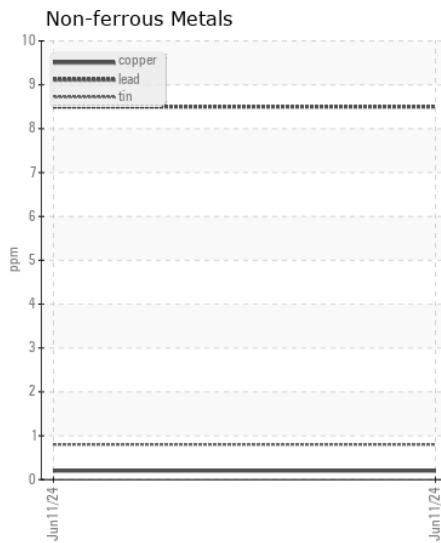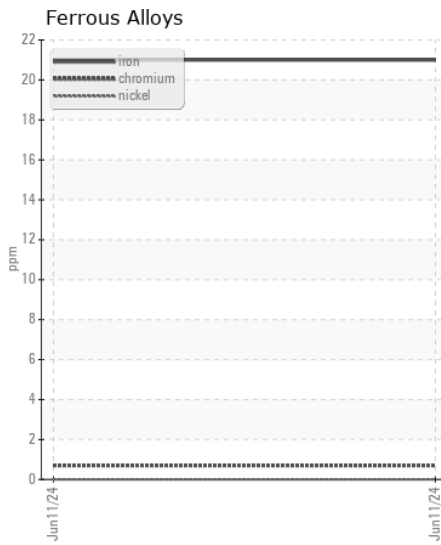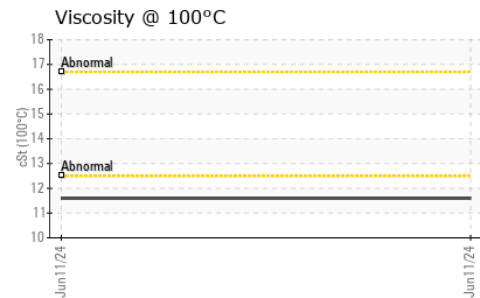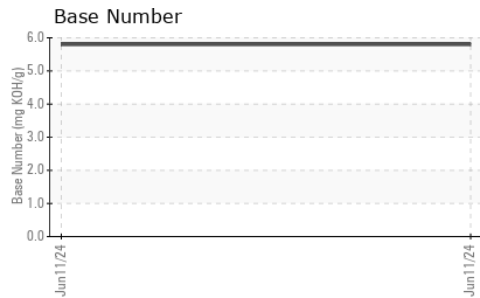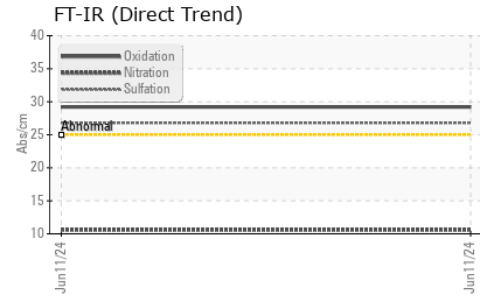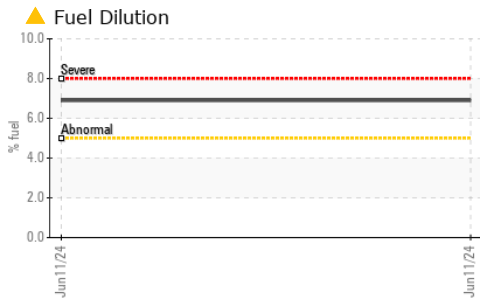

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : RPL0021161 **Received** : 19 Jun 2024  
**Lab Number** : 06214382 **Tested** : 21 Jun 2024  
**Unique Number** : 11087246 **Diagnosed** : 21 Jun 2024 - Don Baldrige  
**Test Package** : FLEET ( Additional Tests: FuelDilution, PercentFuel )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**RTL PACLEASE - 7020 - El Pao**  
 3500 Doniphan Dr  
 El Paso, TX  
 US 79922  
 Contact: JUAN MARTINEZ  
 martinezj15@rushenterprises.com  
 T:  
 F: