



ASCENDUM

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
Ascendum Machinery
Machine Id
VOLVO L120H RL71 (S/N L120HV632898)
Component
Rear Axle
Fluid
VOLVO WB 102 (11 GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		ASC0011123	ASC0008742	ASC0002519
Sample Date		Client Info		16 Jun 2024	31 Mar 2024	20 Jan 2024
Machine Age	hrs	Client Info		5572	5015	4495
Oil Age	hrs	Client Info		1522	1015	495
Filter Age	hrs	Client Info		0	0	495
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Filter Changed		Client Info		N/A	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	160	22	155
Chromium	ppm	ASTM D5185m	>20	4	<1	3
Nickel	ppm	ASTM D5185m	>10	1	<1	<1
Titanium	ppm	ASTM D5185m		<1	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>30	2	2	1
Lead	ppm	ASTM D5185m	>50	<1	0	0
Copper	ppm	ASTM D5185m	>120	15	4	11
Tin	ppm	ASTM D5185m	>20	<1	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION





There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	14	11	17
Potassium	ppm	ASTM D5185m	>20	2	2	2
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		3	1	0
Boron	ppm	ASTM D5185m		138	134	139
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		8	2	8
Manganese	ppm	ASTM D5185m		7	1	7
Magnesium	ppm	ASTM D5185m		23	16	23
Calcium	ppm	ASTM D5185m		3852	3967	3808
Phosphorus	ppm	ASTM D5185m		1260	1342	1114
Zinc	ppm	ASTM D5185m		1528	1629	1575
Sulfur	ppm	ASTM D5185m		4014	4521	3880
Visc @ 40°C	cSt	ASTM D445	55	42.5	42.8	42.5

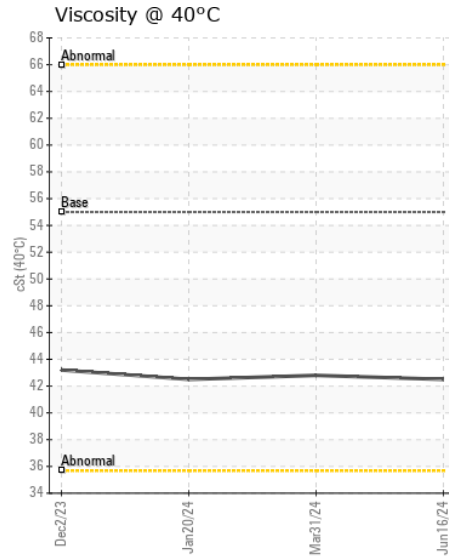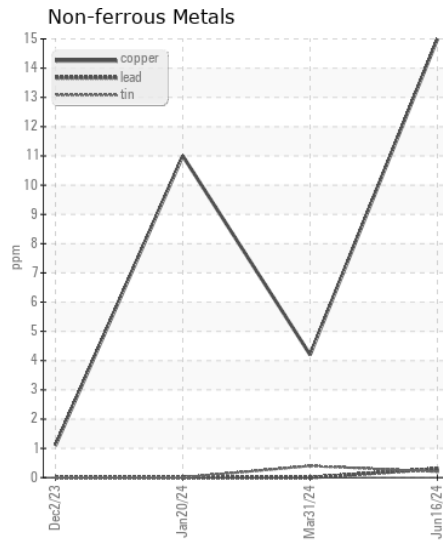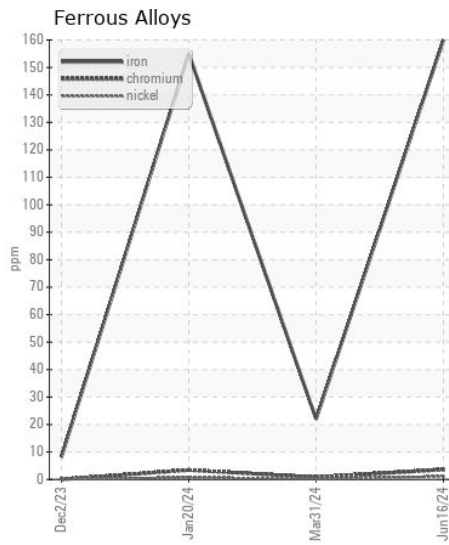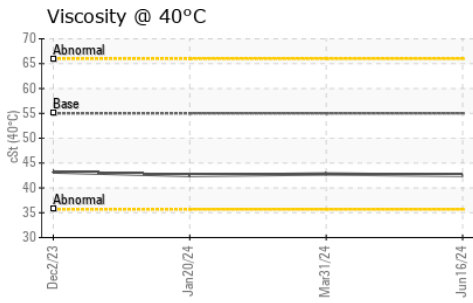

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513

Sample No. : ASC0011123

Lab Number : 06215129

Unique Number : 11087993

Test Package : CONST

Received : 19 Jun 2024

Tested : 20 Jun 2024

Diagnosed : 20 Jun 2024 - Wes Davis

HILCO TRANSPORT

7700 KENMONT RD

GREENSBORO, NC

US 27409

Contact: MIKE LAUGHEAD

mlaughead@hilcotransport.com

T: (336)273-9441

F: (336)273-9701

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)