



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**Store 4 - Fairmont [RO#152082]**  
Machine Id  
**JOHN DEERE 250G 1FF250GXPNF611997**  
Component  
**Hydraulic System**  
Fluid  
**HITACHI HYDRAULIC SUPER EX 46HN (63 GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor. ( Customer Sample Comment: Need Rushed )

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LEC0051106</b>	LEC0047826	LEC0045113
Sample Date		Client Info		<b>18 Jun 2024</b>	23 Feb 2024	23 Oct 2023
Machine Age	hrs	Client Info		<b>1168</b>	1066	994
Oil Age	hrs	Client Info		<b>1168</b>	1066	994
Filter Age	hrs	Client Info		<b>174</b>	1066	994
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Changed</b>	Not Changd	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

PQ		ASTM D8184	>50	<b>17</b>	11	13
Iron	ppm	ASTM D5185m	>32	<b>1</b>	2	3
Chromium	ppm	ASTM D5185m	>9	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185m	>5	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>9	<b>&lt;1</b>	0	2
Lead	ppm	ASTM D5185m	>28	<b>0</b>	0	<1
Copper	ppm	ASTM D5185m	>50	<b>2</b>	2	3
Tin	ppm	ASTM D5185m	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION











The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>11	<b>&lt;1</b>	<1	<1
Potassium	ppm	ASTM D5185m	>20	<b>4</b>	<1	2
Water		WC Method	>0.075	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>80000	<b>717</b>	3015	1190
Particles >6µm		ASTM D7647	>20000	<b>117</b>	233	267
Particles >14µm		ASTM D7647	>640	<b>9</b>	8	16
Particles >21µm		ASTM D7647	>160	<b>1</b>	2	4
Particles >38µm		ASTM D7647	>40	<b>0</b>	0	0
Particles >71µm		ASTM D7647	>10	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>23/21/16	<b>17/14/10</b>	19/15/10	17/15/11
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.075	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>21	<b>3</b>	1	0
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	0	3
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	<1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Magnesium	ppm	ASTM D5185m		<b>1</b>	<1	<1
Calcium	ppm	ASTM D5185m		<b>8</b>	8	4
Phosphorus	ppm	ASTM D5185m	827	<b>553</b>	536	543
Zinc	ppm	ASTM D5185m	0	<b>41</b>	28	21
Sulfur	ppm	ASTM D5185m	13	<b>115</b>	120	40
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	<b>0.14</b>	0.18	0.14
Visc @ 40°C	cSt	ASTM D445	47	<b>46.8</b>	46.7	46.5

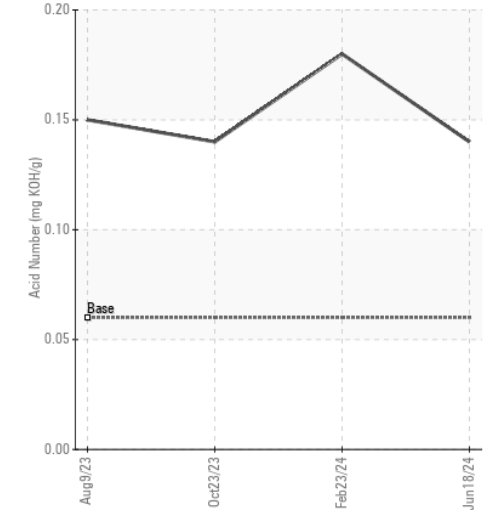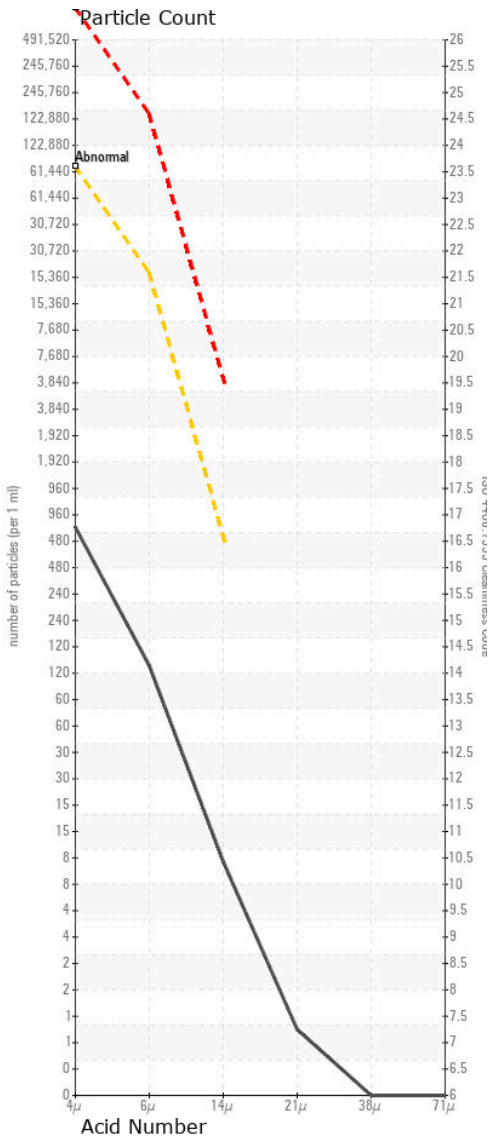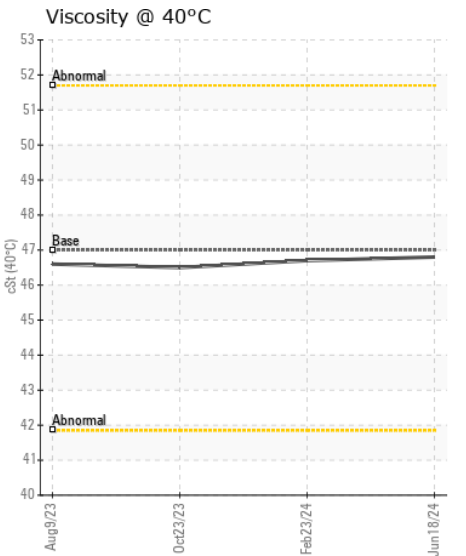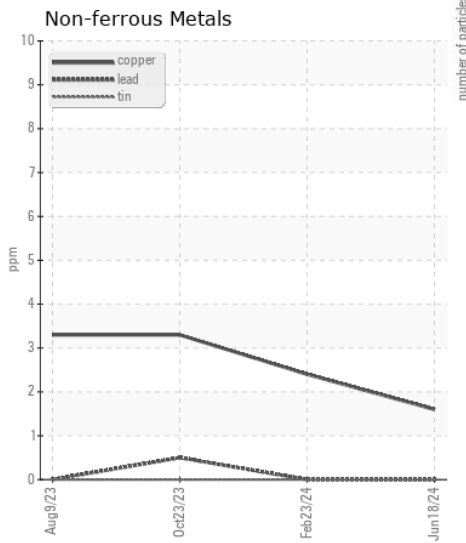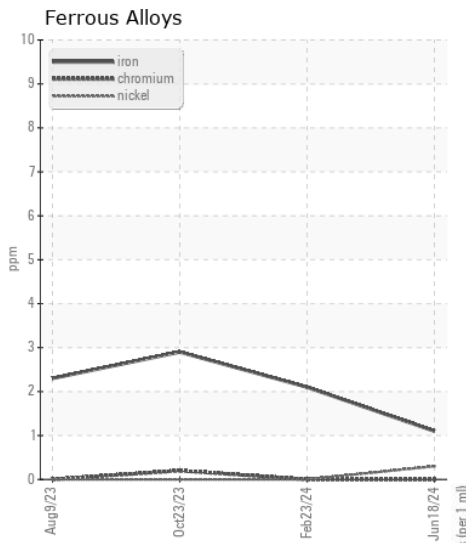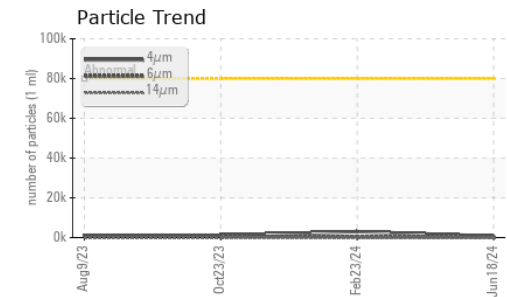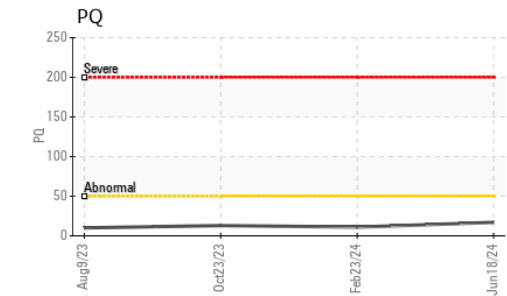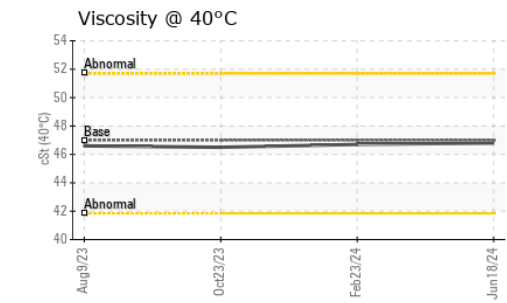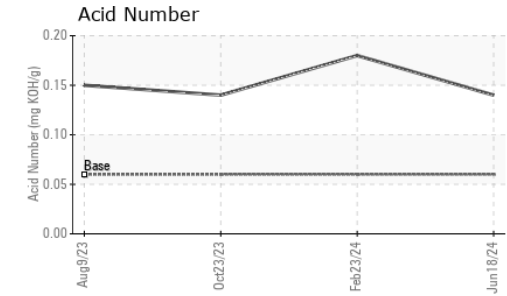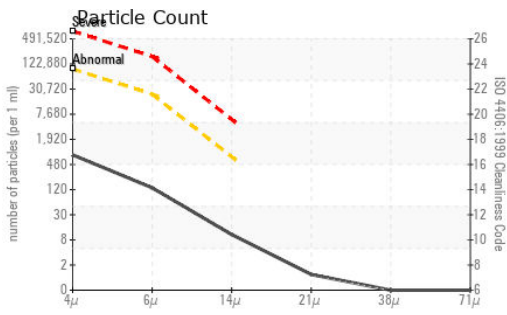

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : LEC0051106 **Received** : 20 Jun 2024  
**Lab Number** : 06215731 **Tested** : 21 Jun 2024  
**Unique Number** : 11088595 **Diagnosed** : 22 Jun 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PQ )

**LESLIE EQUIPMENT COMPANY**  
 105 TENNIS CENTER DR.  
 MARIETTA, OH  
 US 45750-9765  
 Contact: LEANNE KENDALL  
 KendalLeanne@lec1.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
 F: (740)373-5570