


G.LOPES CONSTRUCTION INC./Off-Road

L336 Component Coolant

EXTENDED LIFE COOLANT (--- GAL)

	·····						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
The fluid is suitable for further service.	Sample Number		Client Info		PCA0122480		
	Sample Date		Client Info		18 Jun 2024		
	Machine Age	hrs	Client Info		9919		
	Oil Age	hrs	Client Info		9919		
	Oil Changed		Client Info		N/A		
	Sample Status				NORMAL		
CORROSION	Tatal Dissalard Oalida				400 =		
CORROSION	Total Dissolved Solids				493.5		
	Coolant Appearance		*Visual	Clear	normal		
CONTAMINANTS	Boiling Point	°C	WC Method		226		
There is no indication of any contamination in the coolant.	Specific Gravity		*ASTM D1298		1.072		
There is no indication of any contamination in the coolant.					1.072		
	рН	Scale 0-14	ASTM D1287		7.00		
	Nitrites	ppm	AP-053:2009		636		
	Reserve Alkalinity	Scale 0-20	*ASTM D1121				
	Percentage Glycol	%	ASTM D3321		53.5		
	Freezing Point	°F	ASTM D3321		-43		
	Carboxylate				n/a		
	Coolant Color		*Visual		Red		

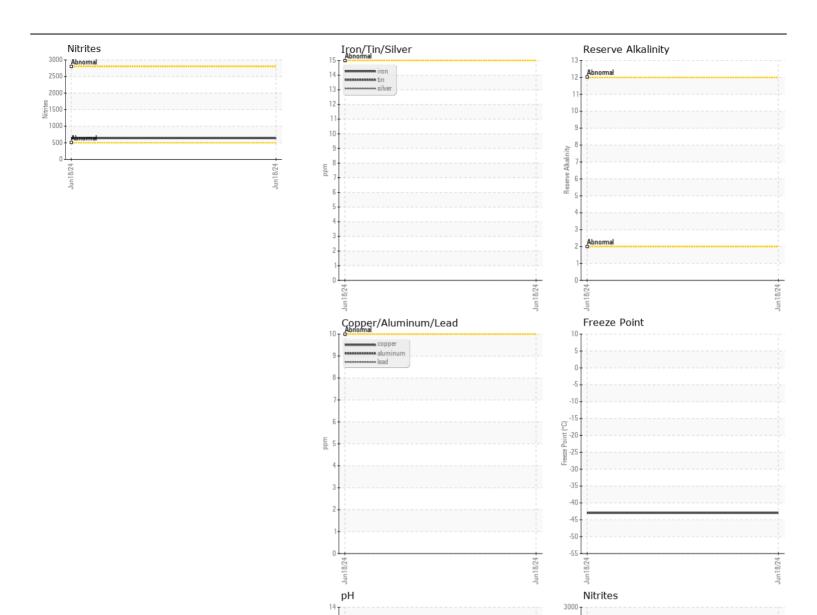





Certificate L2367

Laboratory Sample No.

Lab Number : 06216252 Unique Number : 11089116

: PCA0122480

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested**

: 21 Jun 2024 Diagnosed Test Package : COOL- (Additional Tests: GlycolType)

: 24 Jun 2024 - Doug Bogart

: 20 Jun 2024

2800

2400

2000 1800

1400

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

G LOPES CONSTRUCTION

565 WINTHROP ST TAUNTON, MA US 02780

Contact: BUTCH MCGRATH bmcgrath@glopes.com

T:

F: