



Machine Id  
**821081**  
 Component  
**Diesel Engine**  
 Fluid  
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

**RECOMMENDATION**

Check for low coolant level. We advise that you check for the source of the coolant leak. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0118474</b>	GFL0118481	GFL0118495
Sample Date		Client Info		<b>12 Jun 2024</b>	04 Jun 2024	15 Apr 2024
Machine Age	hrs	Client Info		<b>8403</b>	0	0
Oil Age	hrs	Client Info		<b>650</b>	0	0
Filter Age	hrs	Client Info		<b>650</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Sample Status				<b>ABNORMAL</b>	NORMAL	NORMAL

**WEAR**

Blower/turbocharger and/or piston wear is indicated.

Iron	ppm	ASTM D5185m	>100	<b>50</b>	19	68
Chromium	ppm	ASTM D5185m	>20	<b>2</b>	<1	2
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	0
Silver	ppm	ASTM D5185m	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>▲ 46</b>	4	49
Lead	ppm	ASTM D5185m	>40	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185m	>330	<b>&lt;1</b>	7	2
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**










Sodium and/or potassium levels are high.

Silicon	ppm	ASTM D5185m	>25	<b>10</b>	7	11
Potassium	ppm	ASTM D5185m	>20	<b>▲ 141</b>	33	76
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol	%	*ASTM D2982		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>1.3</b>	0.4	1.2
Nitration	Abs/cm	*ASTM D7624	>20	<b>8.9</b>	7.4	8.9
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>20.7</b>	19.2	20.8
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The BN result indicates that there is suitable alkalinity remaining in the oil.

Sodium	ppm	ASTM D5185m		<b>● 97</b>	33	5
Boron	ppm	ASTM D5185m	0	<b>4</b>	1	2
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	60	<b>68</b>	69	88
Manganese	ppm	ASTM D5185m	0	<b>1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	1010	<b>977</b>	916	1366
Calcium	ppm	ASTM D5185m	1070	<b>1101</b>	1111	1572
Phosphorus	ppm	ASTM D5185m	1150	<b>1131</b>	1056	1658
Zinc	ppm	ASTM D5185m	1270	<b>1312</b>	1212	1859
Sulfur	ppm	ASTM D5185m	2060	<b>3604</b>	3105	4426
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>14.6</b>	14.6	15.1
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	<b>9.3</b>	8.6	8.8
Visc @ 100°C	cSt	ASTM D445	15.4	<b>13.9</b>	13.9	13.8

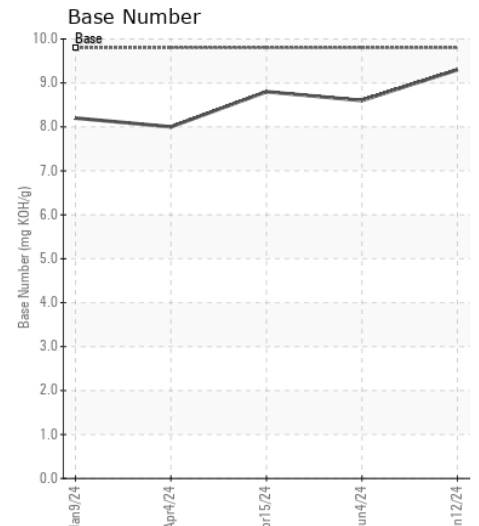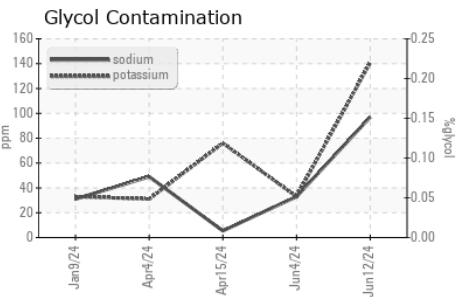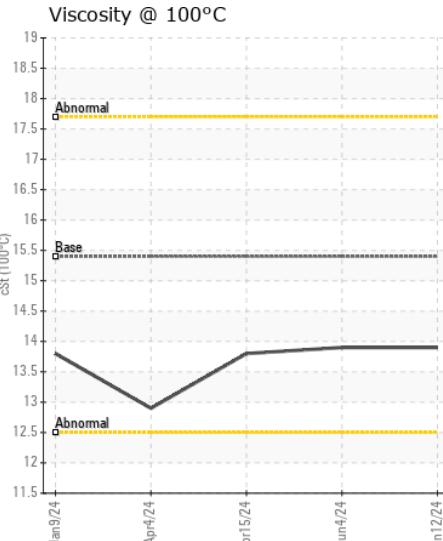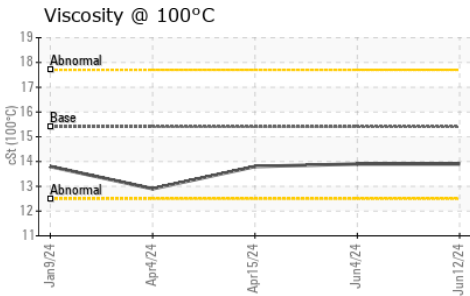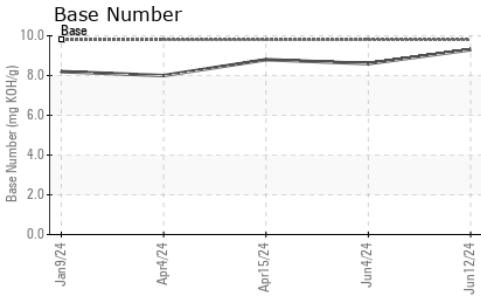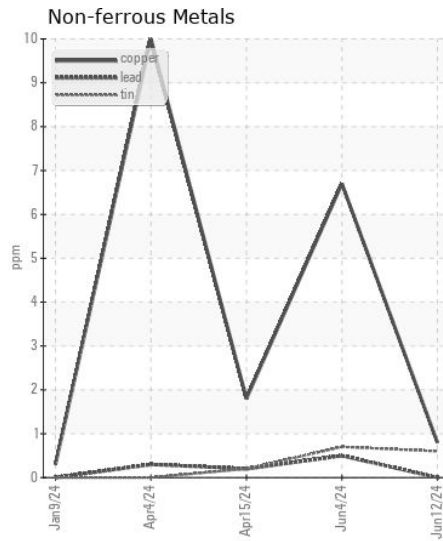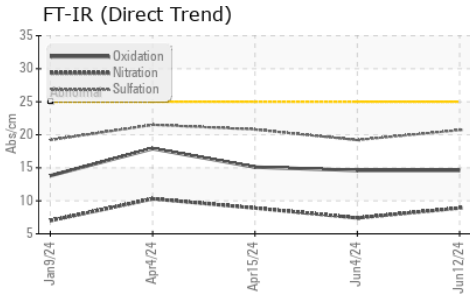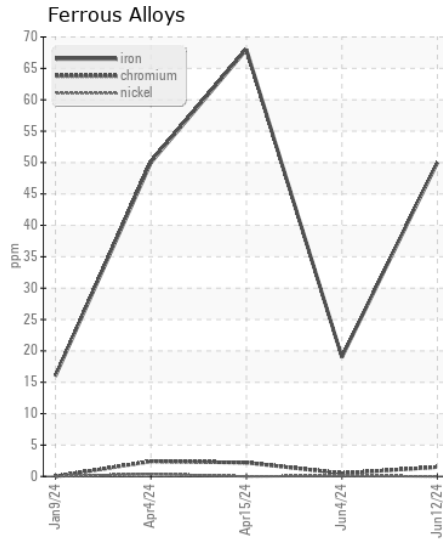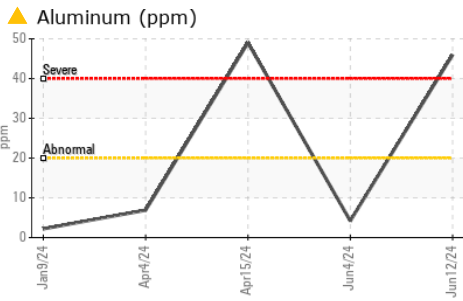

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : GFL0118474  
**Lab Number** : 06216687  
**Unique Number** : 11089551  
**Test Package** : FLEET ( Additional Tests: Glycol )

**GFL Environmental - 893 - OK East Hauling**  
 2100 Lilly Street  
 Seminole, OK  
 US 74868  
 Contact: Roger Barlow  
 rbarlow@gflenv.com  
 T: (405)204-6183  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)