



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[SPM716537 MCIRON]**  
 Machine Id  
**VOLVO A45GFS 353797**  
 Component  
**Rear Axle**  
 Fluid  
**GEAR OIL SAE 75W80 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP451382</b>	---	---
Sample Date		Client Info		<b>17 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>521</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Changed</b>	---	---
Filter Changed		Client Info		<b>Not Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>204</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>30	<b>&lt;1</b>	---	---
Lead	ppm	ASTM D5185m	>50	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>150	<b>1</b>	---	---
Tin	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>6</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>6</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>MODER</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>3</b>	---	---
Boron	ppm	ASTM D5185m	400	<b>266</b>	---	---
Barium	ppm	ASTM D5185m	200	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m	12	<b>12</b>	---	---
Manganese	ppm	ASTM D5185m		<b>12</b>	---	---
Magnesium	ppm	ASTM D5185m	12	<b>2</b>	---	---
Calcium	ppm	ASTM D5185m	150	<b>80</b>	---	---
Phosphorus	ppm	ASTM D5185m	1650	<b>2647</b>	---	---
Zinc	ppm	ASTM D5185m	125	<b>42</b>	---	---
Sulfur	ppm	ASTM D5185m	22500	<b>34439</b>	---	---
Visc @ 40°C	cSt	ASTM D445	48	<b>52.1</b>	---	---

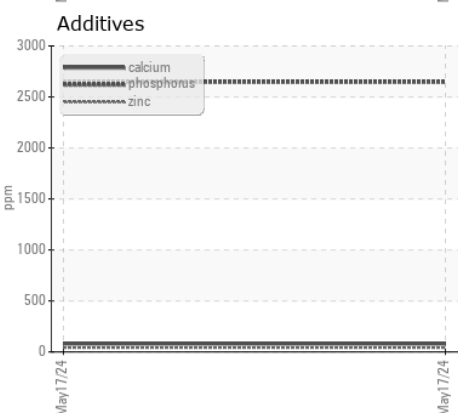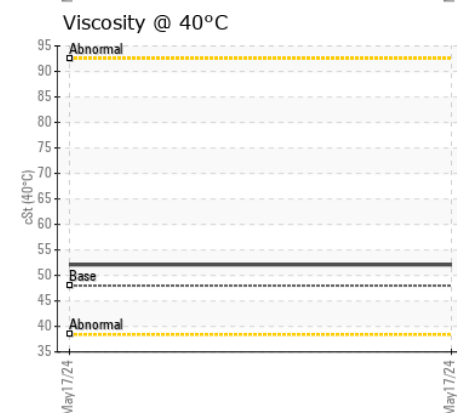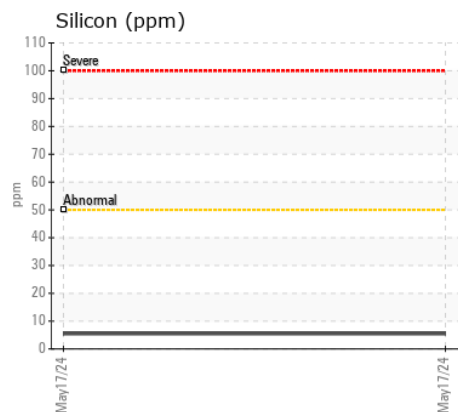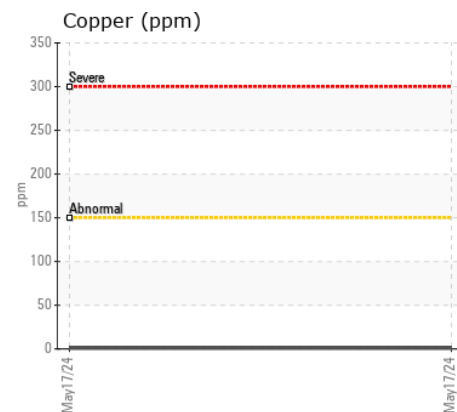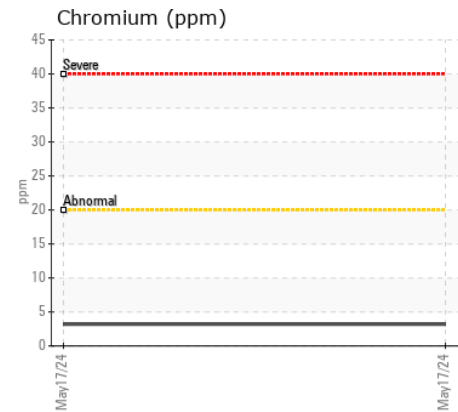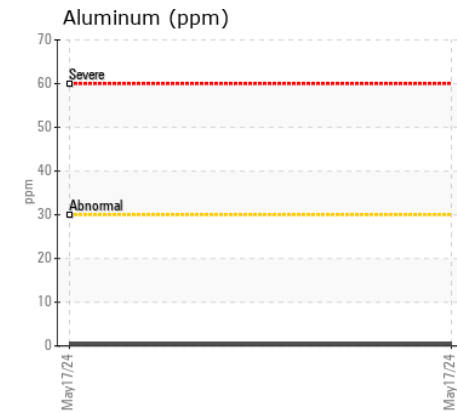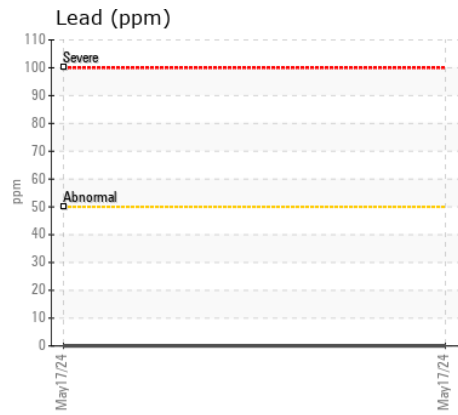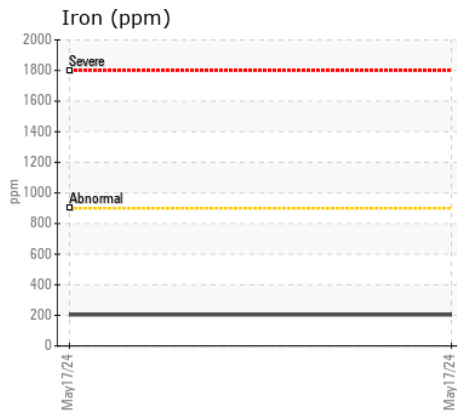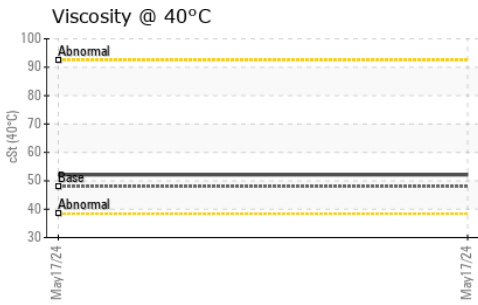

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP451382  
**Lab Number** : 06217136  
**Unique Number** : 11090000  
**Test Package** : MOB 1  
**Received** : 21 Jun 2024  
**Tested** : 24 Jun 2024  
**Diagnosed** : 24 Jun 2024 - Sean Felton

**ALTA EQUIPMENT CO - ORLAND PARK**  
 5000 INDUSTRIAL HWY  
 GARY, IN  
 US 46406  
 Contact: MARK DEROSA  
 mark.derosa@altg.com  
 T: (248)356-5200  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)