WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL


Machine Id


921063


Transmission

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GFL0117816		
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Date		Client Info		05 Jun 2024		
	Machine Age	mls	Client Info		176807		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
VEAD			AOTA DELOE	050			
WEAR	Iron	ppm	ASTM D5185m		85		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	>2	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		19		
	Lead	ppm	ASTM D5185m		2		
	Copper	ppm	ASTM D5185m		14		
	Tin	ppm	ASTM D5185m	>6	3		
	Vanadium	ppm	ASTM D5185m	NONE	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>15	6		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	4		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
LUID CONDITION	0		AOTM DEADE				
	Sodium Boron	ppm	ASTM D5185m		8		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m ASTM D5185m		59		
	Molybdenum	ppm	ASTM D5185m		0		
	•	ppm					
	Magnesium	ppm	ASTM D5185m ASTM D5185m		2		
	Magnesium Calcium	ppm	ASTM D5185m		2 195		
		ppm	ASTM D5185m		249		
	Dhoonharua		MCOLCO INLOW		249		
	Phosphorus						
	Phosphorus Zinc Sulfur	ppm	ASTM D5185m ASTM D5185m		30 2141		

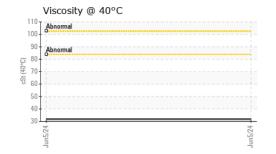

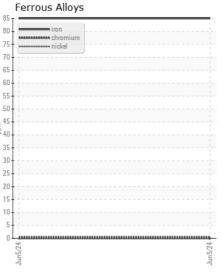

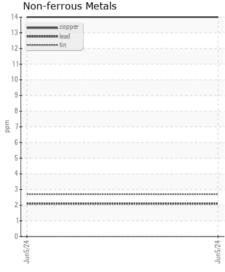

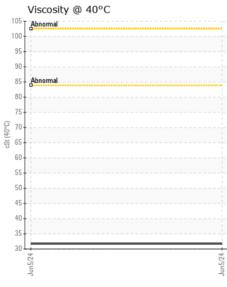



Certificate L2367

Laboratory Sample No.

: GFL0117816 Lab Number : 06217213 Unique Number : 11090077

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2024 **Tested** Diagnosed

: 24 Jun 2024 : 24 Jun 2024 - Don Baldridge

GFL Environmental - 865 - East Mount Hauling 7213 East Mount Houston Road

Houston, TX US 77050

Contact: TECHNICIAN ACCOUNT wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Test Package : FLEET

T:

F: