**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 


Machine Id

934056

2 Differential

PFTRO CANADA TRAXON SYNTHETIC 75W90 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		GFL0125218		
	Sample Date		Client Info		05 Jun 2024		
	Machine Age	hrs	Client Info		2420		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		None		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	403		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>10	4		
	Nickel	ppm	ASTM D5185m	>10	1		
	Titanium	ppm	ASTM D5185m		1		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm	ASTM D5185m	>25	3		
	Lead	ppm	ASTM D5185m	>25	1		
	Copper	ppm	ASTM D5185m	>100	30		
	Tin	ppm	ASTM D5185m	>10	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	49		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method	>.2	NEG		
	Silt	scalar	*Visual	NONE	LIGHT		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		8		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	328	51		
	Barium	ppm	ASTM D5185m		6		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		16		
	Magnesium	ppm	ASTM D5185m	1	176		
	Calcium	ppm	ASTM D5185m	7	13		
	Phosphorus	ppm	ASTM D5185m	1145	1850		
	Zinc	ppm	ASTM D5185m	3	22		
	Sulfur	ppm	ASTM D5185m	17909	26058		

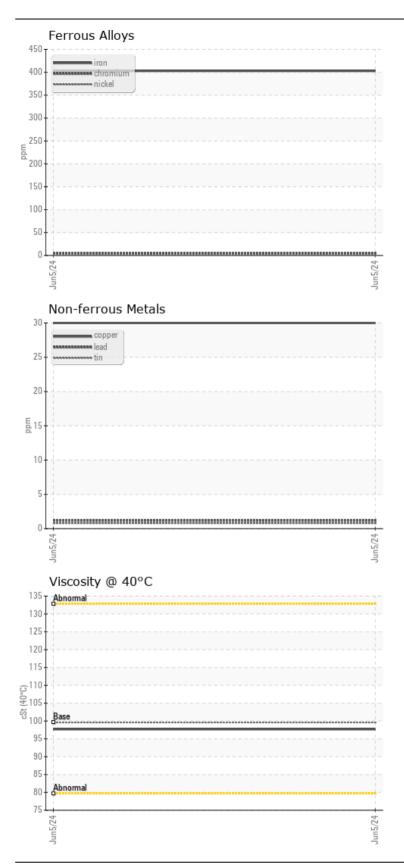



Certificate L2367

Laboratory Sample No.

: GFL0125218 **Lab Number** : 06217448 Unique Number : 11090312 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2024 **Tested** : 25 Jun 2024 Diagnosed

: 25 Jun 2024 - Sean Felton

GFL Environmental - 865 - East Mount Hauling 7213 East Mount Houston Road

Houston, TX US 77050

Contact: TECHNICIAN ACCOUNT wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: