WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


Machine Id


934067


Transmission (Auto)


PETRO CANADA DuraDrive HD Synthetic 668 (--- GAL)

ECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		GFL0125252		
	Sample Date		Client Info		12 Jun 2024		
	Machine Age	hrs	Client Info		2406		
	Oil Age	hrs	Client Info		2406		
	Filter Age	hrs	Client Info		2406		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
/EAR	luon		ACTM DE10Em	. 100			
LAN	Iron	ppm	ASTM D5185m		57		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0		
	Nickel	ppm	ASTM D5185m	>5	0		
	Titanium	ppm	ASTM D5185m	_	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		23		
	Lead	ppm	ASTM D5185m		14		
	Copper	ppm	ASTM D5185m		8		
	Tin	ppm	ASTM D5185m	>10	3		
	Vanadium	ppm	ASTM D5185m	NONE	<1 NONE		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
ONTAMINATION	Silicon	ppm	ASTM D5185m	>20	4		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m	>20	5		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
LUID CONDITION	O - diam-		AOTA DEADE		•		
	Sodium	ppm	ASTM D5185m		6		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		91		
	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		0		
	Maganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		1		
	Calcium	ppm	ASTM D5185m		74		
	Phosphorus	ppm	ASTM D5185m		259		
	Zinc	ppm	ASTM D5185m		3		
	Sulfur	ppm	ASTM D5185m		1350		

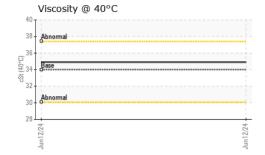

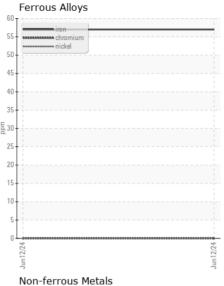

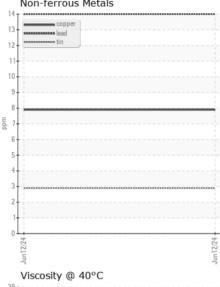

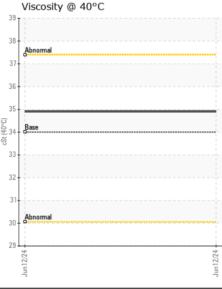



Certificate L2367

Laboratory Sample No.

: GFL0125252 Lab Number : 06217457 Unique Number : 11090321

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received **Tested** Diagnosed Test Package : FLEET

: 21 Jun 2024 : 24 Jun 2024

: 24 Jun 2024 - Wes Davis

GFL Environmental - 865 - East Mount Hauling

7213 East Mount Houston Road Houston, TX US 77050

Contact: TECHNICIAN ACCOUNT wcgfldemo@gmail.com

T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: