WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**


Machine Id

733030

1 Differential

PETRO CANADA TRAXON SYNTHETIC 75W90 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.	Sample Number		Client Info		GFL0125256		
	Sample Date		Client Info		13 Jun 2024		
	Machine Age	hrs	Client Info		2369		
	Oil Age	hrs	Client Info		2369		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>500	149		
Metal levels are typical for a new component breaking in.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	0		
	Lead	ppm	ASTM D5185m	>25	<1		
	Copper	ppm	ASTM D5185m	>100	153		
	Tin	ppm	ASTM D5185m	>10	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	> 75	47		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		3		
	Water	ppiii	WC Method		NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	LIGHT		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		6		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	328	46		
	Barium	ppm	ASTM D5185m		4		
	Molybdenum	ppm	ASTM D5185m	•	0		
	Manganese	ppm	ASTM D5185m		13		
	Magnesium	ppm	ASTM D5185m	1	157		
	Calcium	ppm	ASTM D5185m		9		
	Phosphorus	ppm	ASTM D5185m		1547		
	Zinc	ppm	ASTM D5185m		14		
	Sulfur		ASTM D5185m		26104		

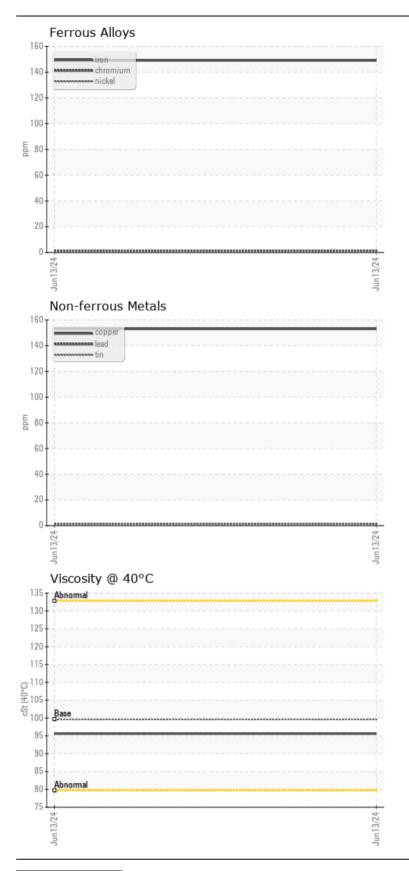



Certificate L2367

Laboratory Sample No.

: GFL0125256 Lab Number : 06217459 Unique Number : 11090323 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested** Diagnosed

: 21 Jun 2024 : 24 Jun 2024

: 24 Jun 2024 - Don Baldridge

GFL Environmental - 865 - East Mount Hauling 7213 East Mount Houston Road

Houston, TX US 77050

Contact: TECHNICIAN ACCOUNT wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: