



VOLVO

OIL ANALYSIS REPORT

WEAR	ABNORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
[729857 RENTALS]
 Machine Id
VOLVO A25G 752687
 Component
Wet Disc Brake
 Fluid
VOLVO WET BRAKE TRANSAXLE OIL (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP449943	---	---
Sample Date		Client Info		17 Jun 2024	---	---
Machine Age	hrs	Client Info		1340	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changed	---	---
Filter Changed		Client Info		Not Changed	---	---
Sample Status				ABNORMAL	---	---

WEAR

The copper level is abnormal. All other component wear rates are normal.

Iron	ppm	ASTM D5185m	>20	9	---	---
Chromium	ppm	ASTM D5185m	>10	<1	---	---
Nickel	ppm	ASTM D5185m	>10	1	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m		<1	---	---
Aluminum	ppm	ASTM D5185m	>10	3	---	---
Lead	ppm	ASTM D5185m	>10	1	---	---
Copper	ppm	ASTM D5185m	>75	▲ 227	---	---
Tin	ppm	ASTM D5185m	>10	<1	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>20	15	---	---
Potassium	ppm	ASTM D5185m	>20	6	---	---
Water		WC Method	>0.1	NEG	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		2	---	---
Boron	ppm	ASTM D5185m	100	121	---	---
Barium	ppm	ASTM D5185m	0	3	---	---
Molybdenum	ppm	ASTM D5185m	0	<1	---	---
Manganese	ppm	ASTM D5185m		2	---	---
Magnesium	ppm	ASTM D5185m	0	13	---	---
Calcium	ppm	ASTM D5185m	3800	3958	---	---
Phosphorus	ppm	ASTM D5185m	1200	1350	---	---
Zinc	ppm	ASTM D5185m	1500	1563	---	---
Sulfur	ppm	ASTM D5185m	6500	5208	---	---
Visc @ 40°C	cSt	ASTM D445	52.0	43.8	---	---

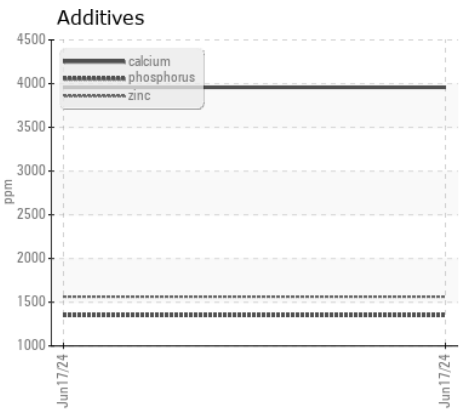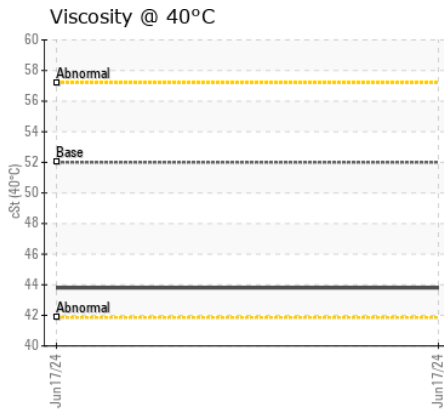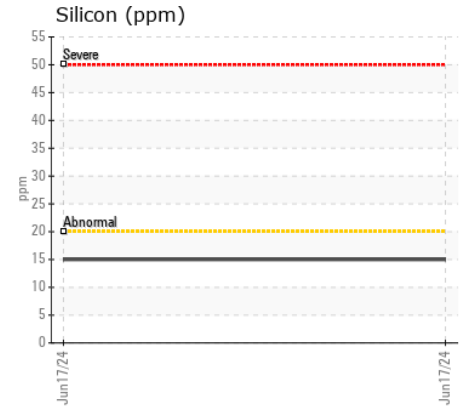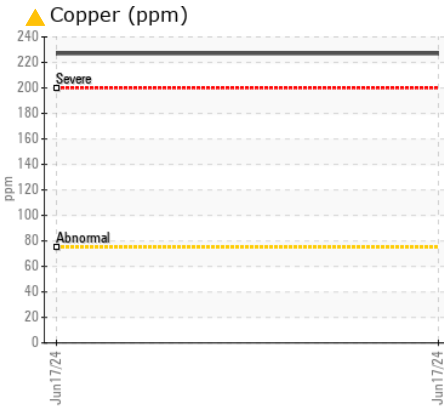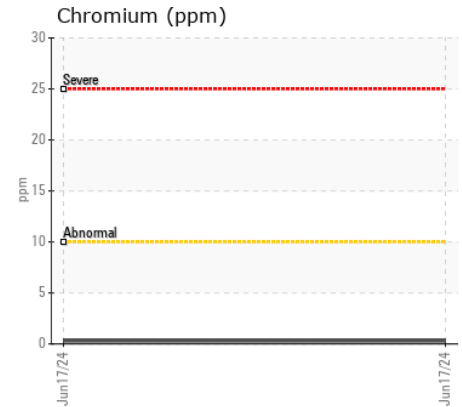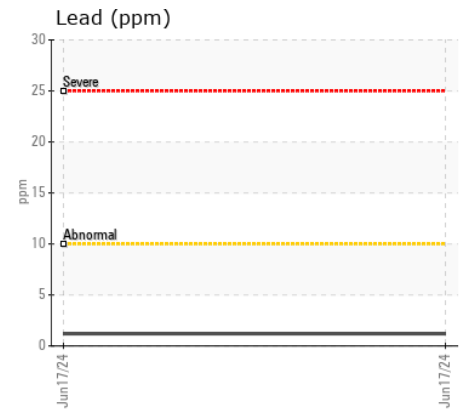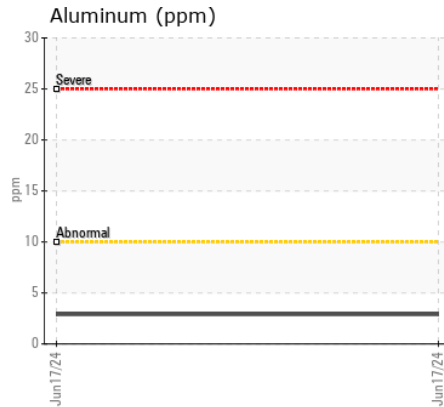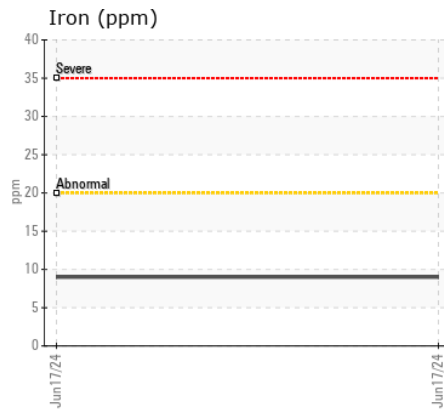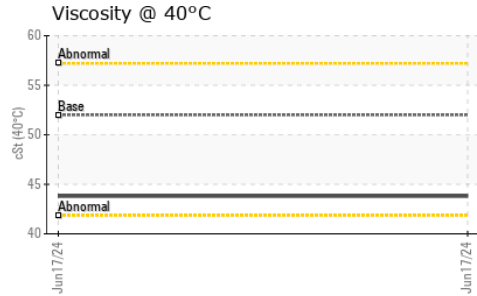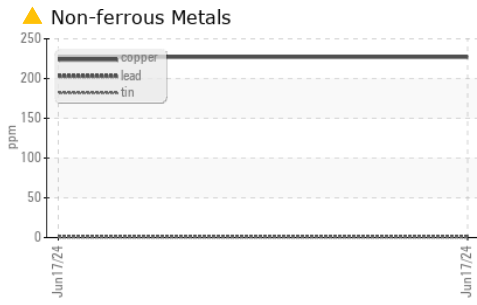

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP449943
Lab Number : 06218587
Unique Number : 11096784
Test Package : MOB 1

Received : 24 Jun 2024
Tested : 25 Jun 2024
Diagnosed : 26 Jun 2024 - Sean Felton

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)