



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area

**[RENTALS]**

Machine Id

**VOLVO L150H 7199**

Component

**Transmission (Auto)**

Fluid

**VOLVO AUTOMATIC TRANSMISSION FLUID AT102 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP440191</b>	VCP430706	---
Sample Date		Client Info		<b>19 Jun 2024</b>	25 Aug 2023	---
Machine Age	hrs	Client Info		<b>1620</b>	401	---
Oil Age	hrs	Client Info		<b>0</b>	0	---
Filter Age	hrs	Client Info		<b>0</b>	0	---
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	---
Filter Changed		Client Info		<b>Not Changd</b>	N/A	---
Sample Status				<b>NORMAL</b>	NORMAL	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>300	<b>87</b>	64	---
Chromium	ppm	ASTM D5185m	>3	<b>&lt;1</b>	<1	---
Nickel	ppm	ASTM D5185m	>3	<b>&lt;1</b>	0	---
Titanium	ppm	ASTM D5185m		<b>0</b>	0	---
Silver	ppm	ASTM D5185m	>5	<b>0</b>	0	---
Aluminum	ppm	ASTM D5185m	>5	<b>1</b>	3	---
Lead	ppm	ASTM D5185m	>3	<b>0</b>	0	---
Copper	ppm	ASTM D5185m	>25	<b>5</b>	3	---
Tin	ppm	ASTM D5185m	>4	<b>&lt;1</b>	0	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---

### CONTAMINATION










There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185m	>20	<b>8</b>	7	---
Potassium	ppm	ASTM D5185m	>20	<b>4</b>	<1	---
Water		WC Method	>0.1	<b>NEG</b>	NEG	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	---

### FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>5</b>	3	---
Boron	ppm	ASTM D5185m	187	<b>71</b>	88	---
Barium	ppm	ASTM D5185m	0.0	<b>3</b>	5	---
Molybdenum	ppm	ASTM D5185m	0.0	<b>0</b>	0	---
Manganese	ppm	ASTM D5185m	0.0	<b>5</b>	4	---
Magnesium	ppm	ASTM D5185m	6.8	<b>2</b>	3	---
Calcium	ppm	ASTM D5185m	215	<b>74</b>	77	---
Phosphorus	ppm	ASTM D5185m	445	<b>200</b>	188	---
Zinc	ppm	ASTM D5185m	56	<b>14</b>	10	---
Sulfur	ppm	ASTM D5185m	1336	<b>2136</b>	2129	---
Visc @ 40°C	cSt	ASTM D445	35.3	<b>26.5</b>	28.21	---

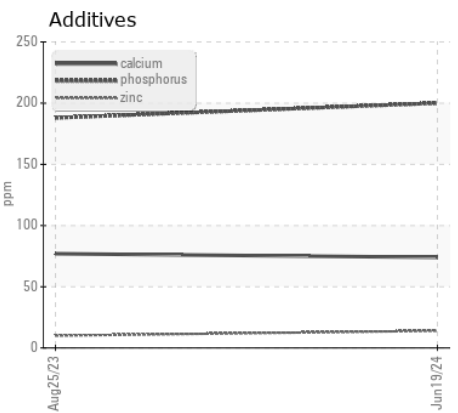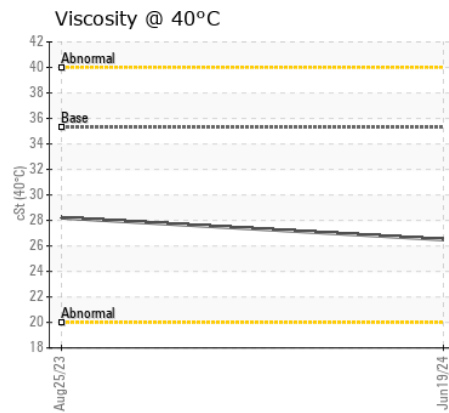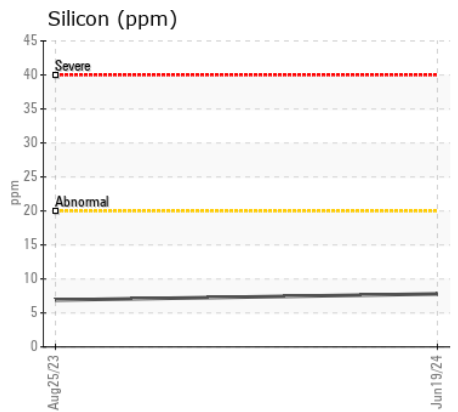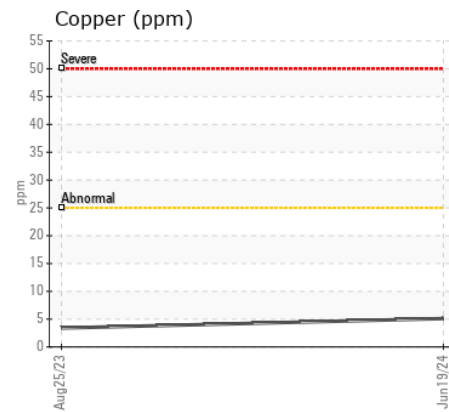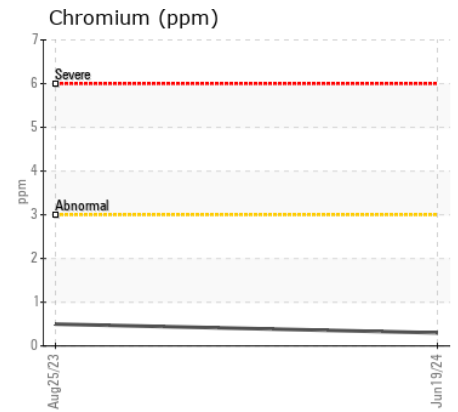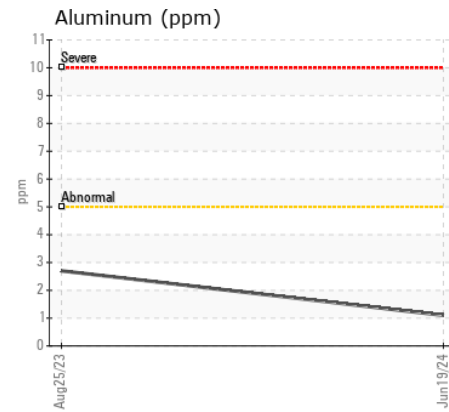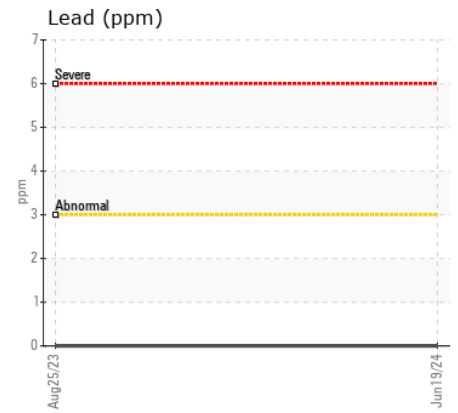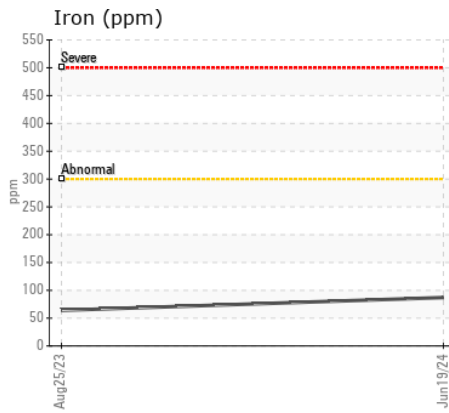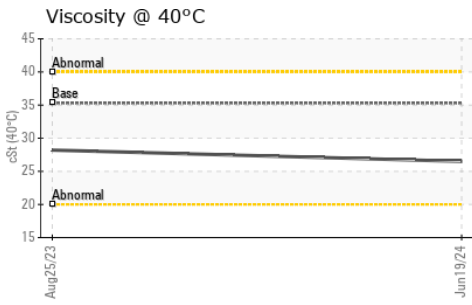

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP440191  
**Lab Number** : 06218685  
**Unique Number** : 11096882  
**Test Package** : MOB 1

**Received** : 24 Jun 2024  
**Tested** : 25 Jun 2024  
**Diagnosed** : 26 Jun 2024 - Sean Felton

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC  
 8418 PALM RIVER ROAD  
 TAMPA, FL  
 US 33619  
 Contact: KENNY HANEY  
 khaney@flaglerce.com  
 T: (813)630-0077  
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)