

## Machine Id VOLVO 7319 Component Front Axle Fluid {not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

## **WEAR**

All component wear rates are normal.

## CONTAMINATION


There is no indication of any contamination in the oil.


## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		ASC0003341		
Sample Date		Client Info		24 Jun 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		1018		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Filter Changed		Client Info		N/A		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>500	90		
Chromium	ppm	ASTM D5185m	>10	2		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>75	15		
Potassium	ppm	ASTM D5185m	>20	3		
Mater	1-1-		>0.2	-		
Water		WC Method	>0.2	NEG		
Silt	scalar	WC Method *Visual	NONE	NEG NONE		
	scalar scalar		-			
Silt		*Visual	NONE	NONE		
Silt Debris Sand/Dirt	scalar	*Visual *Visual	NONE NONE	NONE		
Silt Debris	scalar scalar	*Visual *Visual *Visual	NONE NONE NONE	NONE NONE NONE		
Silt Debris Sand/Dirt Appearance	scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NORML	NONE NONE NONE NORML	 	
Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NONE NORE NORML	 	  
Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NONE NORE NORML	 	  
Silt Debris Sand/Dirt Appearance Odor Emulsified Water	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NONE NORE NORML NORML NEG	 	
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2	 	
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron	scalar scalar scalar scalar scalar ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124		
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium	scalar scalar scalar scalar scalar ppm ppm	*Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124 0		
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum	scalar scalar scalar scalar scalar ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124 0 5		
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese	scalar scalar scalar scalar scalar ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124 0 5 6		
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Malybdenum Manganese Magnesium	scalar scalar scalar scalar ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124 0 5 6 12		
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium	scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124 0 5 6 12 3968		
Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium	scalar scalar scalar scalar ppm ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML NORML	NONE NONE NORML NORML NEG 2 124 0 5 6 12 3968 1404		

Submitted By: Kendall Rhodes

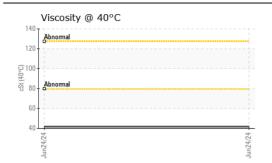

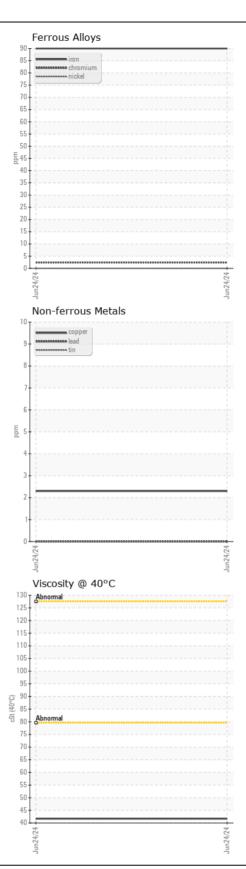

OMNISOURCE Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : ASC0003341 Received 303 S MAGNOLIA : 26 Jun 2024 RAEFORD, NC Lab Number : 06221694 Tested : 27 Jun 2024 Unique Number : 11099891 Diagnosed : 28 Jun 2024 - Don Baldridge US 28376 Test Package : CONST Contact: Service Manager Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F:

Submitted By: Kendall Rhodes Page 2 of 2