

# WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

#### Machine Id MILL 4 Component 2 Gearbox Fluid FUCHS RENOLIN UNISYN CLP 220 (--- GAL)

### RECOMMENDATION

Resample at the next service interval to monitor.

#### **WEAR**

All component wear rates are normal.

### CONTAMINATION


There is no indication of any contamination in the oil.

# FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		FCH0000226		
Sample Date		Client Info		25 Jun 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Filter Changed		Client Info		N/A		
Sample Status				NORMAL		
PQ		ASTM D8184		17		
			. 000	17		
Iron Chromium	ppm	ASTM D5185m	>200 >15	49		
	ppm	ASTM D5185m	-	<1		
Nickel	ppm	ASTM D5185m	>15	<1		
Titanium	ppm	ASTM D5185m		1		
Silver	ppm	ASTM D5185m	05	0		
Aluminum	ppm	ASTM D5185m	>25	3		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m	NONE	0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	5		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m	_	0		
Boron	ppm	ASTM D5185m		<1		
Barium	ppm	ASTM D5185m	_	<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m	_	<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		193		
Zinc	ppm	ASTM D5185m		<1		
Sulfur	ppm	ASTM D5185m		7092		
Acid Number (AN)	mg KOH/g	ASTM D8045	0.6	0.67		
Visc @ 40°C	cSt	ASTM D445	220	221	 vico Manago	

Contact/Location: Service Manager - ATLBLY

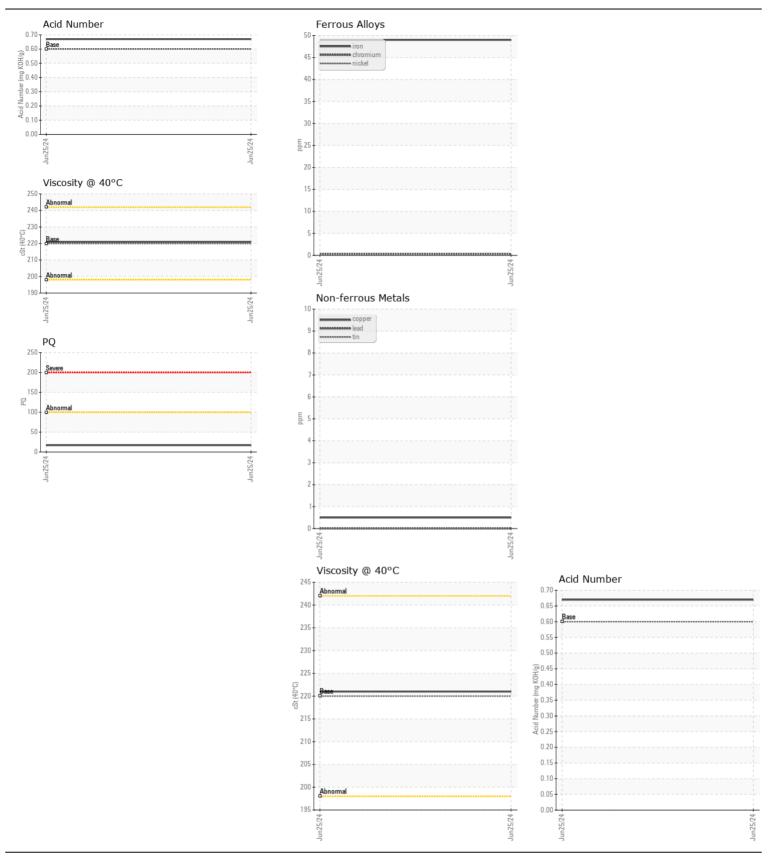

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 ATLAS TUBE Sample No. : FCH0000226 Received 5661 E STATE STREET HWY 137 : 27 Jun 2024 Ř Lab Number : 06222472 Tested : 01 Jul 2024 BLYTHEVILLE, AR Unique Number : 11100669 Diagnosed : 01 Jul 2024 - Jonathan Hester US 72315 Test Package : PLANT ( Additional Tests: KF, PrtCount ) Contact: Service Manager Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F:

Contact/Location: Service Manager - ATLBLY Page 2 of 2