
**WEAR** CONTAMINATION **FLUID CONDITION** 

**NORMAL NORMAL NORMAL** 

Machine Id MILL 4 Component
3 Gearbox

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		FCH0000222		
	Sample Date		Client Info		25 Jun 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184		19		
VEAIT	Iron	nnm	ASTM D5185m	> 200	18		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
		ppm					
	Nickel Titanium	ppm	ASTM D5185m ASTM D5185m	>15	0		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm		. 05	0		
		ppm	ASTM D5185m		3		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m	>25	0		
	Vanadium	ppm	ASTM D5185m	NONE	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	3		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		<1		
	Water	%	ASTM D6304	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
LUID CONDITION	0 "		40TM D5405				
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m		2		
	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		<1		
	Calcium	ppm	ASTM D5185m		0		
	Phosphorus	ppm	ASTM D5185m		245		
	Zinc	ppm	ASTM D5185m		<1		
	Sulfur	ppm	ASTM D5185m		10385		
	Acid Number (AN)	mg KOH/g	ASTM D8045		0.62		
	Visc @ 40°C	cSt	ASTM D445	220	220		



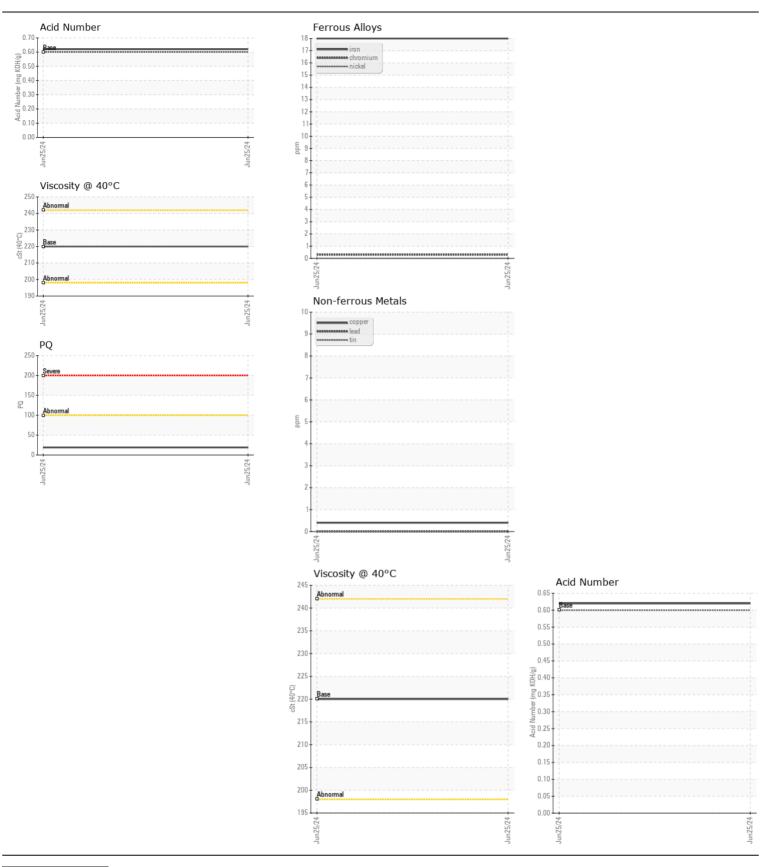

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : FCH0000222 Lab Number : 06222474 Unique Number : 11100671

Received **Tested** Diagnosed

: 27 Jun 2024 : 01 Jul 2024 : 01 Jul 2024 - Jonathan Hester

**ATLAS TUBE** 5661 E STATE STREET HWY 137 BLYTHEVILLE, AR US 72315 Contact: Service Manager

Test Package : PLANT ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) T:

F: