

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



LIEBHERR LH30 115841-1253

Front Differential

SUPER S 80W90 LS (--- GAL)

R	EC	ON	IME	ENC	DAT	ION	
		• • •					

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION


There is no indication of any contamination in the oil.


FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0285575	LH0235734	DJJ0011137
Sample Date		Client Info		20 Jun 2024	28 Sep 2023	22 May 2023
Machine Age	hrs	Client Info		12685	10707	1000
Oil Age	hrs	Client Info		500	0	1000
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	N/A	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
Iron	ppm	ASTM D5185m	>190	15	50	10
Chromium	ppm	ASTM D5185m	>2	<1	<1	0
Nickel	ppm	ASTM D5185m	>2	<1	<1	<1
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>5	3	<1	0
Lead	ppm	ASTM D5185m	>15	0	0	<1
Copper	ppm	ASTM D5185m	>70	1	6	<1
Tin	ppm	ASTM D5185m	>2	0	0	0
Vanadium	ppm	ASTM D5185m		0	<1	0
White Metal	scalar	*Visual	NONE	NONE	LIGHT	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Silicon	ppm	ASTM D5185m	>20	1	2	4
Potassium	ppm	ASTM D5185m	>20	2	1	2
Water		WC Method	>.2	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.2	NEG	NEG	NEG
Sodium	ppm	ASTM D5185m		<1	<1	0
Boron	ppm	ASTM D5185m		1	0	4
Barium	ppm	ASTM D5185m		0	0	2
Molybdenum	ppm	ASTM D5185m		<1	<1	1
Manganese	ppm	ASTM D5185m		<1	2	<1
Magnesium	ppm	ASTM D5185m		3	5	16
Calcium	ppm	ASTM D5185m		19	84	150
Phosphorus	ppm	ASTM D5185m		308	392	325
					30	61
Zinc	ppm	ASTM D5185m		12	30	01
Zinc Sulfur	ppm ppm	ASTM D5185m ASTM D5185m		12 14648	14078	14055

Contact/Location: SERVICE MANAGER ? - SPASPALH

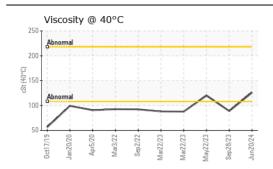

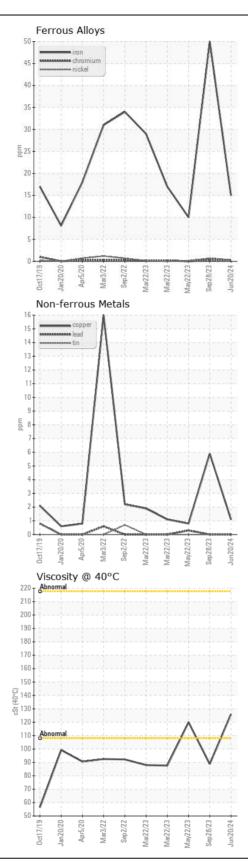

SPARTAN RECYCLING 3071 HOWARD ST SPARTANBURG, SC US 29303 Contact: SERVICE MANAGER

T:

F:

Certificate 12367 Test Package : CONST To discuss this sample report, contact Customer Service at 1-800-237-1369.

: LH0285575

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received

Diagnosed

Tested

: 27 Jun 2024

: 28 Jun 2024

: 29 Jun 2024 - Don Baldridge

Laboratory

Sample No.

Lab Number : 06222652

Unique Number : 11100849