



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area

**[2647 IAA FREMONT]**

Machine Id

**VOLVO L90H 623642**

Component

**Diesel Engine**

Fluid

**VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP440835</b>	VCP446592	VCP428951
Sample Date		Client Info		<b>26 Jun 2024</b>	03 Apr 2024	18 Dec 2023
Machine Age	hrs	Client Info		<b>12951</b>	12482	11933
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	N/A	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>7</b>	9	8
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>10	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>10	<b>2</b>	4	4
Lead	ppm	ASTM D5185m	>20	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185m	>10	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION













There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>5</b>	6	9
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	<1
Fuel		WC Method	>6.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.2</b>	0.3	0.4
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.0</b>	7.9	7.4
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>22.2</b>	22.3	22.7
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>2</b>	3	3
Boron	ppm	ASTM D5185m	2.5	<b>34</b>	39	43
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.7	<b>46</b>	43	43
Manganese	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	256	<b>628</b>	541	533
Calcium	ppm	ASTM D5185m	2057	<b>2170</b>	1887	1718
Phosphorus	ppm	ASTM D5185m	935	<b>1166</b>	1010	1013
Zinc	ppm	ASTM D5185m	1223	<b>1468</b>	1235	1160
Sulfur	ppm	ASTM D5185m	4079	<b>4153</b>	3630	3003
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>20.7</b>	21.5	21.3
Base Number (BN)	mg KOH/g	ASTM D2896	10	<b>10.0</b>	10.2	10.0
Visc @ 100°C	cSt	ASTM D445	15.0	<b>12.6</b>	13.0	12.8

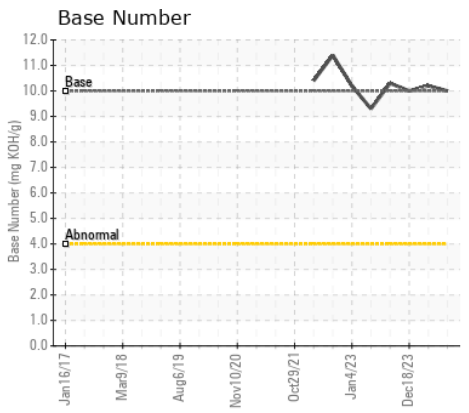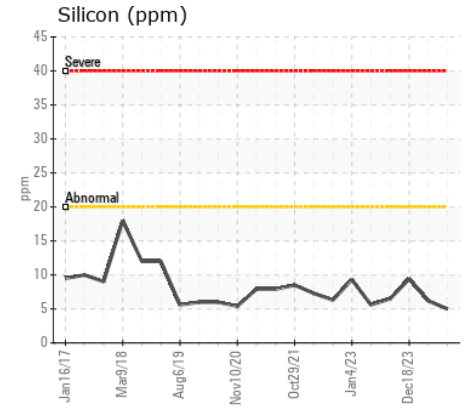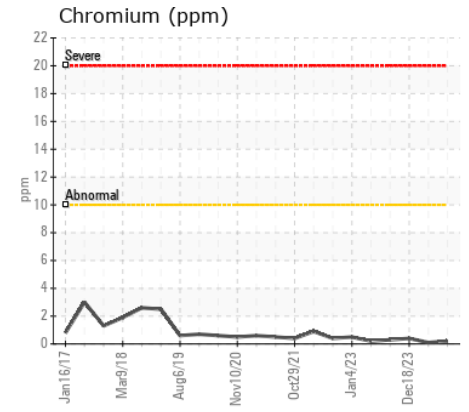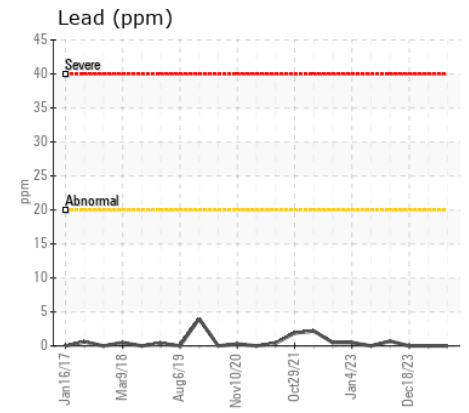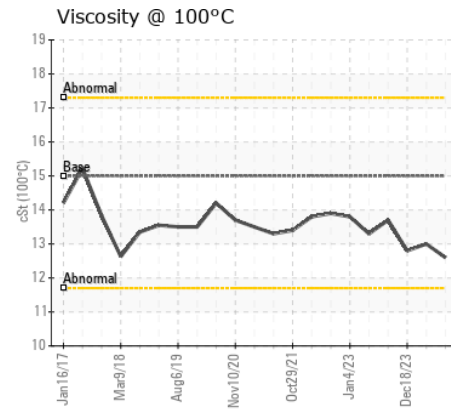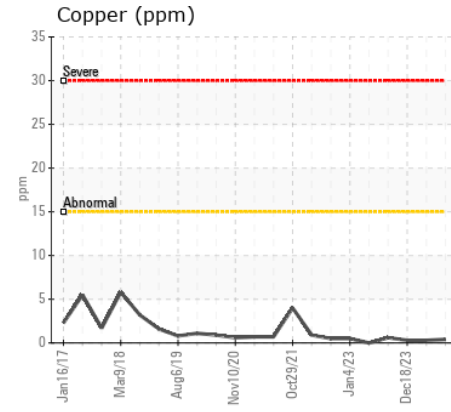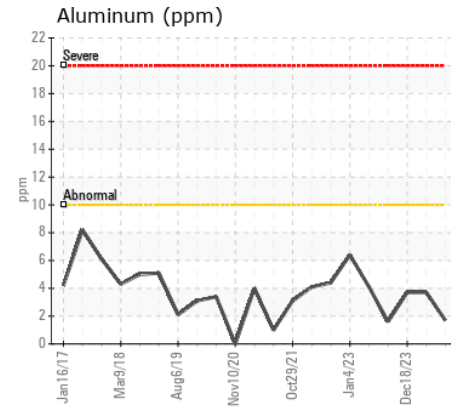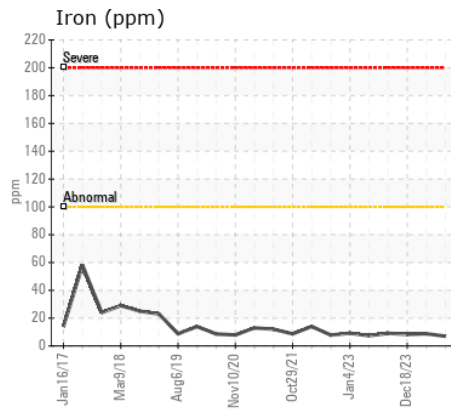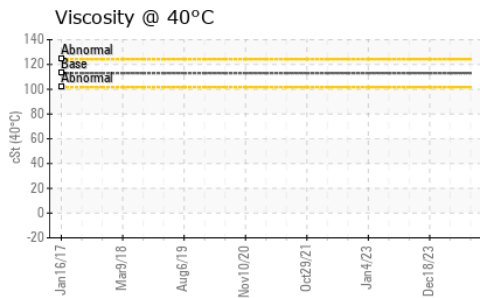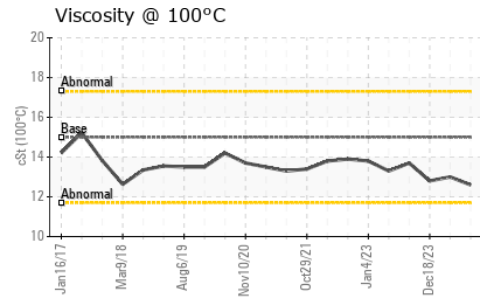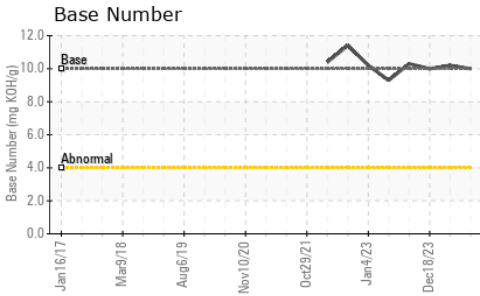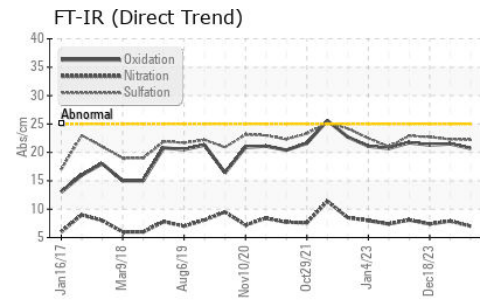

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP440835  
**Lab Number** : 06223288  
**Unique Number** : 11101485  
**Test Package** : MOB 1 ( Additional Tests: KV40, TBN )

**Received** : 28 Jun 2024  
**Tested** : 01 Jul 2024  
**Diagnosed** : 01 Jul 2024 - Don Baldridge

**VCES- VOLVO CONSTRUCTION EQUIPMENT**  
 1944 MARINA BLVD  
 SAN LEANDRO, CA  
 US 94577  
 Contact: JOHN BUDESILICH  
 john.budesilich@vcesvolvo.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (925)294-9240