**WEAR** CONTAMINATION FLUID CONDITION


NORMAL NORMAL **NORMAL** 

Machine Id

## YALE BEW3X43RT16D2 C0017 - TROLLEY (S/N 07H14K58)

Gearbox

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		DC0037341	DC0024817	
	Sample Date		Client Info		13 Jun 2024	23 Jun 2023	
	Machine Age	hrs	Client Info		0	0	
	Oil Age	hrs	Client Info		0	0	
	Filter Age	hrs	Client Info		0	0	
	Oil Changed		Client Info		N/A	Not Changd	
	Filter Changed		Client Info		N/A	Not Changd	
	Sample Status				NORMAL	NORMAL	
WEAD			AOTA DELOE				
WEAR	Iron	ppm	ASTM D5185m		8	3	
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0	0	
	Nickel	ppm	ASTM D5185m	>10	0	<1	
	Titanium Silver	ppm	ASTM D5185m ASTM D5185m		<1	0	
	Aluminum	ppm	ASTM D5185m	>25	0	0	
	Lead	ppm	ASTM D5185m		<1	0	
	Copper	ppm	ASTM D5185m		4	2	
	Tin	ppm	ASTM D5185m		0	<1	
	Vanadium	ppm	ASTM D5185m	>10	<1	0	
	White Metal	ppm scalar	*Visual	NONE	NONE	NONE	
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
			visuai		·····		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	10	<1	
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	1	<1	
	Water		WC Method	>0.2	NEG	NEG	
	Silt	scalar	*Visual	NONE	NONE	NONE	
	Debris	scalar	*Visual	NONE	NONE	NONE	
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
	Appearance	scalar	*Visual	NORML	NORML	NORML	
	Odor	scalar	*Visual	NORML	NORML	NORML	
	Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2	0	
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		10	0	
	Barium	ppm	ASTM D5185m		<1	0	
	Molybdenum	ppm	ASTM D5185m		<1	<1	
	Manganese	ppm	ASTM D5185m		<1	0	
	Magnesium	ppm	ASTM D5185m		5	2	
	Calcium	ppm	ASTM D5185m		390	19	
	Phosphorus	ppm	ASTM D5185m		666	18	
	Zinc	ppm	ASTM D5185m		227	9	
	Sulfur	ppm	ASTM D5185m		4611	1731	

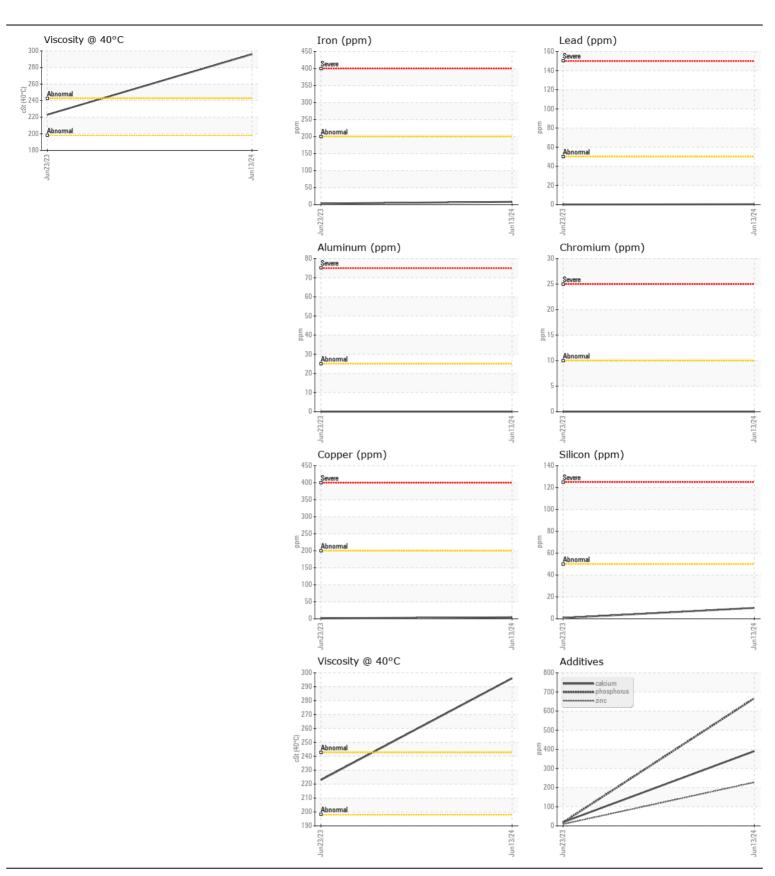



Certificate L2367

Report Id: CRAASHMA [WUSCAR] 06223823 (Generated: 07/01/2024 15:35:59) Rev: 1

Laboratory Sample No.

: DC0037341 Lab Number : 06223823 Unique Number : 11102020 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Jun 2024 **Tested** : 01 Jul 2024

Diagnosed : 01 Jul 2024 - Don Baldridge

**CRANEWORKS INC - MID-ATLANTIC** 

11089 LEADBETTER ROAD ASHLAND, VA US 23005

Contact: JASON WILDE jcwilde@vacraneworks.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T:

F: