



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area

[TMR]

Machine Id

VOLVO L120H 633358

Component

Diesel Engine

Fluid

DIESEL ENGINE OIL SAE 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP444536	---	---
Sample Date		Client Info		26 Jun 2024	---	---
Machine Age	hrs	Client Info		933	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	16	---	---
Chromium	ppm	ASTM D5185m	>10	2	---	---
Nickel	ppm	ASTM D5185m	>10	0	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m	>2	<1	---	---
Aluminum	ppm	ASTM D5185m	>10	14	---	---
Lead	ppm	ASTM D5185m	>20	<1	---	---
Copper	ppm	ASTM D5185m	>15	4	---	---
Tin	ppm	ASTM D5185m	>10	1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION













There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>20	6	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Fuel		WC Method	>6.0	<1.0	---	---
Water		WC Method	>0.1	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.3	---	---
Nitration	Abs/cm	*ASTM D7624	>20	6.4	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.9	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>158	2	---	---
Boron	ppm	ASTM D5185m	250	36	---	---
Barium	ppm	ASTM D5185m	10	4	---	---
Molybdenum	ppm	ASTM D5185m	100	42	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m	450	545	---	---
Calcium	ppm	ASTM D5185m	3000	1811	---	---
Phosphorus	ppm	ASTM D5185m	1150	997	---	---
Zinc	ppm	ASTM D5185m	1350	1213	---	---
Sulfur	ppm	ASTM D5185m	4250	3756	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	19.1	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	8.5	10.1	---	---
Visc @ 100°C	cSt	ASTM D445	14.4	12.7	---	---

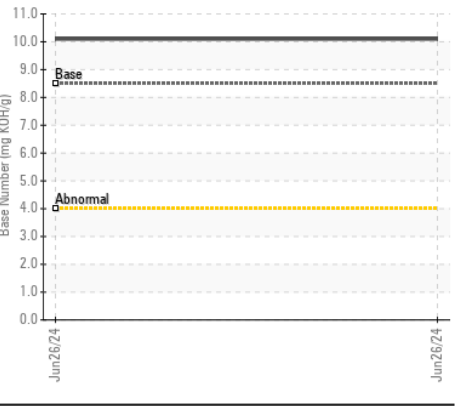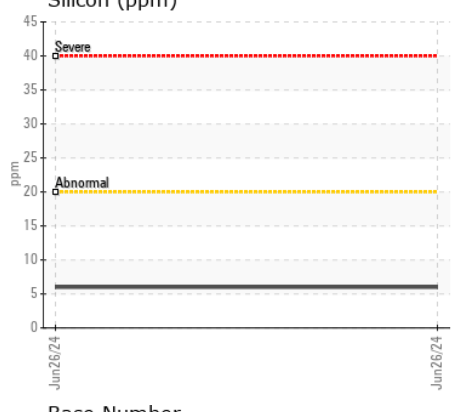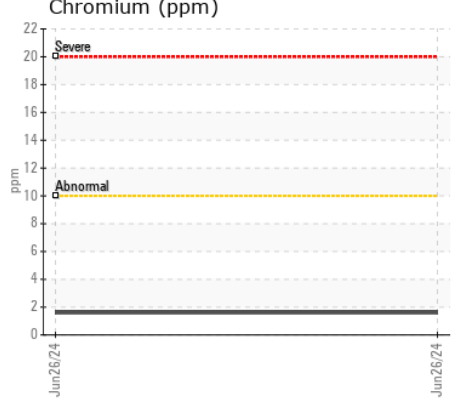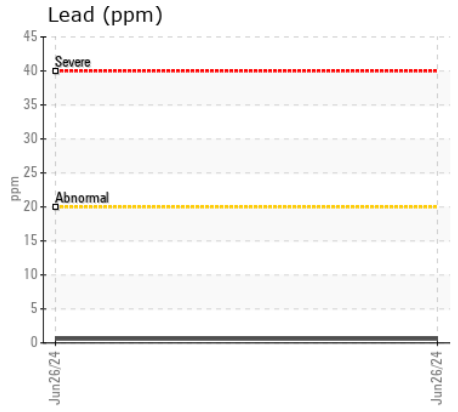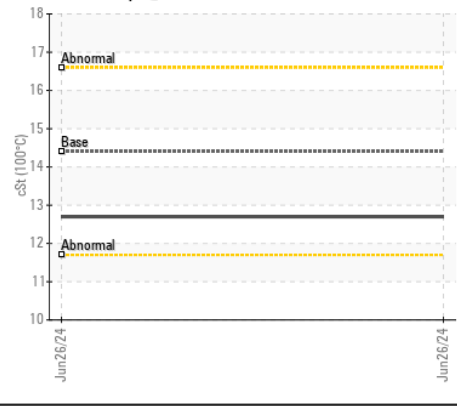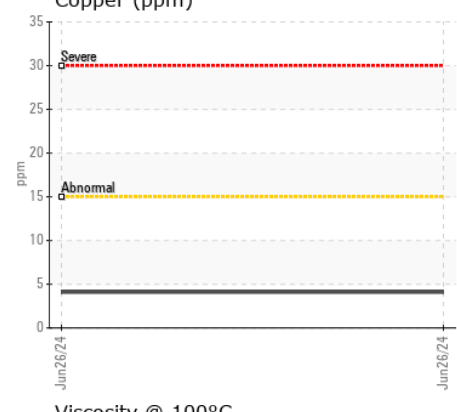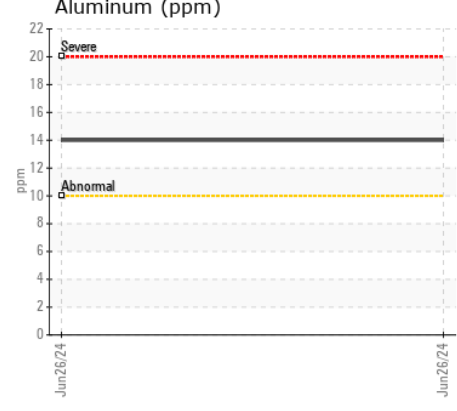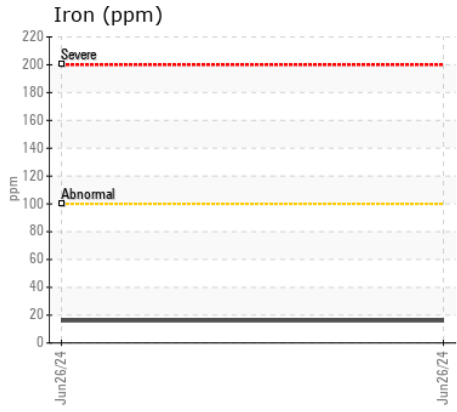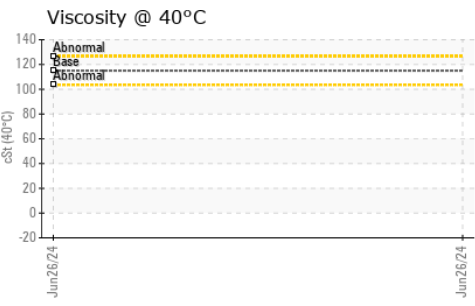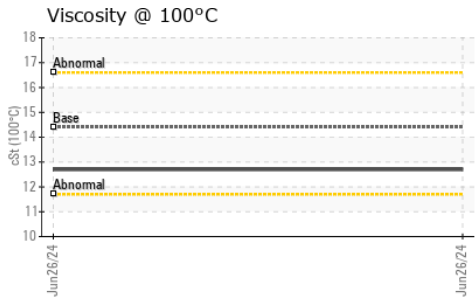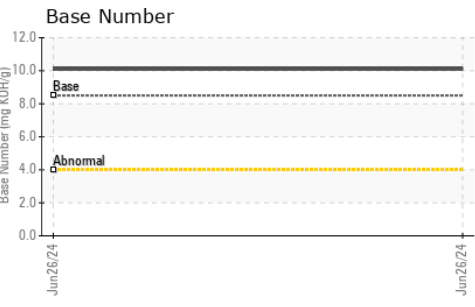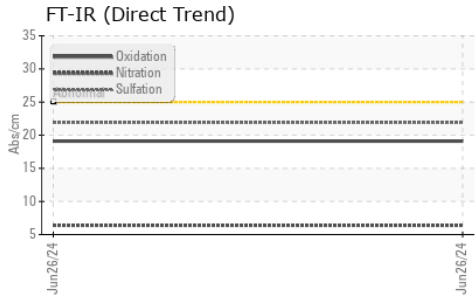

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP444536 **Received** : 01 Jul 2024
Lab Number : 06224275 **Tested** : 02 Jul 2024
Unique Number : 11102472 **Diagnosed** : 02 Jul 2024 - Jonathan Hester
Test Package : MOB 1 (Additional Tests: KV40, TBN)

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)