

#### Area [HERC RENTALS] Machine Id VOLVO L70H 625327 Component Transmission (Auto) Fluid

DEXRON III (--- GAL)

# RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm.

#### WEAR

All component wear rates are normal.

### CONTAMINATION

There is no indication of any contamination in the fluid.

# FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP444368		
Sample Date		Client Info		24 Jun 2024		
Machine Age	hrs	Client Info		662		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Filter Changed		Client Info		Not Changd		
Sample Status				NORMAL		
Iron			. 100	110		
Iron	ppm	ASTM D5185m	>160	116		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m	>5	<1		
Titanium	ppm	ASTM D5185m	~	<1		
Silver	ppm	ASTM D5185m	>5	<1		
Aluminum	ppm	ASTM D5185m	>50	3		
Lead	ppm	ASTM D5185m	>50	<1		
Copper	ppm	ASTM D5185m	>225	6		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m	NONE	<1		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>20	11		
Potassium	ppm	ASTM D5185m	>20	3		
Water		WC Method	>0.1	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
		40TH DE105		•		
Sodium	ppm	ASTM D5185m		2		
Boron	ppm	ASTM D5185m		72		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		7		
Magnesium	ppm	ASTM D5185m		3		
Calcium	ppm	ASTM D5185m		72		
Phosphorus	ppm	ASTM D5185m		183		
Zinc	ppm	ASTM D5185m		36		
Sulfur	ppm	ASTM D5185m		1640		

# WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL


Visc @ 40°C


cSt

ASTM D445 35.0

Contact/Location: KENNY HANEY - VOLVO0093

28.6

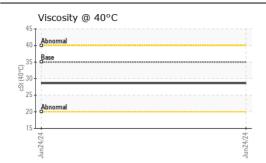

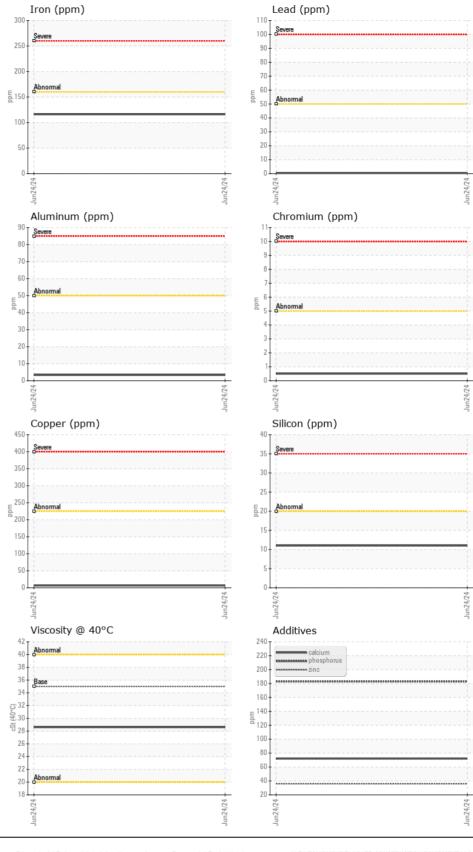

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP444368 : 01 Jul 2024 Lab Number : 06224916 Tested TAMPA, FL : 02 Jul 2024 Diagnosed Unique Number : 11103113 : 02 Jul 2024 - Wes Davis US 33619 Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

P

Contact/Location: KENNY HANEY - VOLVO0093