



PacLease

OIL ANALYSIS REPORT

| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
8574051
 Component
Diesel Engine
 Fluid
CHEVRON DELO 400 SAE 10W30 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | RPL0019052 | RPL0014301 | RPL0014634 |
| Sample Date | | Client Info | | 18 Jun 2024 | 01 Mar 2024 | 14 Nov 2023 |
| Machine Age | hrs | Client Info | | 9162 | 8576 | 140184 |
| Oil Age | hrs | Client Info | | 0 | 0 | 0 |
| Filter Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Changed | | Client Info | | N/A | Not Changd | Not Changd |
| Filter Changed | | Client Info | | N/A | Not Changd | Not Changd |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >100 | 26 | 18 | 10 |
| Chromium | ppm | ASTM D5185m | >20 | 1 | 1 | <1 |
| Nickel | ppm | ASTM D5185m | >4 | 0 | <1 | 0 |
| Titanium | ppm | ASTM D5185m | | 0 | <1 | 0 |
| Silver | ppm | ASTM D5185m | >3 | 0 | <1 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 3 | 2 | 1 |
| Lead | ppm | ASTM D5185m | >40 | 6 | 3 | 0 |
| Copper | ppm | ASTM D5185m | >330 | <1 | 1 | <1 |
| Tin | ppm | ASTM D5185m | >15 | <1 | 1 | 0 |
| Vanadium | ppm | ASTM D5185m | | 0 | <1 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION









There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 6 | 6 | 4 |
| Potassium | ppm | ASTM D5185m | >20 | 4 | 5 | 4 |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >3 | 0.8 | 0.5 | 0.3 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 13.8 | 12.0 | 8.8 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 25.7 | 22.9 | 21.8 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

| | | | | | | |
|------------------|----------|-------------|------|--------------|------|------|
| Sodium | ppm | ASTM D5185m | | 2 | 2 | 1 |
| Boron | ppm | ASTM D5185m | | 18 | 24 | 33 |
| Barium | ppm | ASTM D5185m | | 0 | 2 | 3 |
| Molybdenum | ppm | ASTM D5185m | | 37 | 40 | 38 |
| Manganese | ppm | ASTM D5185m | | <1 | <1 | 0 |
| Magnesium | ppm | ASTM D5185m | | 516 | 525 | 502 |
| Calcium | ppm | ASTM D5185m | | 1596 | 1596 | 1561 |
| Phosphorus | ppm | ASTM D5185m | 1260 | 738 | 760 | 682 |
| Zinc | ppm | ASTM D5185m | 1400 | 888 | 900 | 870 |
| Sulfur | ppm | ASTM D5185m | | 2551 | 2621 | 2819 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 27.0 | 23.5 | 20.5 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 10.1 | 6.2 | 7.7 | 9.6 |
| Visc @ 100°C | cSt | ASTM D445 | 11.1 | 11.4 | 11.1 | 11.1 |

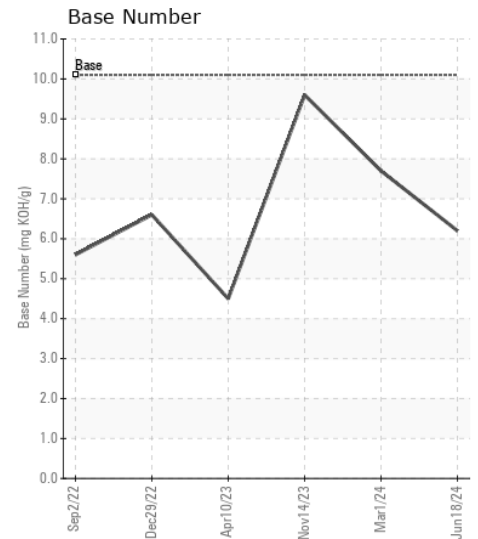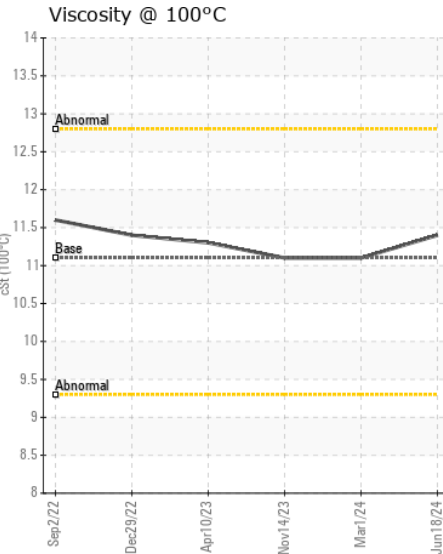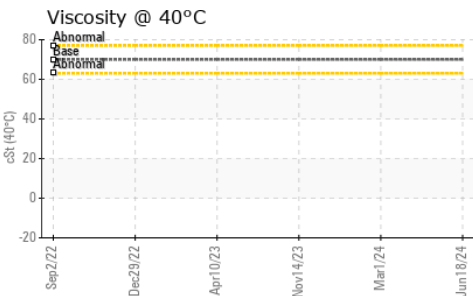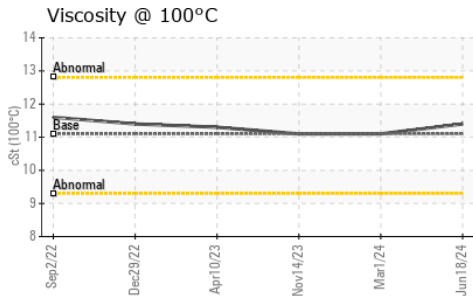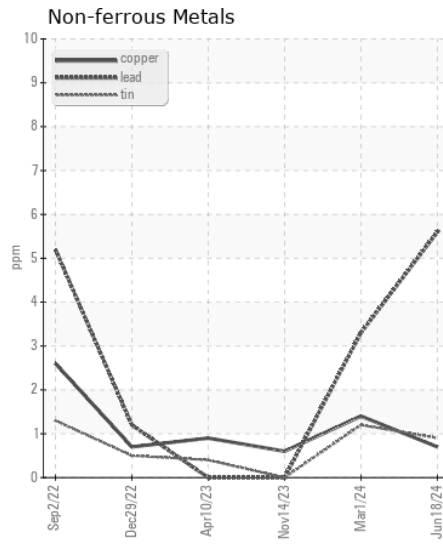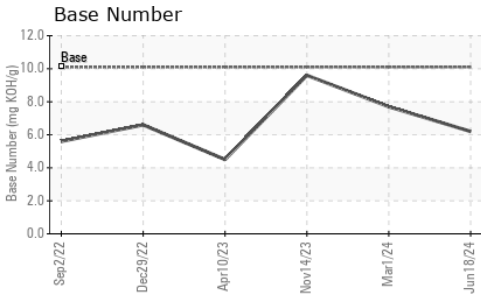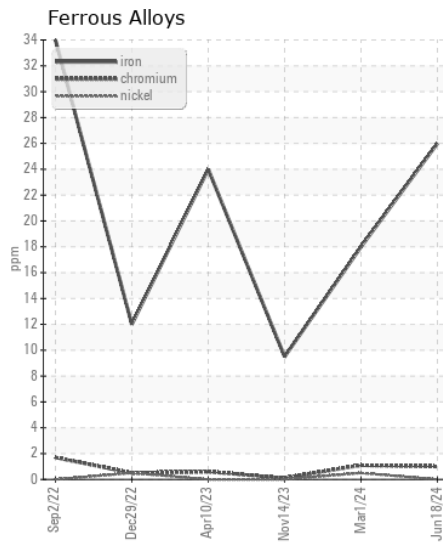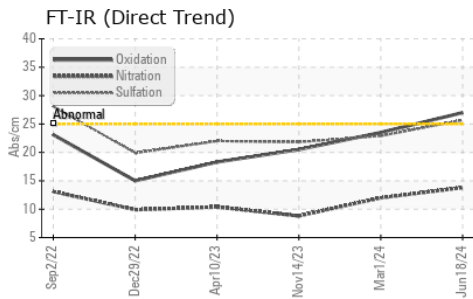

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RPL0019052 **Received** : 01 Jul 2024
Lab Number : 06225490 **Tested** : 03 Jul 2024
Unique Number : 11103687 **Diagnosed** : 03 Jul 2024 - Don Baldridge
Test Package : FLEET (Additional Tests: KV40)

RTL PACLEASE - 7001 - Houston
 6300 N. Loop East
 Houston, TX
 US 77026
 Contact: RODNEY BRIGGS
 briggs@rushenterprises.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)