**WEAR** CONTAMINATION **FLUID CONDITION** 

**NORMAL NORMAL NORMAL** 


Machine Id


1786


## Component Hydraulic System


## LEAHY WOLF LUBEMASTER HYDRAULIC OIL (50 GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		LW0009290		
	Sample Date		Client Info		28 Jun 2024		
	Machine Age	hrs	Client Info		143		
	Oil Age	hrs	Client Info		143		
	Filter Age	hrs	Client Info		143		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>20	1		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>10	0		
	Nickel	ppm	ASTM D5185m	>10	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>10	0		
	Lead	ppm	ASTM D5185m	>10	0		
	Copper	ppm	ASTM D5185m	>75	1		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	1		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		4		
	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m		64		
	Calcium	ppm	ASTM D5185m		43		
	Phosphorus	ppm	ASTM D5185m		298		
	Zinc	ppm	ASTM D5185m		371		
	Sulfur	ppm	ASTM D5185m		1097		
	Visc @ 40°C	cSt	ASTM D445		44.3		

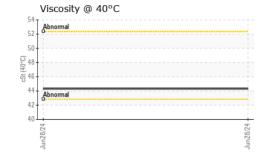

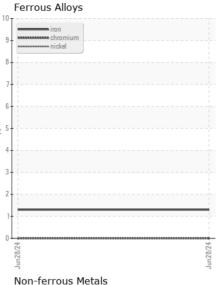

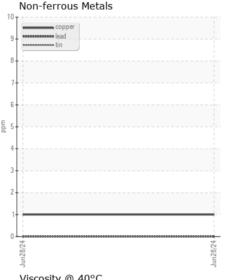

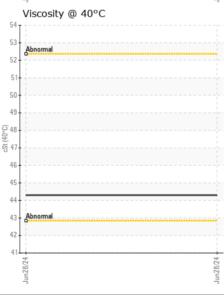



Certificate L2367

Laboratory Sample No.

: LW0009290 Lab Number : 06228006 Unique Number : 11111499 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 03 Jul 2024 **Tested** : 05 Jul 2024 Diagnosed

: 07 Jul 2024 - Don Baldridge

**K5 CONSTRUCTION CORPORATION** 6301 S EAST AVENUE

HODGKINS, IL US 60525

Contact: NOELLE TERRAULT noellet@k-five.net

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: