



PacLease

# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**8591860**  
 Component  
**Diesel Engine**  
 Fluid  
**MOBIL DELVAC 1300 SUPER 15W40 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>RPL0021249</b>	RPL0017255	RPL0013244
Sample Date		Client Info		<b>18 Jun 2024</b>	17 Jan 2024	27 Sep 2023
Machine Age	mls	Client Info		<b>41128</b>	31750	25087
Oil Age	mls	Client Info		<b>0</b>	0	0
Filter Age	mls	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>72</b>	15	5
Chromium	ppm	ASTM D5185m	>20	<b>1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	0	<1
Silver	ppm	ASTM D5185m	>3	<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>7</b>	4	2
Lead	ppm	ASTM D5185m	>40	<b>0</b>	0	<1
Copper	ppm	ASTM D5185m	>330	<b>3</b>	<1	<1
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION








There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>5</b>	4	6
Potassium	ppm	ASTM D5185m	>20	<b>7</b>	0	3
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>2.1</b>	0.9	0.1
Nitration	Abs/cm	*ASTM D7624	>20	<b>15.6</b>	10.6	5.9
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>29.3</b>	21.8	19.5
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>6</b>	0	2
Boron	ppm	ASTM D5185m	0	<b>79</b>	93	467
Barium	ppm	ASTM D5185m	0	<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185m	0	<b>101</b>	92	95
Manganese	ppm	ASTM D5185m		<b>1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	0	<b>597</b>	577	465
Calcium	ppm	ASTM D5185m		<b>1491</b>	1276	2255
Phosphorus	ppm	ASTM D5185m		<b>741</b>	746	1240
Zinc	ppm	ASTM D5185m		<b>863</b>	889	1660
Sulfur	ppm	ASTM D5185m		<b>2821</b>	2625	4662
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>29.3</b>	19.7	14.1
Base Number (BN)	mg KOH/g	ASTM D2896	9.4	<b>6.4</b>	6.8	8.3
Visc @ 100°C	cSt	ASTM D445	14	<b>14.4</b>	13.4	14.1

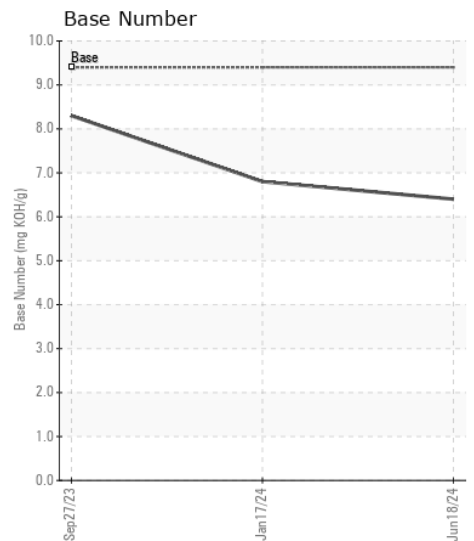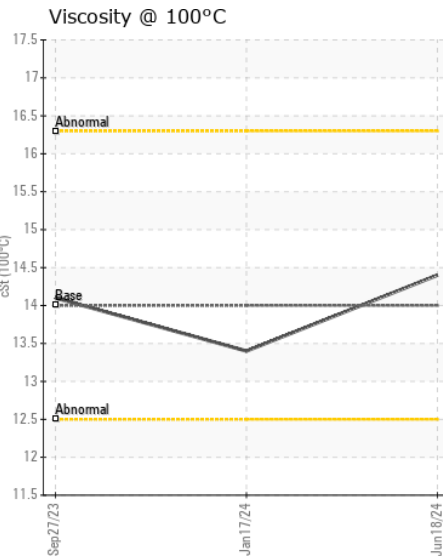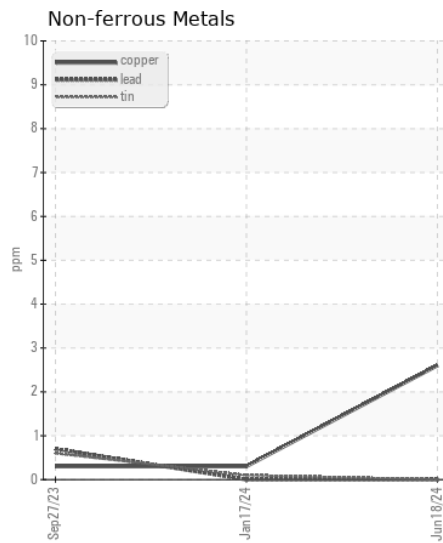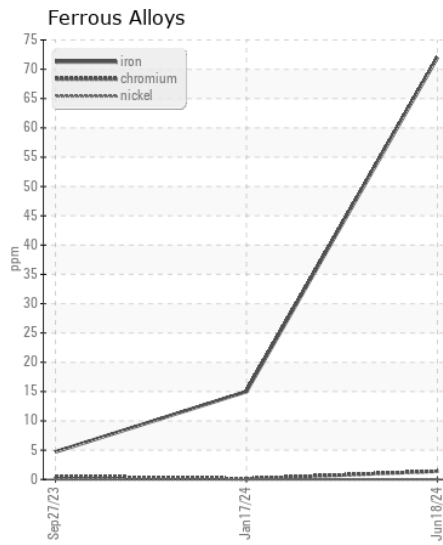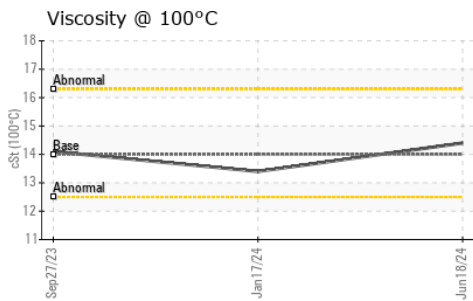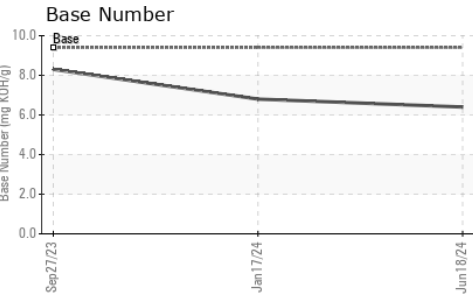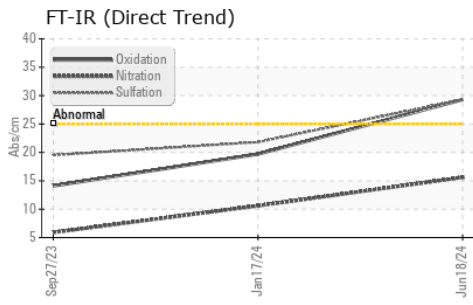

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513

**Sample No.** : RPL0021249

**Lab Number** : 06228358

**Unique Number** : 11111851

**Test Package** : FLEET

**Received** : 05 Jul 2024

**Tested** : 08 Jul 2024

**Diagnosed** : 08 Jul 2024 - Don Baldrige

**RTL PACLEASE - 7051 - Las Vegas**

4150 Arctic Spring Ave

North Las Vegas, NV

US 89115

Contact: Rudy Trevizo

TrevizoR@RushEnterprises.Com

T: (702)208-7164

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)