



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**VOLVO A25G 740250**  
Component  
**Hydraulic System**  
Fluid  
**VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP441000</b>	VCP398428	VCP445628
Sample Date		Client Info		<b>28 Jun 2024</b>	04 May 2024	22 Apr 2024
Machine Age	hrs	Client Info		<b>6651</b>	6452	6403
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	N/A	Not Changed
Filter Changed		Client Info		<b>Changed</b>	N/A	Not Changed
Sample Status				<b>NORMAL</b>	NORMAL	ATTENTION

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	<b>18</b>	17	15
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	<1	0
Nickel	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>&lt;1</b>	2	0
Lead	ppm	ASTM D5185m	>20	<b>2</b>	4	2
Copper	ppm	ASTM D5185m	>150	<b>8</b>	9	8
Tin	ppm	ASTM D5185m	>20	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	<b>7</b>	7	4
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	1	0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647		<b>5686</b>	1619	10656
Particles >6µm		ASTM D7647	>5000	<b>1561</b>	297	3332
Particles >14µm		ASTM D7647	>160	<b>61</b>	48	255
Particles >21µm		ASTM D7647	>40	<b>7</b>	21	55
Particles >38µm		ASTM D7647	>10	<b>0</b>	1	1
Particles >71µm		ASTM D7647	>3	<b>0</b>	1	0
Oil Cleanliness		ISO 4406 (c)	>-/19/14	<b>20/18/13</b>	18/15/13	21/19/15
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>LIGHT</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>3</b>	0	2
Boron	ppm	ASTM D5185m	14	<b>&lt;1</b>	0	0
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	2	1
Manganese	ppm	ASTM D5185m	0.0	<b>0</b>	<1	0
Magnesium	ppm	ASTM D5185m	2.6	<b>5</b>	6	4
Calcium	ppm	ASTM D5185m	49	<b>82</b>	86	82
Phosphorus	ppm	ASTM D5185m	354	<b>324</b>	363	331
Zinc	ppm	ASTM D5185m	419	<b>405</b>	427	411
Sulfur	ppm	ASTM D5185m	3719	<b>3944</b>	4127	4139
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.41</b>	0.43	0.45
Visc @ 40°C	cSt	ASTM D445	46	<b>44.1</b>	44.2	44.3

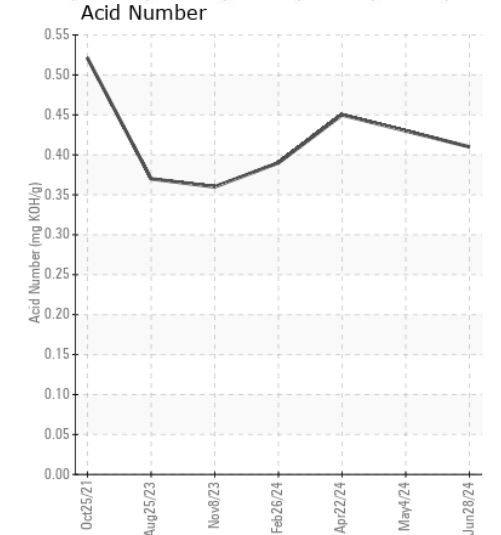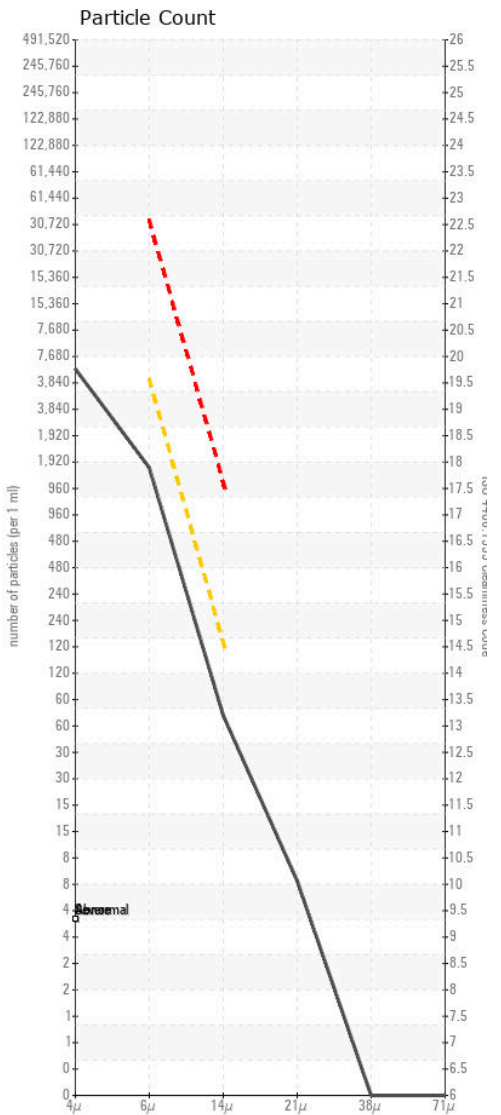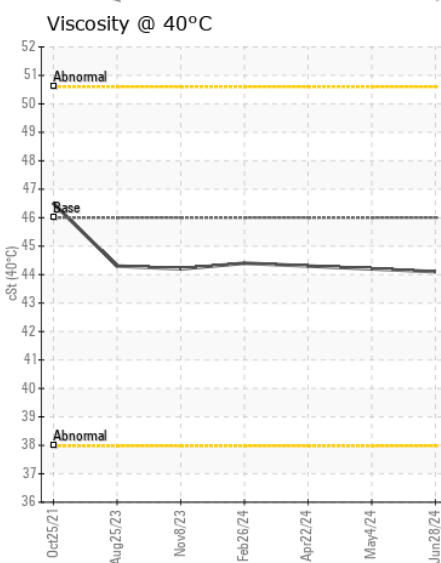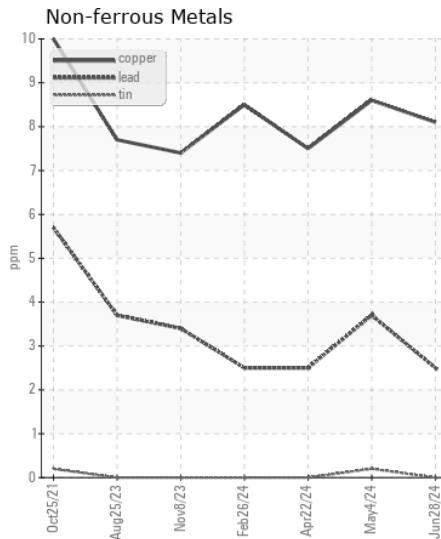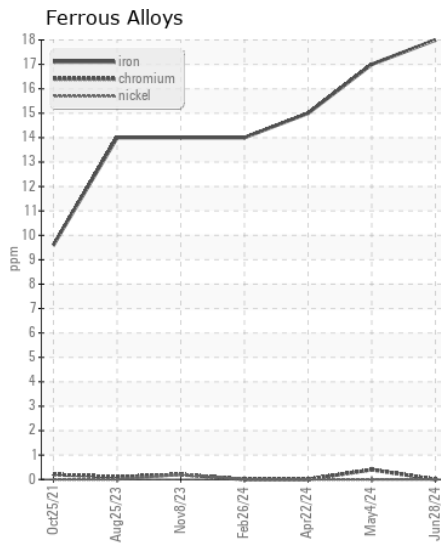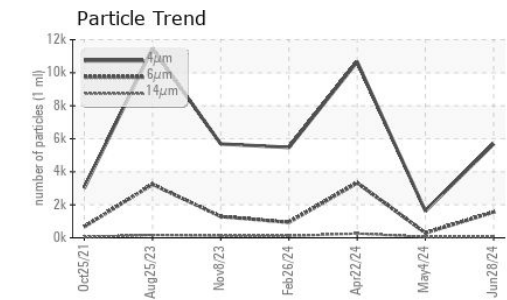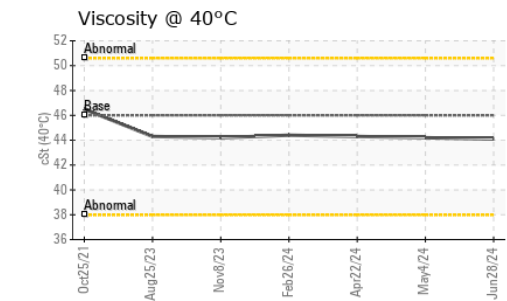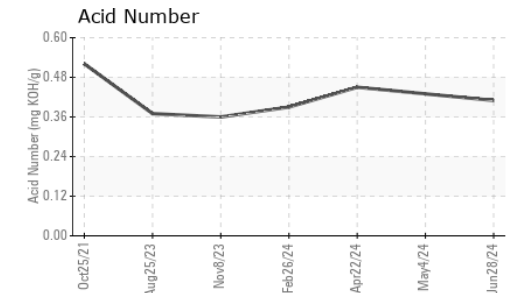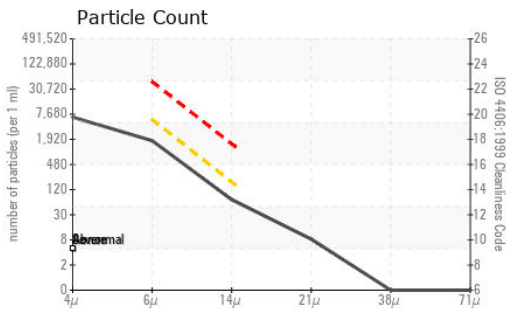

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP441000  
**Lab Number** : 06230103  
**Unique Number** : 11113596  
**Test Package** : MOB 2

**Received** : 08 Jul 2024  
**Tested** : 09 Jul 2024  
**Diagnosed** : 09 Jul 2024 - Wes Davis

**ALTA EQUIPMENT COMPANY**  
 5151 DR MARTIN LUTHER KING BLVD  
 FORT MYERS, FL  
 US 33905  
 Contact: TODD LARK  
 tlark@altaequipfl.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
 F: (239)481-3302