



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area

[TMR]

Machine Id

VOLVO L120H 3531

Component

Front Axle

Fluid

VOLVO WET BRAKE TRANSAXLE OIL (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP438842	---	---
Sample Date		Client Info		27 Jun 2024	---	---
Machine Age	hrs	Client Info		836	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changed	---	---
Filter Changed		Client Info		Not Changed	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	58	---	---
Chromium	ppm	ASTM D5185m	>20	1	---	---
Nickel	ppm	ASTM D5185m	>10	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>30	1	---	---
Lead	ppm	ASTM D5185m	>50	1	---	---
Copper	ppm	ASTM D5185m	>120	4	---	---
Tin	ppm	ASTM D5185m	>20	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION









There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	12	---	---
Potassium	ppm	ASTM D5185m	>20	4	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	*Visual	NONE	LIGHT	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		3	---	---
Boron	ppm	ASTM D5185m	100	126	---	---
Barium	ppm	ASTM D5185m	0	0	---	---
Molybdenum	ppm	ASTM D5185m	0	1	---	---
Manganese	ppm	ASTM D5185m		2	---	---
Magnesium	ppm	ASTM D5185m	0	11	---	---
Calcium	ppm	ASTM D5185m	3800	4223	---	---
Phosphorus	ppm	ASTM D5185m	1200	1499	---	---
Zinc	ppm	ASTM D5185m	1500	1744	---	---
Sulfur	ppm	ASTM D5185m	6500	4920	---	---
Visc @ 40°C	cSt	ASTM D445	52.0	41.8	---	---

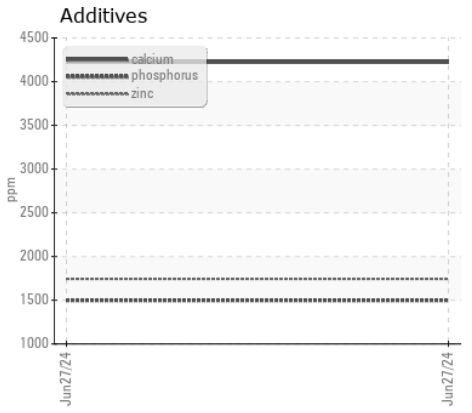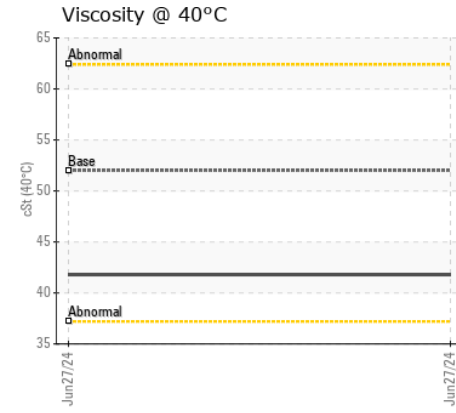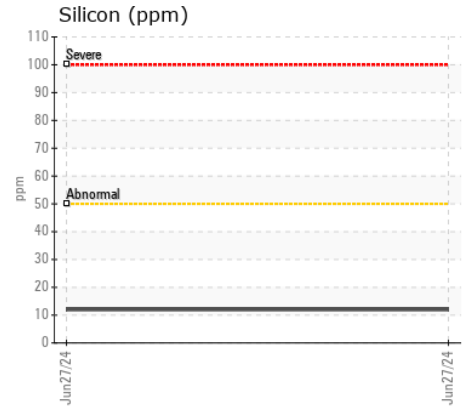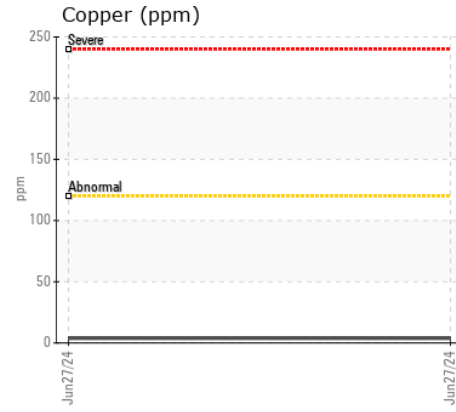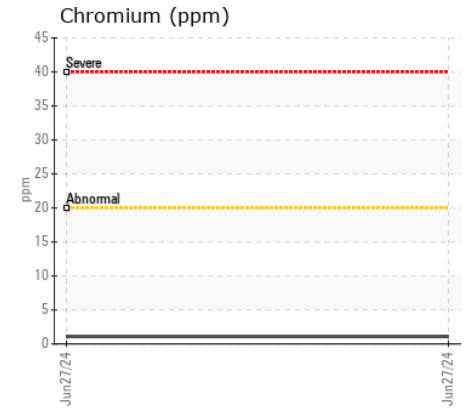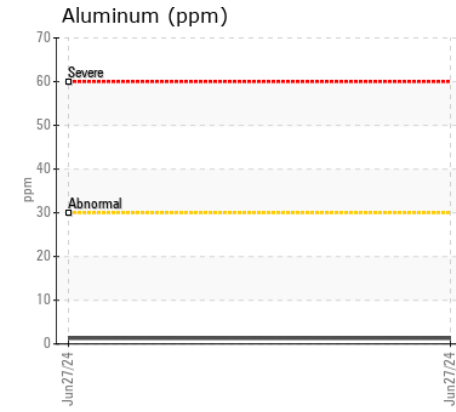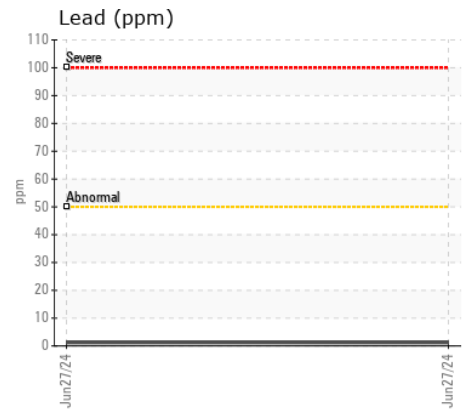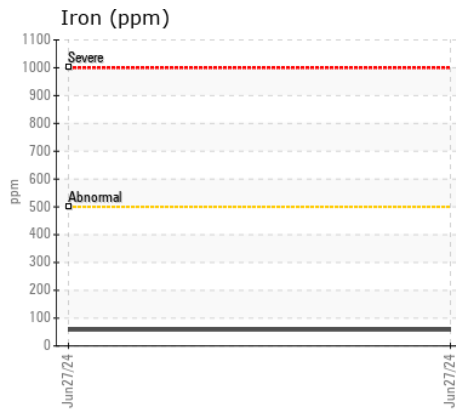

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP438842
Lab Number : 06230549
Unique Number : 11114042
Test Package : MOB 1

Received : 08 Jul 2024
Tested : 10 Jul 2024
Diagnosed : 10 Jul 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)