



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area

**[W9142]**

Machine Id

**JOHN DEERE 444H DW444JZ610229**

Component

**Front Axle**

Fluid

**JOHN DEERE HY-GARD HYD/TRANS (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor. ( Customer Sample Comment: W9142 )

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0224034</b>	---	---
Sample Date		Client Info		<b>03 Jul 2024</b>	---	---
Machine Age	hrs	Client Info		<b>24232</b>	---	---
Oil Age	hrs	Client Info		<b>24232</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Changd</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

PQ	UOM	Method	Limit/Abn	Current	History1	History2
PQ		ASTM D8184		<b>52</b>	---	---
Iron	ppm	ASTM D5185m	>750	<b>237</b>	---	---
Chromium	ppm	ASTM D5185m	>11	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>21	<b>&lt;1</b>	---	---
Lead	ppm	ASTM D5185m	>49	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>101	<b>3</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>31	<b>5</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m	>51	<b>4</b>	---	---
Boron	ppm	ASTM D5185m	6	<b>2</b>	---	---
Barium	ppm	ASTM D5185m	0	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m	0	<b>2</b>	---	---
Manganese	ppm	ASTM D5185m		<b>3</b>	---	---
Magnesium	ppm	ASTM D5185m	145	<b>89</b>	---	---
Calcium	ppm	ASTM D5185m	3570	<b>3269</b>	---	---
Phosphorus	ppm	ASTM D5185m	1290	<b>1039</b>	---	---
Zinc	ppm	ASTM D5185m	1640	<b>1161</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>3796</b>	---	---
Visc @ 40°C	cSt	ASTM D445	57.0	<b>50.1</b>	---	---

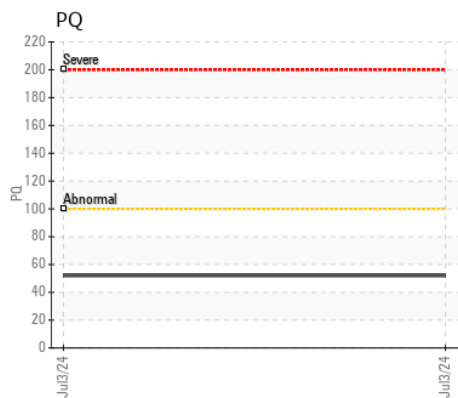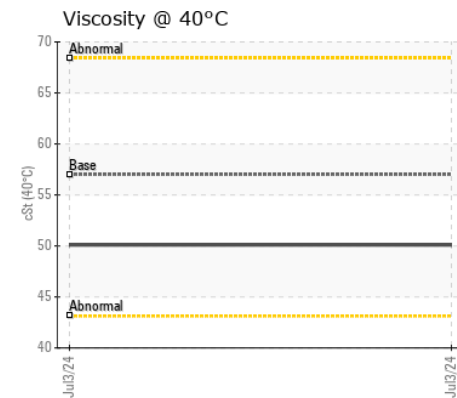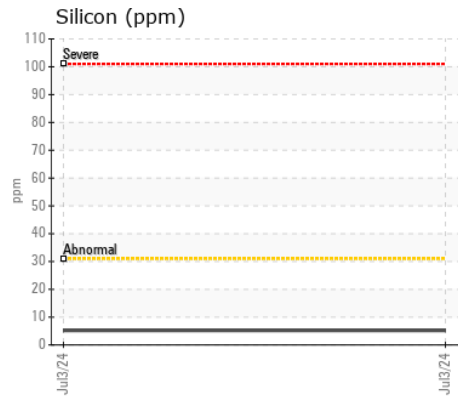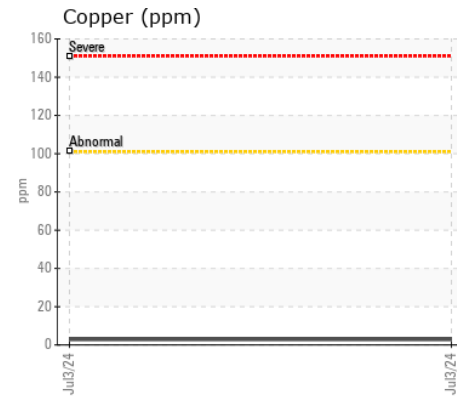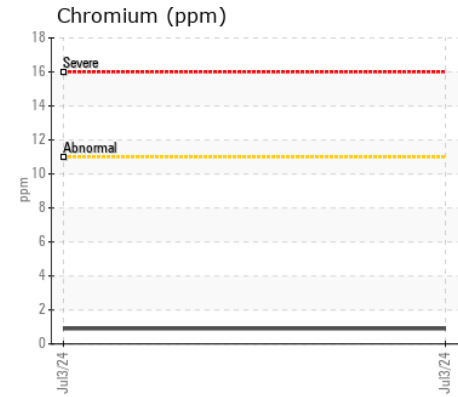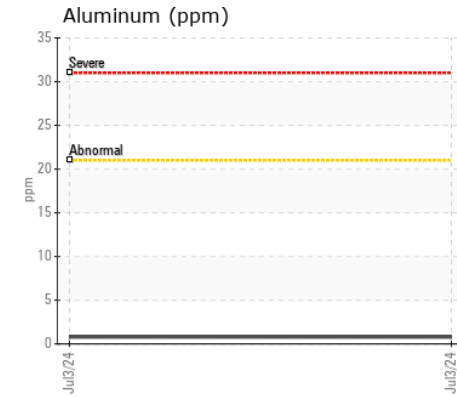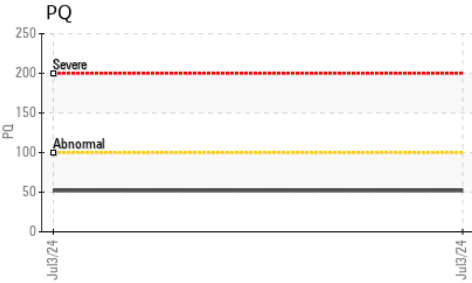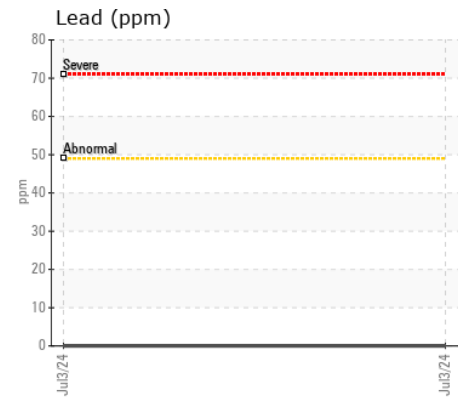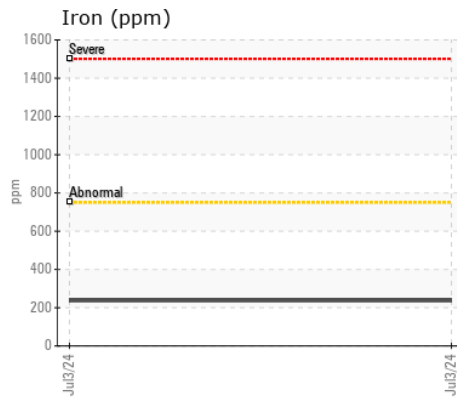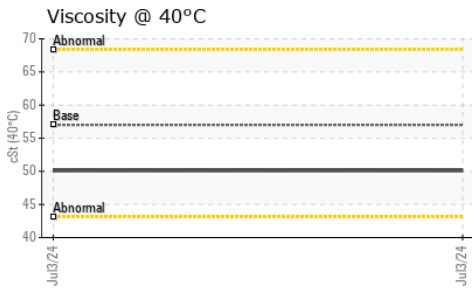

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513

**Sample No.** : JR0224034

**Lab Number** : 06231659

**Unique Number** : 11115152

**Test Package** : MOBCE ( Additional Tests: PQ )

**Received** : 09 Jul 2024

**Tested** : 10 Jul 2024

**Diagnosed** : 11 Jul 2024 - Don Baldridge

**JRE - HOPE MILLS/FAYETTEVILLE**

5039 HWY 301 SOUTH

HOPE MILLS, NC

US 28348

Contact: Justin Jackson

Justin.Jackson@jamesriverequipment.com

T:

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)