WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL


Machine Id


LTI TRUCK 911 (S/N 0104222) Component Hydraulic System


AW HYDRAIII IC OIL ISO 46 (-

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number	OOW	Client Info	LITTIQ/ QIT	WC0938802		
Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) AW HYDRAULIC OIL ISO 46. Please confirm.	Sample Date		Client Info		29 Jun 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed	1110	Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>20	<1		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	0		
	Nickel	ppm	ASTM D5185m	>20	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>20	0		
	Lead	ppm	ASTM D5185m	>20	0		
	Copper	ppm	ASTM D5185m	>20	5		
	Tin	ppm	ASTM D5185m	>20	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>15	1		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	0		
	Water		WC Method	>0.05	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.05	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	5	0		
	Barium	ppm	ASTM D5185m	5	0		
	Molybdenum	ppm	ASTM D5185m	5	<1		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m	25	<1		
	Calcium	ppm	ASTM D5185m	200	35		
	Phosphorus	ppm	ASTM D5185m	300	237		
	Zinc	ppm	ASTM D5185m	370	296		
	Sulfur	ppm	ASTM D5185m	2500	4092		
	Visc @ 40°C	cSt	ASTM D445	16	46.9		

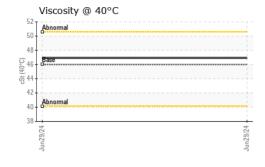

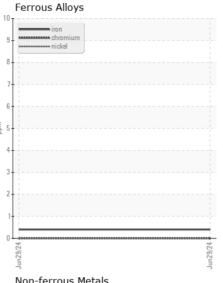

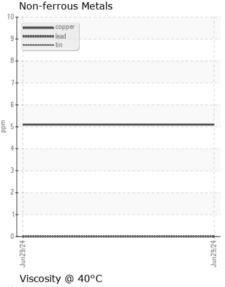

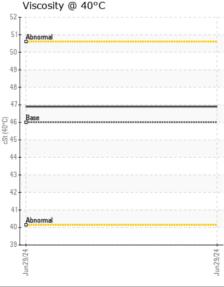





Certificate L2367

Laboratory Sample No.

: WC0938802 Lab Number : 06233693 Unique Number : 11117186 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Jul 2024 **Tested** : 12 Jul 2024

Diagnosed

: 12 Jul 2024 - Wes Davis

INVESTMENT RECOVERY CORP

4329 SE I-1440 FRONTAGE RD SEALY, TX

US 77474

Contact: ZEEV KOFMON

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: